

# Liner Inspection

Remediation Activities: Standing fluids were recovered via vac truck. Liner maintained integrity. This spill happened from a temporary frac tank and this is a temporary secondary containment.



