

Submit 3 Copies To Appropriate District Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

RECEIVED
State of New Mexico
Energy, Minerals and Natural Resources
March 27 2004

Form C-103
Revised May 08, 2003

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30 - 015 - 27909
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. E - 5894
7. Lease Name or Unit Agreement Name REMUDA BASIN "24" STATE
8. Well Number 2
9. OGRID Number 2433
10. Pool name or Wildcat NASH DRAW BRUSHY CANYON

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
Oil Well ☒ Gas Well ☐ Other ☐

2. Name of Operator
BK EXPLORATION CORP.

3. Address of Operator
1019A E 11TH ST. STE 401 TULSA, OK 74120

4. Well Location
Unit Letter A : 330 feet from the NORTH line and 330 feet from the EAST line
Section 24 Township 23-S Range 29-E NMPM County EDDY

11. Elevation (Show whether DR, RKB, RT, GR, etc.)
3008' GR

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

REFER TO ATTACHED PROCEDURE.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Brad D Burks TITLE PRESIDENT DATE 5-24-2004

Type or print name BRAD D. BURKS 918-582-3855 Telephone No.

(This space for State use)

APPROVED BY Mike Gratcher TITLE Compliance Officer DATE 6/2/04

Conditions of approval, if any: Notify OED 24 Hrs. prior to commence operations
C-144 for pit approval required prior to pit construction
WOC 24 Hrs. on surface plug & top off if necessary
Prior to setting PIA Marker

ABANDONMENT PROCEDURE

Remuda Basin "24" State No. 2

NE/NE/4 Section 24 T23S R29E
Eddy County, New Mexico

1. Rig up pulling unit. Notify NMOCD @ 505-748-1283. Fabricate abandonment marker. *24 Hrs. prior to commence operation*
2. Deliver rental tanks, racks, and 2-7/8" tubing.
3. With backhoe, dig small work-over pit, to north of wellhead. *C-144 approval required prior to pit construction*
4. Remove wellhead. By wire-line, detonate primer cord charge in 5 1/2" casing at collar located at 6116'.
5. Pull and remove 6116' of 5 1/2" casing from well, and set onto racks. Truck casing to inspection shop.
6. Tally 2-7/8" tubing. Lower tubing down well to 6865'. Spot brine gel up to 6166'.
7. Spot 100' cement plug @ 6166' up to 6066'. Wait on cement (woc). Tag plug.
8. Load well with brine gel up to 4200'. Spot 100' cement plug @ 4200' up to 4100'.
9. Load well with brine gel up to 3235'. Spot 100' cement plug @ 3235' up to 3135', across 8-5/8" casing shoe. WOC. Tag plug.
10. Load well with brine gel up to 3060'. In steps, fill 8-5/8" casing with cement, up to surface. *WOC 24 hrs to top off as needed*
11. Install abandonment marker. Rig down pulling unit. Cut off 4 location anchors and electric panel. Clean location.

BEFORE P&A

AFTER P&A

BK EXPLORATION CORP.
REMUDA BASIN "24" #2
NE/4 NE/4 SEC 24-23S-29E
EDDY CO., NEW MEXICO
KB = 13' AGL
1-20-2004

