Submit 3 Copies To Appropriate District Office	State of New Mexico		Form C-103		
District I	Energy, Minerals	and Natu	ral Resources		March 4, 2004
1625 N. French Dr., Hobbs, NM 88240			WELL API NO.		
<u>District II</u> 1301 W. Grand Ave., Artesia, NM 88210	OIL CONSERVATION DIVISION			30 005 63263	
District III	1220 South St. Francis Dr.		5. Indicate Type		
1000 Rio Brazos Rd., Aztec, NM 87410	Santa Fe, NM 87505		STATE	7	
<u>District IV</u> 1220 S. St. Francis Dr., Santa Fe, NM	Salita PC	5, INIVI 0 /	303	6. State Oil & G	as Lease No.
87505				26232	
SUNDRY NOTION	CES AND REPORTS OF	N WELLS		7. Lease Name of	or Unit Agreement Name
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)			JG BACK TO A OR SUCH	Willow Springs "	
1. Type of Well:				8. Well Number	
Oil Well Gas Well	Other	1	RECEIVED	1	
2. Name of Operator			HECEIVED	9. OGRID Numl	
Reliance Energy, Inc.			APR 2 2 2004	9. OGRID Numi 149441	ber
3. Address of Operator				10. Pool name of	r Wildcat
	Desta Drive, Ste 5500, Midland, Tx 79705		CD-ARTESIA	Pecos Slope Abo	
4. Well Location	117703			1 ccos biope 71	
4. Well Location					
Unit LetterL_:	1980 feet from the	Sout	ı line and 6	i60 feet from	n the West line
Oint Better	17001000 Holli tile _	5000		icci mor	in thewestime
Section 27	Township	4S	Range 25E	NMPM Chave	es County
	11. Elevation (Show wh				
	3797' GR		1412, 111, 011, 010.)		
Pit or Below-grade Tank Application (For		ures, a form	C-144 must be attache	<u>d)</u>	
Pit Location: ULSectTwp_	Rng Pit type	D	enth to Groundwater	Distance from n	earest fresh water well
Distance from nearest surface water					
			Scct1wp	Kiig	'
feet from theline and	feet from the	line			
					
12. Check A NOTICE OF IN PERFORM REMEDIAL WORK				SEQUENT RE	
NOTICE OF IN PERFORM REMEDIAL WORK	TENTION TO:		SUB REMEDIAL WOR	SEQUENT RE	EPORT OF: ALTERING CASING PLUG AND x
NOTICE OF IN PERFORM REMEDIAL WORK	TENTION TO: PLUG AND ABANDON CHANGE PLANS MULTIPLE	· 🗆	SUB REMEDIAL WOR COMMENCE DRI	SEQUENT RE	EPORT OF: ALTERING CASING [
NOTICE OF IN PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING	TENTION TO: PLUG AND ABANDON CHANGE PLANS		SUB REMEDIAL WOR COMMENCE DRI CASING TEST AN CEMENT JOB	SEQUENT RE K \	EPORT OF: ALTERING CASING PLUG AND x ABANDONMENT
NOTICE OF IN PERFORM REMEDIAL WORK	TENTION TO: PLUG AND ABANDON CHANGE PLANS MULTIPLE		SUB REMEDIAL WOR COMMENCE DRI	SEQUENT RE K \	EPORT OF: ALTERING CASING PLUG AND x
NOTICE OF IN PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 13. Describe proposed or comp	TENTION TO: PLUG AND ABANDON CHANGE PLANS MULTIPLE COMPLETION	y state all	SUB REMEDIAL WOR COMMENCE DRI CASING TEST AI CEMENT JOB OTHER: pertinent details, and	SEQUENT RE K	EPORT OF: ALTERING CASING PLUG AND x ABANDONMENT
NOTICE OF IN PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 13. Describe proposed or compof starting any proposed wo	TENTION TO: PLUG AND ABANDON CHANGE PLANS MULTIPLE COMPLETION leted operations. (Clearly rk). SEE RULE 1103.	y state all	SUB REMEDIAL WOR COMMENCE DRI CASING TEST AI CEMENT JOB OTHER: pertinent details, and	SEQUENT RE K	PORT OF: ALTERING CASING PLUG AND x ABANDONMENT tes, including estimated date
NOTICE OF IN PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 13. Describe proposed or compof starting any proposed woor recompletion.	TENTION TO: PLUG AND ABANDON CHANGE PLANS MULTIPLE COMPLETION leted operations. (Clearly rk). SEE RULE 1103. I	y state all	SUB REMEDIAL WOR COMMENCE DRI CASING TEST AN CEMENT JOB OTHER: pertinent details, and le Completions: At	SEQUENT RE K	PORT OF: ALTERING CASING PLUG AND x ABANDONMENT tes, including estimated date tram of proposed completion
NOTICE OF IN PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 13. Describe proposed or compof starting any proposed woor recompletion. 4/13/04: RU rig & PA equipment. 4/14/04: POH w/111 jts of tbg. RU w/sinker bar. TIH w/tbg to 3600'. Sinker bar.	TENTION TO: PLUG AND ABANDON CHANGE PLANS MULTIPLE COMPLETION leted operations. (Clearly rk). SEE RULE 1103. I NU BOP. SWIFN. Wireline to set CIBP @ Spot 25 sxs cmt. WOC &	y state all properties of the	SUB REMEDIAL WOR COMMENCE DRI CASING TEST AT CEMENT JOB OTHER: pertinent details, and le Completions: At CIBP would not go p 14'. Circ hole w/1	SEQUENT RE K	PORT OF: ALTERING CASING PLUG AND x ABANDONMENT tes, including estimated date tram of proposed completion //sinker bar to 3610'. POH
NOTICE OF IN PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 13. Describe proposed or compof starting any proposed woor recompletion. 4/13/04: RU rig & PA equipment. 4/14/04: POH w/111 jts of tbg. RU w/sinker bar. TIH w/tbg to 3600'. Semove 5-1/2" csg slip. Work 5-1/2	TENTION TO: PLUG AND ABANDON CHANGE PLANS MULTIPLE COMPLETION Leted operations. (Clearly rk). SEE RULE 1103. If the control of the control o	y state all properties of the	SUB REMEDIAL WOR COMMENCE DRI CASING TEST AN CEMENT JOB OTHER: pertinent details, and le Completions: At CIBP would not go p 14'. Circ hole w/1 0 4 jts of 5-1/2". SI	SEQUENT RE K	PORT OF: ALTERING CASING PLUG AND x ABANDONMENT tes, including estimated date tram of proposed completion /sinker bar to 3610'. POH //tbg. ND BOP & well head.
NOTICE OF IN PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 13. Describe proposed or compostarting any proposed woor recompletion. 4/13/04: RU rig & PA equipment. 4/14/04: POH w/111 jts of tbg. RU w/sinker bar. TIH w/tbg to 3600'. Semove 5-1/2" csg slip. Work 5-1/2 4/15/04: LD 5-1/2" csg. GIH to 304	TENTION TO: PLUG AND ABANDON CHANGE PLANS MULTIPLE COMPLETION Leted operations. (Clearly rk). SEE RULE 1103. If NU BOP. SWIFN. Wireline to set CIBP @ Logot 25 sxs cmt. WOC & Logot 25 cut @ 2990'. If T'. Spot 30 sxs cmt. WOC	y state all; For Multip 3610'. Ct tag @ 34 POH & LI OC & tag (SUB REMEDIAL WOR COMMENCE DRI CASING TEST AT CEMENT JOB OTHER: pertinent details, and le Completions: At CIBP would not go p 14'. Circ hole w/1 0 4 jts of 5-1/2". SI 20 2900'. Spot 30 s	SEQUENT RE K	PORT OF: ALTERING CASING PLUG AND x ABANDONMENT tes, including estimated date tram of proposed completion /sinker bar to 3610'. POH //tbg. ND BOP & well head.
NOTICE OF IN PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 13. Describe proposed or compof starting any proposed woor recompletion. 4/13/04: RU rig & PA equipment. 4/14/04: POH w/111 jts of tbg. RU w/sinker bar. TIH w/tbg to 3600'. Semove 5-1/2" csg slip. Work 5-1/2	TENTION TO: PLUG AND ABANDON CHANGE PLANS MULTIPLE COMPLETION Leted operations. (Clearly rk). SEE RULE 1103. If NU BOP. SWIFN. Wireline to set CIBP @ Logot 25 sxs cmt. WOC & Logot 25 cut @ 2990'. If T'. Spot 30 sxs cmt. WOC	y state all; For Multip 3610'. Ct tag @ 34 POH & LI OC & tag (SUB REMEDIAL WOR COMMENCE DRI CASING TEST AT CEMENT JOB OTHER: pertinent details, and le Completions: At CIBP would not go p 14'. Circ hole w/1 0 4 jts of 5-1/2". SI 20 2900'. Spot 30 s	SEQUENT RE K	PORT OF: ALTERING CASING PLUG AND x ABANDONMENT tes, including estimated date tram of proposed completion /sinker bar to 3610'. POH //tbg. ND BOP & well head.
NOTICE OF IN PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 13. Describe proposed or compostarting any proposed woor recompletion. 4/13/04: RU rig & PA equipment. 4/14/04: POH w/111 jts of tbg. RU w/sinker bar. TIH w/tbg to 3600'. SRemove 5-1/2" csg slip. Work 5-1/2 4/15/04: LD 5-1/2" csg. GIH to 304 33 sxs cmt @ 1600' to 1500'. Spot 3	TENTION TO: PLUG AND ABANDON CHANGE PLANS MULTIPLE COMPLETION Reted operations. (Clearly rk). SEE RULE 1103. If the set CIBP (as a set CIBP	y state all; For Multip 3610'. C tag @ 34 POH & LI OC & tag (OC & tag (SUB REMEDIAL WOR COMMENCE DRI CASING TEST AI CEMENT JOB OTHER: pertinent details, and le Completions: At CIBP would not go p 14'. Circ hole w/1 0 4 jts of 5-1/2". SI @ 2900'. Spot 30 s. @ 920'. Spot 25 sxi	SEQUENT RE K	PORT OF: ALTERING CASING PLUG AND x ABANDONMENT tes, including estimated date tram of proposed completion //sinker bar to 3610'. POH //tbg. ND BOP & well head. WOC & tag @ 1898'. Spot f. RD rig.
NOTICE OF IN PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 13. Describe proposed or compostarting any proposed woor recompletion. 4/13/04: RU rig & PA equipment. 4/14/04: POH w/111 jts of tbg. RU w/sinker bar. TIH w/tbg to 3600'. SRemove 5-1/2" csg slip. Work 5-1/2 4/15/04: LD 5-1/2" csg. GIH to 304 33 sxs cmt @ 1600' to 1500'. Spot 31	TENTION TO: PLUG AND ABANDON CHANGE PLANS MULTIPLE COMPLETION Reted operations. (Clearly rk). SEE RULE 1103. If the set CIBP (a) and t	y state all: For Multip 3610'. C tag @ 34 POH & LI OC & tag (Coc & tag (Coc & tag (SUB REMEDIAL WOR COMMENCE DRI CASING TEST AT CEMENT JOB OTHER: pertinent details, and le Completions: At CIBP would not go p 14'. Circ hole w/1 0 4 jts of 5-1/2". SI @ 2900'. Spot 30 s. @ 920'. Spot 25 sxi est of my knowledge	SEQUENT RE K	PORT OF: ALTERING CASING PLUG AND x ABANDONMENT tes, including estimated date tram of proposed completion //sinker bar to 3610'. POH //tbg. ND BOP & well head. WOC & tag @ 1898'. Spot f. RD rig. ther certify that any pit or below-
NOTICE OF IN PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 13. Describe proposed or compostarting any proposed woor recompletion. 4/13/04: RU rig & PA equipment. 4/14/04: POH w/111 jts of tbg. RU w/sinker bar. TIH w/tbg to 3600'. SRemove 5-1/2" csg slip. Work 5-1/2 4/15/04: LD 5-1/2" csg. GIH to 304 33 sxs cmt @ 1600' to 1500'. Spot 3	TENTION TO: PLUG AND ABANDON CHANGE PLANS MULTIPLE COMPLETION Reted operations. (Clearly rk). SEE RULE 1103. If the set CIBP (a) and t	y state all: For Multip 3610'. C tag @ 34 POH & LI OC & tag (Coc & tag (Coc & tag (SUB REMEDIAL WOR COMMENCE DRI CASING TEST AT CEMENT JOB OTHER: pertinent details, and le Completions: At CIBP would not go p 14'. Circ hole w/1 0 4 jts of 5-1/2". SI @ 2900'. Spot 30 s. @ 920'. Spot 25 sxi est of my knowledge	SEQUENT RE K	PORT OF: ALTERING CASING PLUG AND x ABANDONMENT tes, including estimated date tram of proposed completion //sinker bar to 3610'. POH //tbg. ND BOP & well head. WOC & tag @ 1898'. Spot f. RD rig. ther certify that any pit or below-
NOTICE OF IN PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 13. Describe proposed or compostarting any proposed woor recompletion. 4/13/04: RU rig & PA equipment. 4/14/04: POH w/111 jts of tbg. RU w/sinker bar. TIH w/tbg to 3600'. SRemove 5-1/2" csg slip. Work 5-1/2 4/15/04: LD 5-1/2" csg. GIH to 304 33 sxs cmt @ 1600' to 1500'. Spot if the constructed or grade tank has been/will be constructed or	TENTION TO: PLUG AND ABANDON CHANGE PLANS MULTIPLE COMPLETION Leted operations. (Clearly rk). SEE RULE 1103. If the set CIBP (as pot 25 sxs cmt. WOC & as complete with the set CIBP (as	y state all; For Multip 3610'. C tag @ 34 POH & LI OC & tag (oc tag (SUB REMEDIAL WOR COMMENCE DRI CASING TEST AI CEMENT JOB OTHER: pertinent details, and le Completions: At CIBP would not go p 14'. Circ hole w/1 0 4 jts of 5-1/2". SI @ 2900'. Spot 30 s. @ 920'. Spot 25 sx: est of my knowledg \(\text{\tex{\tex	SEQUENT RE K	PORT OF: ALTERING CASING PLUG AND X ABANDONMENT tes, including estimated date tram of proposed completion //sinker bar to 3610'. POH //tbg. ND BOP & well head. WOC & tag @ 1898'. Spot f. RD rig. ther certify that any pit or below-relative OCD-approved plan
NOTICE OF IN PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 13. Describe proposed or comp of starting any proposed wo or recompletion. 4/13/04: RU rig & PA equipment. 4/14/04: POH w/111 jts of tbg. RU w/sinker bar. TIH w/tbg to 3600'. S Remove 5-1/2" csg slip. Work 5-1/2 4/15/04: LD 5-1/2" csg. GIH to 304 33 sxs cmt @ 1600' to 1500'. Spot: I hereby certify that the information grade tank has been/will be constructed or SIGNATURE	TENTION TO: PLUG AND ABANDON CHANGE PLANS MULTIPLE COMPLETION Reted operations. (Clearly rk). SEE RULE 1103. If the set CIBP (a) and t	y state all: For Multip 3610'. C t tag @ 34 POH & LI OC & tag (OC & tag (oct to the beguidelines for the second s	SUB REMEDIAL WOR COMMENCE DRI CASING TEST AND CEMENT JOB OTHER: pertinent details, and le Completions: At CIBP would not go provided the second secon	SEQUENT RE K	PORT OF: ALTERING CASING PLUG AND x ABANDONMENT tes, including estimated date tram of proposed completion //sinker bar to 3610'. POH //tbg. ND BOP & well head. WOC & tag @ 1898'. Spot f. RD rig. ther certify that any pit or below- relative OCD-approved plan DATE 4/21/04
NOTICE OF IN PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 13. Describe proposed or compostarting any proposed woor recompletion. 4/13/04: RU rig & PA equipment. 4/14/04: POH w/111 jts of tbg. RU w/sinker bar. TIH w/tbg to 3600'. SRemove 5-1/2" csg slip. Work 5-1/2 4/15/04: LD 5-1/2" csg. GIH to 304 33 sxs cmt @ 1600' to 1500'. Spot if the constructed or grade tank has been/will be constructed or	TENTION TO: PLUG AND ABANDON CHANGE PLANS MULTIPLE COMPLETION Reted operations. (Clearly rk). SEE RULE 1103. If the set CIBP (a) and t	y state all: For Multip 3610'. C t tag @ 34 POH & LI OC & tag (OC & tag (oct to the beguidelines for the second s	SUB REMEDIAL WOR COMMENCE DRI CASING TEST AND CEMENT JOB OTHER: pertinent details, and le Completions: At CIBP would not go provided the second secon	SEQUENT RE K	PORT OF: ALTERING CASING PLUG AND X ABANDONMENT tes, including estimated date tram of proposed completion //sinker bar to 3610'. POH //tbg. ND BOP & well head. WOC & tag @ 1898'. Spot f. RD rig. ther certify that any pit or below-relative OCD-approved plan
NOTICE OF IN PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 13. Describe proposed or comp of starting any proposed wo or recompletion. 4/13/04: RU rig & PA equipment. 4/14/04: POH w/111 jts of tbg. RU w/sinker bar. TIH w/tbg to 3600'. S Remove 5-1/2" csg slip. Work 5-1/2 4/15/04: LD 5-1/2" csg. GIH to 304 33 sxs cmt @ 1600' to 1500'. Spot: I hereby certify that the information grade tank has been/will be constructed or SIGNATURE	TENTION TO: PLUG AND ABANDON CHANGE PLANS MULTIPLE COMPLETION Reted operations. (Clearly rk). SEE RULE 1103. If the set CIBP (a) and t	y state all: For Multip 3610'. C t tag @ 34 POH & LI OC & tag (OC & tag (oct to the beguidelines for the second s	SUB REMEDIAL WOR COMMENCE DRI CASING TEST AND CEMENT JOB OTHER: pertinent details, and le Completions: At CIBP would not go provided the second secon	SEQUENT RE K	PORT OF: ALTERING CASING PLUG AND x ABANDONMENT tes, including estimated date tram of proposed completion //sinker bar to 3610'. POH //tbg. ND BOP & well head. WOC & tag @ 1898'. Spot f. RD rig. ther certify that any pit or below- relative OCD-approved plan DATE 4/21/04
NOTICE OF IN PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 13. Describe proposed or compostarting any proposed woor recompletion. 4/13/04: RU rig & PA equipment. 4/14/04: POH w/111 jts of tbg. RU w/sinker bar. TIH w/tbg to 3600'. SRemove 5-1/2" csg slip. Work 5-1/2 4/15/04: LD 5-1/2" csg. GIH to 304 33 sxs cmt @ 1600' to 1500'. Spot in the system of the syste	TENTION TO: PLUG AND ABANDON CHANGE PLANS MULTIPLE COMPLETION Reted operations. (Clearly rk). SEE RULE 1103. If the set CIBP (as pot 25 sxs cmt. WOC & as complete with the set CIBP (as	y state all: For Multip 3610'. C t tag @ 34 POH & LI OC & tag (OC & tag (oct to the beguidelines for the second s	SUB REMEDIAL WOR COMMENCE DRI CASING TEST AND CEMENT JOB OTHER: pertinent details, and le Completions: At CIBP would not go provided the second secon	SEQUENT RE K	PORT OF: ALTERING CASING PLUG AND x ABANDONMENT tes, including estimated date tram of proposed completion //sinker bar to 3610'. POH //tbg. ND BOP & well head. WOC & tag @ 1898'. Spot f. RD rig. ther certify that any pit or below-reative OCD-approved plan DATE 4/21/04 432-683-4816



NEW MEXICO ENERGY, MINERALS and NATURAL RESOURCES DEPARTMENT

BILL RICHARDSON Governor

Joanna Prukop Cabinet Secretary **Acting Director Oil Conservation Division**

RECEIVED

MAY 2 1 2004

QQD:ADTECIA

4 May 2004

eee milesia
Reliance Energy 6 Desta Drive Ste 5500 Midland TX 79705
Form C-103 Report of Plugging for your Willow Spring 27 St 001 L-27-4-25 APJ 30-005-63263 Cannot be approved until an NMOCD representative has made an inspection of the location and found it to be cleared to comply with OCD rules and regulations. Please check each item in the space provided to indicate that the work has been accomplished and the location is ready for final inspection.
1. All pits have been filled and leveled.
2. Rat hole and cellar have been filled and leveled.
3. A steel marker 4" in diameter and approximately 4' above mean ground level has been set in concrete to mark the exact location of the plugged well. (Marker must have operator name, lease name, well number and location including quarter/quarter section or unit letter, section, township, range and API well ID number permanently welded, stamped or otherwise engraved into the metal marker.)
4. The location has been leveled as nearly as possible to original top ground contour and has been cleared of all junk and equipment.
5. The dead men and tie downs have been cut and removed.
6. If a one well lease or last remaining well on lease, the battery and burn pit locations have been leveled and cleared of all junk & equipment.
7. All environmental concerns have been addressed as per OCD guidelines.
The above are minimum requirements and no plugging bond will be cancelled until all locations for plugged and abandoned wells have been inspected and Form C-103 approved.
When all of the work outlined above has been done, please notify this office by completing, signing and returning this letter to us so that our representative will not have to make more than one trip to the location.
I certify that the above work has been done and the above-mentioned lease is ready for OCD inspection and approval.
Name Mule Bratcher Compliance Officer
Regulary Title Compliance Officer