Submit I Copy To Appropriate District Office	State of 1	New Me	xico		Form C-10	
<u>District I</u> – (575) 393-6161	Energy, Minerals	and Natu	ral Resources	WELL ADINO	Revised August 1, 20	)11
1625 N. French Dr., Hobbs, NM 88240  District II – (575) 748-1283				WELL API NO. 30-015-24962		
811 S. First St., Artesia, NM 88210				5. Indicate Type of Lease		
<u> </u>				STATE X FEE		
1000 Rio Brazos Rd., Aztec, NM 87410 <u>District IV</u> – (505) 476-3460  1220 S. St. Francis Dr., Santa Fe, NM  87505  1000 Rio Brazos Rd., Aztec, NM 87410  JUN 26 2013 Santa Fe, NM 87505				6. State Oil & Ga	is Lease No.	
SUNDRY NOTICES AND REPORTS ON WELLS				7. Lease Name or	r Unit Agreement Name	;
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)				Red Twelve State		
1. Type of Well: Oil Well X Gas Well  Other				8. Well Number	001	
2. Name of Operator State of New Marice formerly Marks and Garner				9. OGRID Number 14070		
State of New Mexico formerly Marks and Garner  3. Address of Operator				10. Pool name or Wildcat		
811 S. First Street Artesia, NM 88210				Cave GB SA		
4. Well Location		···				
Unit LetterN	•		line and		om theWestlin	e
Section 4	Township		Range 29E	NMPM	Eddy County	T-1747
	11. Elevation (Show wh	iether DR,	KKB, RI, GR, etc.)			
and the second of the second second second of the second of the second s	TOME PA			See control and a control and	PROBEET 11 19 19 19 19 19 19 19 19 19 19 19 19	e to each
12. Check	Appropriate Box to Inc	dicate Na	ature of Notice,	Report or Other	Data	
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:						
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK				_	ALTERING CASING	
TEMPORARILY ABANDON					P AND A X	
PULL OR ALTER CASING				1306		
	•	_			_	_
OTHER:  13. Describe proposed or con	anlated aparetions (Classic	u state all p	OTHER:	l give partinent deta	es including estimated	late
	work). SEE RULE 19.15.7.					iate
proposed completion or re				•		
	•					,
4/24/2013 MIRU. Rods we	ere stuck. Worked free and	POOH wit	th partial string. In	stalled BOP. Tubin	ng was stuck.	
Worked tubing free. POOH to rods and stripped remaining equipment OOH. Made scrapper run and set CIBP at 2905'. Attempted to circulate with mud. Did not circulate. Spotted 25 sx on top of CIBP. Picked up packer and						
Would not test b	elow 1800'. SION					
RIH to tag. Tagged CIBP at 2905'. Figure there are open perfs above the CIBP. Called OCD. SION						
RIH and set second CIBP at 1812'. Circulated mud and spotted 25 sx on CIBP. POOH and perforated at 390'.						
	ish circulation from perfs at			th packer and sque	ezed perfs with 35 sx	
cement. woc.	Well was blowing. Pumped	u anomer s	55 SX and SION.			
	potted 25 sx cement 50' belonarker and cut off anchors.	ow perfs.	WOC and tagged at	t 374'. Filled 5 1/2"	casing to surface from	
			4.			
	e e in the					
I hereby certify that the informatio	n above is true and complete	e to the be	st of my knowledge	e and belief.		
SIGNATURE	TITL	.E	·	DA	ATE	
Type or print name	E-ma	ail address:		РН	IONE:	
For State Use Only		/ -				
APPROVED BY:	nale TITU	$\sum_{i} \int_{a} \int_{a$	t mo	DΔ	TP6-26-201	>
Conditions of Approval (if any):				DA		
				JUI	тв <u>6-26-20/</u> N 26 2013	