

Submit 1 Copy To Appropriate District State of	f New Mexico	Form C-103
District I – (575) 393-6161 Energy, Minerals	s and Natural Resources	Revised August 1, 2011
1625 N. French Dr., Hobbs, NM 88240 <u>District II</u> – (575) 748-1283		WELL API NO. 30-015-23149
811 5. Thist St., Altesia, NW 88210	VATION DIVISION h St. Francis Dr.	5. Indicate Type of Lease
1000 Pio Brazos Pd Aztec NM 87410	Fe, NM 87505	STATE FEE 6. State Oil & Gas Lease No.
1220 S. St. Francis Dr., Santa Fe, NM 87505		L-2919
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH		7. Lease Name or Unit Agreement Name SRC KZ State
PROPOSALS.) 1. Type of Well: Oil Well Gas Well Other		 Well Number 6
2. Name of Operator Yates Petroleum Corporation		9. OGRID Number 025575
3. Address of Operator 105 South Fourth Street, Artesia, NM 88210		10. Pool name or Wildcat Penasco Draw; Morrow
4. Well Location		
Unit Letter <u>C</u> : <u>660</u> feet from the	North line and	1980 feet from the West line
Section 1 Township	19S Range 24E whether DR, RKB, RT, GR, etc.	NMPM Eddy County
3684'GR		
12. Check Appropriate Box to I	ndicate Nature of Notice	, Report or Other Data
NOTICE OF INTENTION TO:		3SEQUENT REPORT OF:
PERFORM REMEDIAL WORK PLUG AND ABANDO		
TEMPORARILY ABANDON		
		ит јов
OTHER: OT		
of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of		
proposed completion or recompletion.		
Yates Petroleum Corporation plans to plug and abandon this well as follows:		
 MIRU any safety equipment as needed. NU BOP. No casing recovery will be attempted. POOH with production equipment. Set a 4-1/2" CIBP at 7418' with 35' cement on top. This will place a plug over open Canyon perfs. 		
3. Perforate at 5298' and spot a 50 sx Class "C" cement plug inside and outside casing across Wolfcamp top from 5148'-5298'.		
 Perforate at 4080' and spot a 50 sx Class "C" cement plug inside and outside casing across Abo top from 3930'-4080'. Perforate at 2034' and spot a 50 sx Class "C" cement plug inside and outside casing across Glorieta top from 1884'-2034'. 		
6. Perforate at 1053' and spot a 50 sx Class "C" cement plug inside and outside casing across 8-5/8" intermediate casing shoe from 903'-1053'. WOC		
and tag plug, reset plug if necessary. 7. Perforate at 456' and spot a 45 sx Class "C" cement plug inside and outside casing from 306'-456' across surface casing shoe. WOC and tag plug,		
reset if necessary.		
8. Perforate at 100' and spot a 30 sx Class "C" cement plug inside reset if necessary.	and outside casing from surface t CONDITIONS OF AP	PROVAL ATTACHED
9. Remove all surface equipment and weld dry hole marker per reg	ulations.	RECEIVED
Wellbore schematics attached	Approval Granted	
NOTE: Yates Petroleum Corporation will use steel pits and no eart	h pits.	
Spud Date: Rig	DI Di Histilite unoci it	no well Plugging
A	Forms, www.cmn	rd.state.initiation
I hereby certify that the information above is true and complete to the best of my knowledge and belief.		
SIGNATURE Cherty TITLE Regulatory Reporting Supervisor DATE July 26, 2013		
Type or print name <u>Tina Huerta</u> E-mail ad For State Use Only	ldress: <u>tinah@yatespetroleu</u>	<u>im.com</u> PHONE: <u>575-748-4168</u>
APPROVED BY: HDade TITLE Aur & Supervision DATE Aug 2, 2013 Conditions of Approval (if any): SEE Attached COA'S		
Conditions of Approval (if any): SEE At	lached COAS	

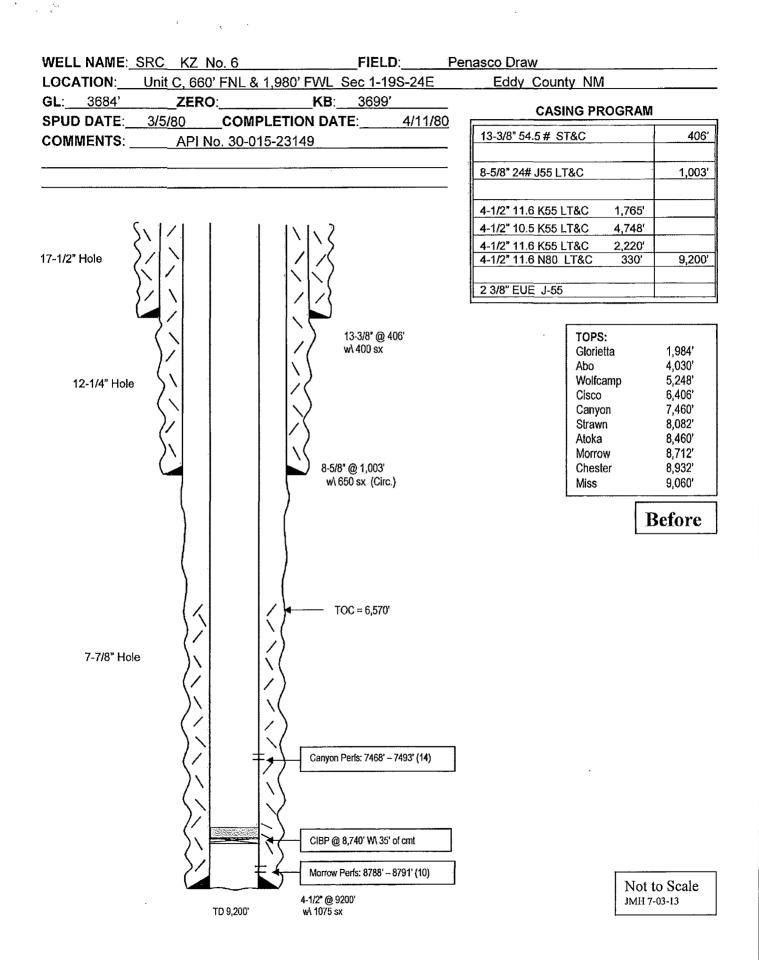

<u>}</u>

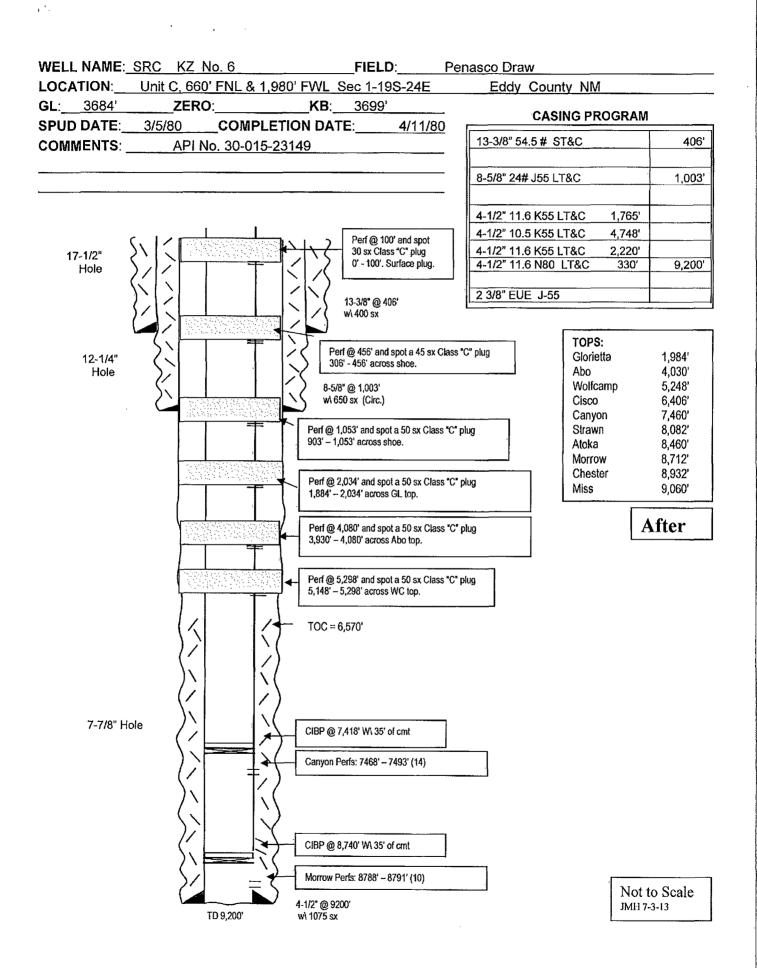

Ĵ

NEW MEXICO OIL CONSERVATION DIVISION DISTRICT 2 OFFICE 811 S. FIRST STREET ARTESIA, NM 88210 (575)748-1283

CONDITIONS OF APPROVAL FOR PLUGGING & ABANDONMENT Operator: <u>Yales Actoleun Cop</u> Well Name & Number: <u>SRC KZ State</u> #6 API #: <u>30-015-23/49</u>

1. Produced water <u>will not</u> be used during any part of the plugging & abandonment operation.

- teacher and a community of the

- 2. Notify NMOCD Dist. 2 office at least 24 hrs before beginning work.
- 3. Closed Loop System is to be used for entire plugging operation. Upon completion, contents of steel pit are to be hauled to a permitted disposal location.
- 4. Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator, as well as the contractor, to verify that this permit is place prior to performing work. Drivers shall produce a copy upon request of NMOCD Field Inspectors.
- 5. A subsequent C-103 will serve as notification that the well bore has been plugged ONLY. A C-103 FINAL shall be filed before any bonding can be released on the well. Upon receipt of the Final, an inspection will be performed to verify that the location has been satisfactorily cleaned to NMOCD standards.
- 6. If work has not begun within 90 days of the approval of this procedure, an extension request must be filed, stating reason that well has not been plugged.
- 7. Every attempt must be made to clean the well bore out to below the perfs, before any plugs can be set, by whatever means possible.
- 8. Cement Retainers may not be used.

9. Squeeze pressures are not to exceed 500 PSI, unless approval is given by NMOCD.
10. Plugs may be combined after consulting with and getting approval from NMOCD.
11. Minimum WOC time for tag plugs will be 4 Hrs.

DATE: Aug 2, 2013

.

APPROVED BY: ADach

GUIDELINES FOR PLUGGING AND ABANDONMENT

DISTRICT II / ARTESIA

- All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater.
- Mud laden fluids must be placed between all cement plugs.
- Mud laden fluids must be mixed at 25 sacks of gel per 100 bbls of water.
- A cement plug is required to be set 50' below and 50' above all casing shoes and casing stub plugs. These plugs must be tagged.
- A CIBP with 35' of cement on top may be set in lieu of 100' cement plug.
- A plug as indicated above must be placed within 100' of top perforation. This plug must be tagged.
- Plugs set below and above salt zones must be tagged.
- No more than 2000' is to be allowed between cement plugs in open hole and no more than 3000' in cased hole.
- DV tools are required to have a 100' cement plug set 50' above and below the tool and must be tagged.
- Formations to be isolated with plugs placed at the top of each formation are:
 - o Fusselman
 - o Devonian
 - o Morrow
 - o Wolfcamp
 - o Bone Spring
 - o Delaware
 - Any Salt Section (Plug at top and bottom)
 - o Abo
 - o Glorieta
 - Yates (this plus is usually at base of salt section)
- If cement does not exist behind casing strings at recommended formation depths, the casing must be cut and pulled with plugs set at these depths or casing must be perforated and cement squeezed behind casing at the formation depths.
- In the R-111-P area (Potash Mine area) a solid cement plug must be set across the salt section.
 Fluid used to mix the cement shall be saturated with the salts common to the section penetrated and in suitable proportions, but not more than a 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible (50' below and 50' above).