	UNITED STATES OCD Artesta PARTMENT OF THE INTERIOR				FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018		
BUREAU OF LAND MANAGEMENT SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals. SUBMIT IN TRIPLICATE - Other instructions on page 2 1. Type of Well O Oil Well O Gas Well O Other				-	5. Lease Serial No. NMNM0219603A     6. If Indian, Allottee or Tribe Name     7. If Unit or CA/Agreement, Name and/or No.		
				-			
					8. Well Name and No. FEDERAL BW 1		
2. Name of Operator EOG Y RESOURCES INC Contact: TINA HUERTA E-Mail: tina_huerta@eogresources.com					9. API Well No. 30-015-20454-00-S1		
3a. Address 105 S 4TH STREET	3b. Phone No. (include area code) Ph: 575-748-4168 Fx: 575-748-4585			10. Field and Pool or Exploratory Area EAGLE CREEK			
ARTESIA, NM 88210 4. Location of Well <i>(Footage, Sec., 1)</i>				11. County or Parish, State			
Sec 22 T17S R25E SESE 33				EDDY COUNTY, NM			
12. CHECK THE A	PPROPRIATE BOX(ES)	TO INDICATE N.	ATURE O	F NOTICE, I	REPORT, OR OTI	IER DATA	
TYPE OF SUBMISSION		TYPE OF ACTION					
☑ Notice of Intent	☐ Acidize	🗖 Deepen		Productio	on (Start/Resume)	U Water Shut-Off	
	Alter Casing	🗖 Hydraulic	Hydraulic Fracturing		tion	Well Integrity	
Subsequent Report	Casing Repair	New Cons	New Construction		ete	□ Other	
Final Abandonment Notice	Change Plans	🛛 Plug and A			rily Abandon		
	Convert to Injection	🗖 Plug Back	ug Back 🔲 Water I		isposal		
If the proposal is to deepen direction Attach the Bond under which the wo following completion of the involve testing has been completed. Final A	hally or recomplete horizontally, ork will be performed or provide d operations. If the operation re bandonment Notices must be fil	give subsurface location the Bond No. on file w sults in a multiple comp	ns and measu ith BLM/BIA oletion or reco	red and true ver Required subs mpletion in a ne	tical depths of all pertin sequent reports must be ew interval, a Form 316	ent markers and zones. filed within 30 days 60-4 must be filed once	
If the proposal is to deepen direction Attach the Bond under which the wo following completion of the involve testing has been completed. Final A determined that the site is ready for 1. MIRU all safety equipment	hally or recomplete horizontally, ork will be performed or provide d operations. If the operation re bandonment Notices must be fil final inspection. as needed. Pull producti	give subsurface locatio the Bond No. on file w sults in a multiple comp ed only after all require	ns and measu ith BLM/BIA eletion or reco ments, includ	red and true ver Required subs mpletion in a no ing reclamation	tical depths of all pertin sequent reports must be ew interval, a Form 316 , have been completed	ent markers and zones. filed within 30 days 0-4 must be filed once and the operator has	
If the proposal is to deepen direction Attach the Bond under which the wo following completion of the involve testing has been completed. Final A determined that the site is ready for 1. MIRU all safety equipment 2. RIH with GR/JB to 1282 ft. 3. Set a CIBP at 1272 ft. 4. If well does not have a valu surface casing see step 7.	hally or recomplete horizontally, ork will be performed or provide d operations. If the operation re bandonment Notices must be fil final inspection. as needed. Pull production we on the surface casing s	give subsurface locatio the Bond No. on file w sults in a multiple comp ed only after all require on equipment. Accept ee step 5. If well do	ns and measu ith BLM/BIA letion or reco ments, includ	red and true ver Required subsempletion in a ne ing reclamation /6-/% ord - NMO valve on	tical depths of all pertin sequent reports must be ew interval, a Form 316 , have been completed SEEE ATTACH	ent markers and zones. filed within 30 days 0-4 must be filed once and the operator has	
If the proposal is to deepen direction Attach the Bond under which the wo following completion of the involve testing has been completed. Final A determined that the site is ready for 1. MIRU all safety equipment 2. RIH with GR/JB to 1282 ft. 3. Set a CIBP at 1272 ft. 4. If well does not have a valv surface casing see step 7. 5. Load the hole with fresh wa	hally or recomplete horizontally, ork will be performed or provide d operations. If the operation re bandonment Notices must be fil final inspection. as needed. Pull production we on the surface casing stater, pressure test 4-1/2 in	give subsurface locatio the Bond No. on file w sults in a multiple comp ed only after all require on equipment. Accept ee step 5. If well do och and 5-1/2 inch o	ns and measu ith BLM/BIA letion or reco ments, includ	red and true ver Required subsempletion in a ne ing reclamation /6-/% ord - NMO valve on	tical depths of all pertin sequent reports must be ew interval, a Form 316 , have been completed SEEE ATTACH	hent markers and zones. filed within 30 days 60-4 must be filed once and the operator has	
If the proposal is to deepen direction Attach the Bond under which the wo following completion of the involve testing has been completed. Final A determined that the site is ready for 1. MIRU all safety equipment 2. RIH with GR/JB to 1282 ft. 3. Set a CIBP at 1272 ft. 4. If well does not have a valv surface casing see step 7. 5. Load the hole with fresh wa circulate a 135 sx class C cer 6. Back fill as needed.	hally or recomplete horizontally, ork will be performed or provide d operations. If the operation re bandonment Notices must be fil final inspection. as needed. Pull production we on the surface casing stater, pressure test 4-1/2 in	give subsurface locatio the Bond No. on file w sults in a multiple comp ed only after all require on equipment. Accept ee step 5. If well do och and 5-1/2 inch o	ns and measu ith BLM/BIA letion or reco ments, includ	red and true ver Required subsempletion in a ne ing reclamation /6-/% ord - NMO valve on	tical depths of all pertin sequent reports must be ew interval, a Form 316 , have been completed a SEE ATTACH	A filed within 30 days 60-4 must be filed once and the operator has HED FOR S OF APPRON	
If the proposal is to deepen direction Attach the Bond under which the wo following completion of the involve testing has been completed. Final A determined that the site is ready for 1. MIRU all safety equipment 2. RIH with GR/JB to 1282 ft. 3. Set a CIBP at 1272 ft. 4. If well does not have a valv surface casing see step 7. 5. Load the hole with fresh wa circulate a 135 sx class C cer	hally or recomplete horizontally, ork will be performed or provide d operations. If the operation re bandonment Notices must be fil final inspection. as needed. Pull production we on the surface casing s ater, pressure test 4-1/2 ir ment plug from 1272 ft up ation between production a g to 1272 ft and load hole	give subsurface locatio the Bond No. on file w sults in a multiple comp led only after all require on equipment. Accept ee step 5. If well do the and 5-1/2 inch o to surface. WOC.	ns and measu ith BLM/BIA bletion or reco ments, includ ed for reco bes have a casing to 50	red and true ver Required subsempletion in a ne ing reclamation <b>/6-/8</b> <b>ord - NMO</b> valve on 00 psi and	tical depths of all pertin sequent reports must be ew interval, a Form 316 , have been completed in SEE ATTACH COMDITION: RECLAMATIO	tent markers and zones. filed within 30 days 60-4 must be filed once and the operator has	
If the proposal is to deepen direction Attach the Bond under which the wo following completion of the involve testing has been completed. Final A determined that the site is ready for 1. MIRU all safety equipment 2. RIH with GR/JB to 1282 ft. 3. Set a CIBP at 1272 ft. 4. If well does not have a valve surface casing see step 7. 5. Load the hole with fresh wa circulate a 135 sx class C cer 6. Back fill as needed. 7. Perforate at 1183 ft. 8. Attempt to establish circula 9. RIH with open ended tubin class C cement plug from 125	hally or recomplete horizontally, ork will be performed or provide d operations. If the operation re bandonment Notices must be fil final inspection. as needed. Pull production we on the surface casing s ater, pressure test 4-1/2 ir ment plug from 1272 ft up ation between production a g to 1272 ft and load hole 72 ft up to surface. WOC.	give subsurface locatio the Bond No. on file w sults in a multiple comp led only after all require on equipment. Accept ee step 5. If well do the and 5-1/2 inch o to surface. WOC. and surface casing. with fresh water an	ns and measu ith BLM/BIA bletion or reco- ments, includ ed for reco- bes have a casing to 50 nd circulate	red and true ver Required subsempletion in a neise ing reclamation //////////////////////////////////	tical depths of all pertin sequent reports must be ew interval, a Form 316 , have been completed in SEE ATTACH COMDITION, RECLAMATIO ATTA	Ant markers and zones. filed within 30 days 60-4 must be filed once and the operator has FED FOR S OF APPRON N PROCEDURE	
If the proposal is to deepen direction Attach the Bond under which the wo following completion of the involve testing has been completed. Final A determined that the site is ready for 1. MIRU all safety equipment 2. RIH with GR/JB to 1282 ft. 3. Set a CIBP at 1272 ft. 4. If well does not have a value surface casing see step 7. 5. Load the hole with fresh wa circulate a 135 sx class C cer 6. Back fill as needed. 7. Perforate at 1183 ft. 8. Attempt to establish circula 9. RIH with open ended tubin class C cement plug from 127 14. I hereby certify that the foregoing in	hally or recomplete horizontally, ork will be performed or provide d operations. If the operation re- bandonment Notices must be fil final inspection. as needed. Pull production we on the surface casing s ater, pressure test 4-1/2 ir ment plug from 1272 ft up ation between production a g to 1272 ft and load hole 72 ft up to surface. WOC. $5 \sqrt{2}$ accord is true and correct. Electronic Submission # For EOG Y	give subsurface locatio the Bond No. on file w sults in a multiple comp ed only after all require on equipment. Accept ee step 5. If well do to hand 5-1/2 inch o to surface. WOC. and surface casing. with fresh water ar S. Recerco 402490 verified by th RESOURCES INC, s	ns and measu ith BLM/BIA Jetion or reco ments, includ ed for reco les have a casing to 50 hd circulate (	red and true ver 	tical depths of all pertin sequent reports must be ew interval, a Form 316 , have been completed : CONDITION: RECLAMATIO ATTA	Antimatkers and zones. filed within 30 days 60-4 must be filed once and the operator has HED FOR S OF APPRON N PROCEDURE ACHED	
If the proposal is to deepen direction Attach the Bond under which the wo following completion of the involve testing has been completed. Final A determined that the site is ready for 1. MIRU all safety equipment 2. RIH with GR/JB to 1282 ft. 3. Set a CIBP at 1272 ft. 4. If well does not have a value surface casing see step 7. 5. Load the hole with fresh wa circulate a 135 sx class C cer 6. Back fill as needed. 7. Perforate at 1183 ft. 8. Attempt to establish circula 9. RIH with open ended tubin class C cement plug from 125 14. I hereby certify that the foregoing is	hally or recomplete horizontally, ork will be performed or provide d operations. If the operation re bandonment Notices must be fil final inspection. The as needed. Pull production we on the surface casing s ater, pressure test 4-1/2 ir ment plug from 1272 ft up ation between production at g to 1272 ft and load hole 72 ft up to surface. WOC. The surface work of the surface for the surface for the first rue and correct. Electronic Submission # For EOG Y mmitted to AFMSS for proc	give subsurface locatio the Bond No. on file w sults in a multiple comp ed only after all require on equipment. Accept ee step 5. If well do to hand 5-1/2 inch o to surface. WOC. and surface casing. with fresh water ar S. Recerco 402490 verified by th RESOURCES INC, s	ns and measu ith BLM/BIA Jetion or reco ments, includ ed for reco bes have a casing to 50 ad circulate (	red and true ver 	tical depths of all pertin sequent reports must be ew interval, a Form 316 , have been completed a SEE ATTACH COMDITION: RECLAMATIO ATTA	Ant markers and zones. filed within 30 days 60-4 must be filed once and the operator has HED FOR S OF APPRON N PROCEDURE ICHED	
If the proposal is to deepen direction Attach the Bond under which the wo following completion of the involve testing has been completed. Final A determined that the site is ready for 1. MIRU all safety equipment 2. RIH with GR/JB to 1282 ft. 3. Set a CIBP at 1272 ft. 4. If well does not have a value surface casing see step 7. 5. Load the hole with fresh was circulate a 135 sx class C cer 6. Back fill as needed. 7. Perforate at 1183 ft. 8. Attempt to establish circula 9. RIH with open ended tubin class C cement plug from 127 14. I hereby certify that the foregoing i Name (Printed/Typed) TINA HUI	hally or recomplete horizontally, ork will be performed or provide d operations. If the operation re- bandonment Notices must be fil final inspection. as needed. Pull production we on the surface casing s ater, pressure test 4-1/2 ir ment plug from 1272 ft up ation between production a g to 1272 ft and load hole 72 ft up to surface. WOC. $5^{1/2}$ and $100$ hole 72 ft up to surface. WOC. $5^{1/2}$ and $100$ hole 72 ft up to surface woc. $5^{1/2}$ and $100$ hole 72 ft up to surface for EOG Y mmitted to AFMSS for proc ERTA	give subsurface locatio the Bond No. on file w sults in a multiple comp ed only after all require on equipment. Accept ee step 5. If well do nch and 5-1/2 inch o to surface. WOC. and surface casing. with fresh water an <u>CS.</u> <u>Resources NC, s</u> essing by PRISCILL Title	ns and measu ith BLM/BIA Jetion or reco ments, includ let for reco let for reco	red and true ver Required subsempletion in a ne ing reclamation <b>/6 - / %</b> <b>ord - NMO</b> valve on 00 psi and a 135 sx <b>/ / / / %</b> valve on 00 psi and a 135 sx <b>/ / / / %</b> valve on 00 psi and a 135 sx <b>/ / / / / %</b>	tical depths of all pertin sequent reports must be ew interval, a Form 316 , have been completed a SEE ATTACH COMDITION: RECLAMATIO ATTA	Antimatkers and zones. filed within 30 days 60-4 must be filed once and the operator has HED FOR S OF APPRON N PROCEDURE ACHED	
Attach the Bond under which the wo following completion of the involve testing has been completed. Final A determined that the site is ready for 1. MIRU all safety equipment 2. RIH with GR/JB to 1282 ft. 3. Set a CIBP at 1272 ft. 4. If well does not have a valve surface casing see step 7. 5. Load the hole with fresh wa circulate a 135 sx class C cer 6. Back fill as needed. 7. Perforate at 1183 ft. 8. Attempt to establish circula 9. RIH with open ended tubin class C cement plug from 127 14. I hereby certify that the foregoing i Name (Printed/Typed) TINA HUI	hally or recomplete horizontally, ork will be performed or provide d operations. If the operation re- bandonment Notices must be fil- final inspection. as needed. Pull producti- ve on the surface casing s ater, pressure test 4-1/2 ir ment plug from 1272 ft up ation between production a g to 1272 ft and load hole 72 ft up to surface. WOC. $5\sqrt{2}^{2}$ accord For EOG Y mmitted to AFMSS for proc ERTA	give subsurface locatio the Bond No. on file w sults in a multiple comp ed only after all require on equipment. Accept ee step 5. If well do nch and 5-1/2 inch o to surface. WOC. and surface casing. with fresh water ar Accept essing by PRISCILL	ns and measu ith BLM/BIA bletion or reco ed for reco bes have a casing to 50 ad circulate (	red and true ver Required subsempletion in a ne ing reclamation <b>/6-/%</b> ord - NMO valve on 00 psi and a 135 sx <u>- in c c c</u> linformation carlsbad n 01/29/2018 ( ATORY SPE	tical depths of all pertin sequent reports must be ew interval, a Form 316 , have been completed in SEE ATTACH COMDITION: RECLAMATIO ATTA System 18PP0901SE) :CIALIST	Ant markers and zones. filed within 30 days 60-4 must be filed once and the operator has HED FOR S OF APPRON N PROCEDURE ICHED	
If the proposal is to deepen direction Attach the Bond under which the wo following completion of the involve testing has been completed. Final A determined that the site is ready for 1. MIRU all safety equipment 2. RIH with GR/JB to 1282 ft. 3. Set a CIBP at 1272 ft. 4. If well does not have a valve surface casing see step 7. 5. Load the hole with fresh was circulate a 135 sx class C cer 6. Back fill as needed. 7. Perforate at 1183 ft. 8. Attempt to establish circula 9. RIH with open ended tubin class C cement plug from 127 14. I hereby certify that the foregoing i Name (Printed/Typed) TINA HUI	hally or recomplete horizontally, ork will be performed or provide d operations. If the operation re- bandonment Notices must be fil- final inspection. as needed. Pull producti- ve on the surface casing s ater, pressure test 4-1/2 ir ment plug from 1272 ft up ation between production a g to 1272 ft and load hole 72 ft up to surface. WOC. $5\sqrt{2}^{2}$ accord For EOG Y mmitted to AFMSS for proc ERTA	give subsurface locatio the Bond No. on file w sults in a multiple comp- led only after all require on equipment. Accept ee step 5. If well do to hand 5-1/2 inch o to surface. WOC. and surface casing. with fresh water ar 	ns and measu ith BLM/BIA bletion or reco ed for reco bes have a casing to 50 ad circulate (	red and true ver Required subsempletion in a ne ing reclamation <b>/6-/%</b> ord - NMO valve on 00 psi and a 135 sx <u>- in c c c</u> linformation carlsbad n 01/29/2018 ( ATORY SPE	tical depths of all pertin sequent reports must be ew interval, a Form 316 , have been completed in SEE ATTACH COMDITION: RECLAMATIO ATTA System 18PP0901SE) :CIALIST	Antimarkers and zones. filed within 30 days 60-4 must be filed once and the operator has IED FOR S OF APPRON N PROCEDURE Sart,	
If the proposal is to deepen direction Attach the Bond under which the wo following completion of the involve testing has been completed. Final A determined that the site is ready for 1. MIRU all safety equipment 2. RIH with GR/JB to 1282 ft. 3. Set a CIBP at 1272 ft. 4. If well does not have a valve surface casing see step 7. 5. Load the hole with fresh was circulate a 135 sx class C cer 6. Back fill as needed. 7. Perforate at 1183 ft. 8. Attempt to establish circula 9. RIH with open ended tubin class C cement plug from 127 14. I hereby certify that the foregoing i Name (Printed/Typed) TINA HUI	hally or recomplete horizontally, ork will be performed or provide d operations. If the operation re- bandonment Notices must be fil- final inspection. as needed. Pull producti- ve on the surface casing s ater, pressure test 4-1/2 ir ment plug from 1272 ft up ation between production a g to 1272 ft and load hole 72 ft up to surface. WOC. $5\sqrt{2}^{2}$ accord For EOG Y mmitted to AFMSS for proc ERTA	give subsurface locatio the Bond No. on file w sults in a multiple comp- led only after all require on equipment. Accept ee step 5. If well do to hand 5-1/2 inch o to surface. WOC. and surface casing. with fresh water ar 	ns and measu ith BLM/BIA Jetion or reco ments, includ ed for reco heres have a casing to 50 ad circulate (	red and true ver Required subsempletion in a ne ing reclamation <b>/6-/%</b> ord - NMO valve on 00 psi and a 135 sx <u>- in c c c</u> linformation carlsbad n 01/29/2018 ( ATORY SPE	tical depths of all pertin sequent reports must be ew interval, a Form 316 , have been completed in SEE ATTACH COMDITION: RECLAMATIO ATTA System 18PP0901SE) :CIALIST	Antipart markers and zones. filed within 30 days 60-4 must be filed once and the operator has HED FOR S OF APPRON N PROCEDURE Sact,	
If the proposal is to deepen direction Attach the Bond under which the wo following completion of the involve testing has been completed. Final A determined that the site is ready for 1. MIRU all safety equipment 2. RIH with GR/JB to 1282 ft. 3. Set a CIBP at 1272 ft. 4. If well does not have a valve surface casing see step 7. 5. Load the hole with fresh wa circulate a 135 sx class C cer 6. Back fill as needed. 7. Perforate at 1183 ft. 8. Attempt to establish circula 9. RIH with open ended tubin class C cement plug from 125 14. I hereby certify that the foregoing i Name (Printed/Typed) TINA HU Signature (Electronic	hally or recomplete horizontally, ork will be performed or provide d operations. If the operation re bandonment Notices must be fil final inspection. as needed. Pull production we on the surface casing s ater, pressure test 4-1/2 ir ment plug from 1272 ft up ation between production a g to 1272 ft and load hole 72 ft up to surface. WOC. $5\sqrt{2}$ accord for EOG Y mmitted to AFMSS for proc ERTA Submission) THIS SPACE FC ed. Approval of this notice does juitable title to those rights in the	give subsurface locatio the Bond No. on file w sults in a multiple comp- led only after all require on equipment. Accept ee step 5. If well do the and 5-1/2 inch of to surface. WOC. and surface casing. with fresh water ar S. Record 402490 verified by the RESOURCES INC, s essing by PRISCILL Title Date DR FEDERAL OF Title	ns and measu ith BLM/BIA bletion or reco- ments, includ ed for reco- bes have a casing to 50 ad circulate (	red and true ver Required subsempletion in a ne ing reclamation <b>/6-/%</b> ord - NMO valve on 00 psi and a 135 sx <u>- in c c c</u> linformation carlsbad n 01/29/2018 ( ATORY SPE	tical depths of all pertin sequent reports must be ew interval, a Form 316 , have been completed in SEE ATTACH COMDITION: RECLAMATIO ATTA System 18PP0901SE) :CIALIST	The term and the rest of the terms and zones. filed within 30 days 0.4  must be filed once and the operator has 1ED FOR S OF APPRON N PROCEDURE ACHED Sart, $2-13-1$	

## Additional data for EC transaction #402490 that would not fit on the form


.


#### 32. Additional remarks, continued

1

Back fill as needed.
 Cut off wellhead and install dry hole marker. Clean up location as per regulated.

Wellbore schematics attached

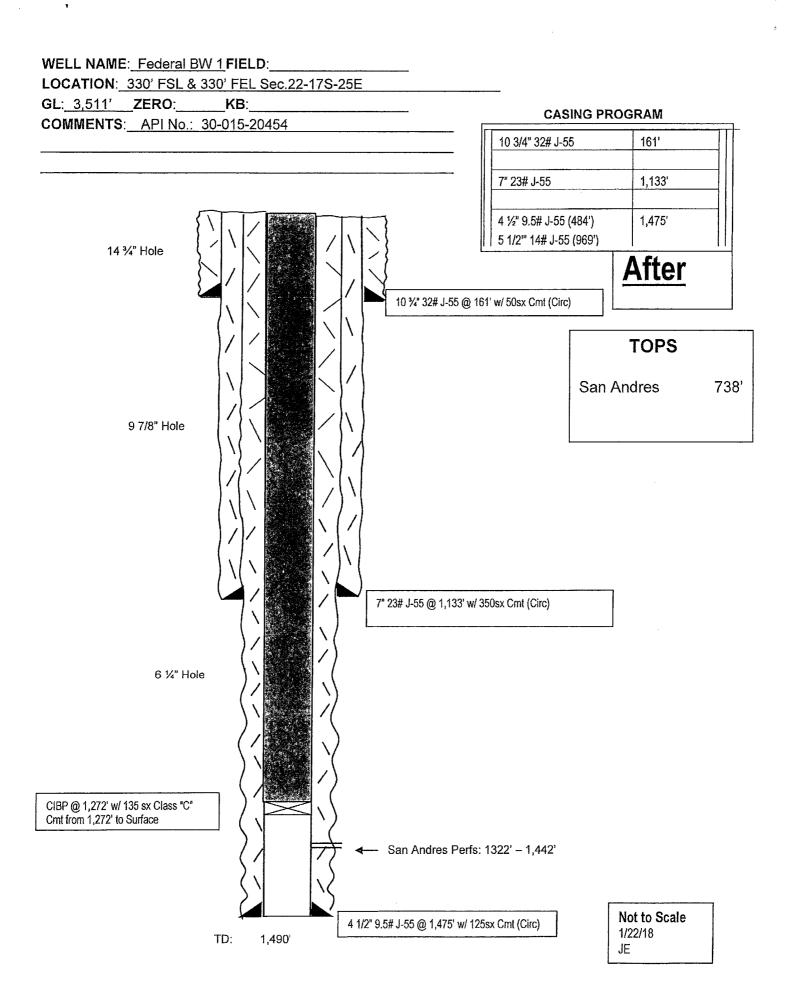

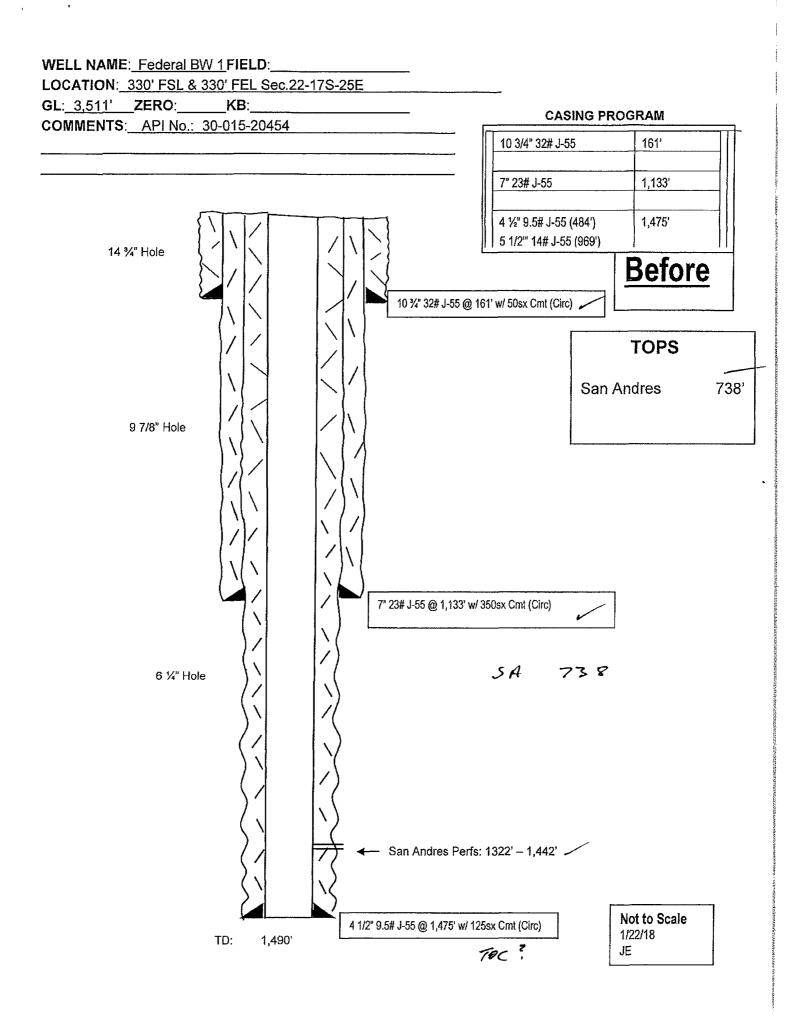

#### BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

## Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10<sup>th</sup> day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>

8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.



# **United States Department of the Interior**

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

#### **Reclamation Objectives and Procedures**

**Reclamation Objective:** Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its predisturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines (Contact service companies, allowing plenty of time to have the risers and power lines and poles removed prior to reclamation, don't wait till the last day and try to get them to remove infrastructure). Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months.
- 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you

have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Petroleum Engineering Tech 575-234-5909, 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

Henryetta Price Environmental Protection Specialist 575-234-5951

Shelly Tucker Environmental Protection Specialist 575-234-5979

Trishia Bad Bear, Hobbs Field Station Natural Resource Specialist 575-393-3612