Submit 1 Copy To Appropriate District Office NM OIL CONSERVATION District 1—(575) 393-6161 APPROVA DISTRICT MAN OF THE PROPRIED FOR THE PROPR					Form C-103 Revised July 18, 2013	
Office District I – (575) 393-6161 1625 N. French Dr., Hobbs, NM 88240 District II – (575) 748-1283 811 S. First St., Artesia, NM 88210 District III – (505) 334-6178 District III – (505) 344-6178 District III – (505) 345-6178 District III – (505) 345-6178 District III – (505) 345-6178 District III – (505)					WELL API NO. 30-015-27142	
					5. Indicate Type of I	Lease FEE
1000 Rio Brazos Rd., Aztec, NM 87410 <u>District IV</u> – (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM					6. State Oil & Gas L	Lease No.
87505		OTICES AND DET	OODTS ON WELL	<u> </u>		3271 nit Agreement Name
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)					PINNACI	LE STATE
1. Type of Well: Oil Well Gas Well Other					8. Well Number	007
2. Name of Operator RKI EXPLORATION & PRODUCTION, LLC					9. OGRID Number	246289
3. Address of Operator ₃₅₀₀ ONE WILLIAMS CENTER MD 35 TULSA, OK 74172					10. Pool name or W HERRADURA BENI	ildcat D; DELAWARE, EAST
4. Well Loc Un	eation D	. 660 _{feet}	from the NOR	RTH line and	330 feet from the	he WEST line
Sec	etion3	- 101		lange 28E		County
		11. Elevation		R, <i>RKB, RT, GR, etc.,</i> 1' GL		
	12. Chec	k Appropriate B	Sox to Indicate 1	Nature of Notice,	Report or Other Da	ata
	NOTICE OF	INTENTION T	·O:	SUB	SEQUENT REPO	ORT OF:
	REMEDIAL WORK			REMEDIAL WOR		TERING CASING
		☐ CHANGE PLA ☐ MULTIPLE C		COMMENCE DRI		AND A
				G/(GIIVG/GEIMEIV		
	OOP SYSTEM			0.711.50		
OTHER:	<u>.</u>	mnleted operations	(Clearly state all	OTHER:	d give pertipent dates i	ncluding estimated date
13 Desc	ribe proposed or col					
of st	arting any proposed	work). SEE RULI			npletions: Attach well	
of st prop		work). SEE RULI recompletion.				
of st prop 2-6-18 Notify 2-8-18 Set Cl	arting any proposed osed completion or Gilbert NMOCD. I BP @ 5900'. Noti	work). SEE RULI recompletion. MIRU W/S Unit. fy NMOCD.	E 19.15.7.14 NMA	C. For Multiple Cor	npletions: Attach well	bore diagram of
of st prop 2-6-18 Notify 2-8-18 Set CI 2-9-18 Load 8	arting any proposed osed completion or Gilbert NMOCD. IBP @ 5900'. Noti	work). SEE RULI recompletion. MIRU W/S Unit. fy NMOCD.	E 19.15.7.14 NMA	C. For Multiple Cor	npletions: Attach well	
of st prop 2-6-18 Notify 2-8-18 Set Cl 2-9-18 Load & 1256'-3960'. I	arting any proposed osed completion or Gilbert NMOCD. I BP @ 5900'. Notick Test Casing 500 Notify NMOCD.	work). SEE RULI recompletion. MIRU W/S Unit. fy NMOCD.) PSI. Circulate 1	E 19.15.7.14 NMA 00 bbl. Salt Gel	C. For Multiple Cor	npletions: Attach well ks Class C 5900'-56	bore diagram of 604'. Spot 30 sacks C
of st prop 2-6-18 Notify 2-8-18 Set Cl 2-9-18 Load & 1256'-3960'. I 2-12-18 Perfo	arting any proposed osed completion or Gilbert NMOCD. I BP @ 5900'. Notick Test Casing 500 Notify NMOCD. Orate @ 2595' W/	work). SEE RULI recompletion. MIRU W/S Unit. fy NMOCD.) PSI. Circulate 1 8 shot 1-9/16" R	E 19.15.7.14 NMA 00 bbl. Salt Gel TG Gun. Attemp	C. For Multiple Cor Mud, Spot 30 sac t to establish rate.	npletions: Attach well ks Class C 5900'-56 Pressured up to 150	bore diagram of
of st prop 2-6-18 Notify 2-8-18 Set Cl 2-9-18 Load & 1256'-3960'. I 2-12-18 Perfo NMOCD. He a by NMOCD. F	arting any proposed osed completion or Gilbert NMOCD. I BP @ 5900'. Notice Test Casing 500 Notify NMOCD. Orate @ 2595' W/ approved 30 sack Perforate @ 1465'	work). SEE RULI recompletion. MIRU W/S Unit. fy NMOCD.) PSI. Circulate 1 8 shot 1-9/16" R' : spot @ 2645'. S ' w/ 8 shot 1-9/16	E 19.15.7.14 NMA 00 bbl. Salt Gel TG Gun. Attemp Spot 30 sacks Cl " RTG Gun. Atte	C. For Multiple Cor Mud, Spot 30 sac t to establish rate. ass C 2645'-2349' empt to establish r	npletions: Attach well ks Class C 5900'-56 Pressured up to 150 . WOC. Tag Plug @ ate. Pressured up to	bore diagram of 504'. Spot 30 sacks C 00 PSI. Notify Gilbert 2 2335'. Tag approved
of st prop 2-6-18 Notify 2-8-18 Set Cl 2-9-18 Load 8 1256'-3960'. I 2-12-18 Perfo NMOCD. He a by NMOCD. F Gilbert NMOC	arting any proposed osed completion or Gilbert NMOCD. I BP @ 5900'. Notify Test Casing 500 Notify NMOCD. Orate @ 2595' W/ approved 30 sack Perforate @ 1465'CD. He approved 3	work). SEE RULI recompletion. MIRU W/S Unit. fy NMOCD. DPSI. Circulate 1 8 shot 1-9/16" R' spot @ 2645'. S W 8 shot 1-9/16 30 sack spot. Sp	E 19.15.7.14 NMA 100 bbl. Salt Gel TG Gun. Attemp Spot 30 sacks Clas ot 30 sacks Clas	C. For Multiple Cor Mud, Spot 30 sac t to establish rate. ass C 2645'-2349' empt to establish rates C 1515'-1209'.	ks Class C 5900'-56 Pressured up to 150 . WOC. Tag Plug @ate. Pressured up to WOC. Overnight.	bore diagram of 604'. Spot 30 sacks C 00 PSI. Notify Gilbert 2335'. Tag approved 5 1500 PSI. Notify
of st prop 2-6-18 Notify 2-8-18 Set Cl 2-9-18 Load 8 1256'-3960'. I 2-12-18 Perfo NMOCD. He a by NMOCD. F Gilbert NMOC 2-13-18 Tag F	arting any proposed osed completion or Gilbert NMOCD. I BP @ 5900'. Notice Test Casing 500 Notify NMOCD. Prate @ 2595' W/Eapproved 30 sack Perforate @ 1465' CD. He approved : Plug @ 1220'. NM	work). SEE RULI recompletion. MIRU W/S Unit. fy NMOCD. DPSI. Circulate 1 8 shot 1-9/16" R' spot @ 2645'. S' W / 8 shot 1-9/16 30 sack spot. Sp IOCD approved t	E 19.15.7.14 NMA OO bbl. Salt Gel TG Gun. Attemp Spot 30 sacks Cla TG RTG Gun. Atte ot 30 sacks Clas tag. Perforate @	C. For Multiple Cor Mud, Spot 30 sac t to establish rate. ass C 2645'-2349' empt to establish rates is C 1515'-1209'. V 599'. Attempt to e	ks Class C 5900'-56 Pressured up to 150 . WOC. Tag Plug @ ate. Pressured up to NOC. Overnight.	bore diagram of 604'. Spot 30 sacks C 00 PSI. Notify Gilbert 2335'. Tag approved 1500 PSI. Notify ured up. Notify Gilber
of st prop 2-6-18 Notify 2-8-18 Set Cl 2-9-18 Load 8 1256'-3960'. I 2-12-18 Perfo NMOCD. He s by NMOCD. F Gilbert NMOC 2-13-18 Tag F NMOCD. OCI	arting any proposed osed completion or Gilbert NMOCD. I BP @ 5900'. Notify Test Casing 500 Notify NMOCD. Prate @ 2595' W/Fapproved 30 sack Perforate @ 1465' CD. He approved 30 approved perforate @ 1465' CD. He approved 30 approved perforate @ 1220'. NMOD approved perforate	work). SEE RULI recompletion. MIRU W/S Unit. fy NMOCD. DPSI. Circulate 1 8 shot 1-9/16" R spot @ 2645'. S W/ 8 shot 1-9/16 30 sack spot. Spot IOCD approved to rate @ 150' drop	E 19.15.7.14 NMA OO bbl. Salt Gel TG Gun. Attemp Spot 30 sacks Cla or RTG Gun. Atte ot 30 sacks Clas tag. Perforate @ down to 650 & s	C. For Multiple Cor Mud, Spot 30 sac t to establish rate. ass C 2645'-2349' empt to establish rates is C 1515'-1209'. V 599'. Attempt to e	ks Class C 5900'-56 Pressured up to 156 WOC. Tag Plug @ ate. Pressured up to NOC. Overnight. establish rate. Press	bore diagram of 604'. Spot 30 sacks C 00 PSI. Notify Gilbert 2335'. Tag approved 5 1500 PSI. Notify
of st prop 2-6-18 Notify 2-8-18 Set Cl 2-9-18 Load 8 1256'-3960'. I 2-12-18 Perfo NMOCD. He s by NMOCD. F Gilbert NMOC 2-13-18 Tag F NMOCD. OCI	arting any proposed osed completion or Gilbert NMOCD. I BP @ 5900'. Notify Test Casing 500 Notify NMOCD. Prate @ 2595' W/Fapproved 30 sack Perforate @ 1465' CD. He approved 30 approved perforate @ 1465' CD. He approved 30 approved perforate @ 1220'. NMOD approved perforate	work). SEE RULI recompletion. MIRU W/S Unit. fy NMOCD.) PSI. Circulate 1 8 shot 1-9/16" R spot @ 2645'. S w/ 8 shot 1-9/16 30 sack spot. Sp IOCD approved 1 rate @ 150' drop Casing and circu	E 19.15.7.14 NMA OO bbl. Salt Gel TG Gun. Attemp Spot 30 sacks Cla or RTG Gun. Atte ot 30 sacks Clas tag. Perforate @ down to 650 & s	Mud, Spot 30 sact to establish rate. ass C 2645'-2349' empt to establish rates C 1515'-1209'. Very Spot. Perforate @diate. Total of 120	ks Class C 5900'-56 Pressured up to 156 WOC. Tag Plug @ ate. Pressured up to NOC. Overnight. establish rate. Press	bore diagram of 604'. Spot 30 sacks C 00 PSI. Notify Gilbert 2335'. Tag approved 1500 PSI. Notify ured up. Notify Gilber
of st prop 2-6-18 Notify 2-8-18 Set Cl 2-9-18 Load & 1256'-3960'. I 2-12-18 Perfo NMOCD. He a by NMOCD. F Gilbert NMOC 2-13-18 Tag F NMOCD. OCI Spot @ 650'-	arting any proposed osed completion or Gilbert NMOCD. I BP @ 5900'. Notify Test Casing 500 Notify NMOCD. Trate @ 2595' W/Papproved 30 sack Perforate @ 1465' CD. He approved 30 approved perforous @ 1220'. NMOD approved perforous Gurface in 5-1/2"	work). SEE RULI recompletion. MIRU W/S Unit. fy NMOCD.) PSI. Circulate 1 8 shot 1-9/16" R spot @ 2645'. S w/ 8 shot 1-9/16 30 sack spot. Sp IOCD approved 1 rate @ 150' drop Casing and circu	E 19.15.7.14 NMA 00 bbl. Salt Gel TG Gun. Attemp Spot 30 sacks Clas or RTG Gun. Atte ot 30 sacks Clas tag. Perforate @ down to 650 & sulate out interme	Mud, Spot 30 sact to establish rate. ass C 2645'-2349' empt to establish rates C 1515'-1209'. Very Spot. Perforate @diate. Total of 120	ks Class C 5900'-56 Pressured up to 156 WOC. Tag Plug @ ate. Pressured up to WOC. Overnight. establish rate. Pressured 150'. Establish circus sacks Class C.	bore diagram of 604'. Spot 30 sacks C 00 PSI. Notify Gilbert 2335'. Tag approved 1500 PSI. Notify ured up. Notify Gilber
of st. prop 2-6-18 Notify 2-8-18 Set Cl 2-9-18 Load 8 1256'-3960'. I 2-12-18 Perfo NMOCD. He a by NMOCD. F Gilbert NMOC 2-13-18 Tag F NMOCD. OCI Spot @ 650'-	arting any proposed osed completion or Gilbert NMOCD. I BP @ 5900'. Notify Test Casing 500 Notify NMOCD. Trate @ 2595' W/Papproved 30 sack Perforate @ 1465' CD. He approved 30 approved perfor a proved perfor a proved perfor Surface in 5-1/2"	work). SEE RULI recompletion. MIRU W/S Unit. fy NMOCD. PSI. Circulate 1 shot 1-9/16" R spot @ 2645'. S W/ 8 shot 1-9/16 30 sack spot. Sp IOCD approved to the many service of the complete of	E 19.15.7.14 NMA OO bbl. Salt Gel TG Gun. Attemp Spot 30 sacks Cla " RTG Gun. Atte ot 30 sacks Clas tag. Perforate @ down to 650 & s ulate out interme Rig Release D	Mud, Spot 30 sact to establish rate. ass C 2645'-2349' empt to establish rates C 1515'-1209'. Very Spot. Perforate @diate. Total of 120	ks Class C 5900'-56 Pressured up to 156 WOC. Tag Plug @ ate. Pressured up to WOC. Overnight. establish rate. Pressured 150'. Establish circusacks Class C.	bore diagram of 604'. Spot 30 sacks C 00 PSI. Notify Gilbert 2335'. Tag approved 1500 PSI. Notify ured up. Notify Gilber
of st. prop 2-6-18 Notify 2-8-18 Set Cl 2-9-18 Load 8 1256'-3960'. I 2-12-18 Perfo NMOCD. He a by NMOCD. F Gilbert NMOC 2-13-18 Tag F NMOCD. OCI Spot @ 650'- Spud Date: I hereby certif	arting any proposed osed completion or Gilbert NMOCD. I BP @ 5900'. Notify Test Casing 500 Notify NMOCD. Trate @ 2595' W/Papproved 30 sack Perforate @ 1465' CD. He approved : Plug @ 1220'. NMOD approved perfor Surface in 5-1/2" 109/30/ The figure of the information of the info	work). SEE RULI recompletion. MIRU W/S Unit. fy NMOCD. PSI. Circulate 1 8 shot 1-9/16" R spot @ 2645'. S W/8 shot 1-9/16 30 sack spot. Sp IOCD approved to rate @ 150' drop Casing and circulate and above is true and	E 19.15.7.14 NMA 100 bbl. Salt Gel TG Gun. Attemp Epot 30 sacks Clas TG Gun. Atte	Mud, Spot 30 sact to establish rate. ass C 2645'-2349' empt to establish rates C 1515'-1209'. Very Spot. Perforate @diate. Total of 120 ate:	ks Class C 5900'-56 Pressured up to 150. WOC. Tag Plug @ ate. Pressured up to NOC. Overnight. establish rate. Pressi 150'. Establish circu sacks Class C.	bore diagram of 604'. Spot 30 sacks C 00 PSI. Notify Gilbert 2335'. Tag approved 1500 PSI. Notify ured up. Notify Gilber
of st. prop 2-6-18 Notify 2-8-18 Set Cl 2-9-18 Load 8 1256'-3960'. I 2-12-18 Perfo NMOCD. He a by NMOCD. F Gilbert NMOC 2-13-18 Tag F NMOCD. OCI Spot @ 650'- Spud Date: I hereby certif	arting any proposed osed completion or Gilbert NMOCD. I BP @ 5900'. Notify Test Casing 500 Notify NMOCD. Trate @ 2595' W/Papproved 30 sack Perforate @ 1465' CD. He approved : Plug @ 1220'. NMOD approved perfor Surface in 5-1/2" 109/30/ The figure of the information of the info	work). SEE RULI recompletion. MIRU W/S Unit. fy NMOCD. PSI. Circulate 1 8 shot 1-9/16" R spot @ 2645'. S W/8 shot 1-9/16 30 sack spot. Sp IOCD approved to rate @ 150' drop Casing and circulate and above is true and	E 19.15.7.14 NMA 100 bbl. Salt Gel TG Gun. Attemp Spot 30 sacks Clas of 30 sacks Clas tag. Perforate @ 0 down to 650 & s ulate out interme Rig Release D d complete to the backs	Mud, Spot 30 sact to establish rate. ass C 2645'-2349' empt to establish rates C 1515'-1209'. Very 1599'. Attempt to espot. Perforate @diate. Total of 120 ate: 11/0	ks Class C 5900'-56 Pressured up to 150. WOC. Tag Plug @ ate. Pressured up to NOC. Overnight. establish rate. Press 150'. Establish circusacks Class C.	bore diagram of 604'. Spot 30 sacks C 604'. Spot 30 sacks C 600 PSI. Notify Gilbert 2335'. Tag approved 5 1500 PSI. Notify Gilbert 1500 psi. Notif
of st. prop 2-6-18 Notify 2-8-18 Set Cl 2-9-18 Load 8 1256'-3960'. I 2-12-18 Perfo NMOCD. He a by NMOCD. F Gilbert NMOC 2-13-18 Tag F NMOCD. OCI Spot @ 650'- Spud Date: I hereby certif	arting any proposed osed completion or Gilbert NMOCD. I BP @ 5900'. Notify Test Casing 500 Notify NMOCD. Orate @ 2595' W/approved 30 sack Perforate @ 1465' CD. He approved 30 proved perforate in 5-1/2" O9/30/ fy that the information came Caitlin Company Control of the Cont	work). SEE RULI recompletion. MIRU W/S Unit. fy NMOCD. PSI. Circulate 1 8 shot 1-9/16" R spot @ 2645'. S W/8 shot 1-9/16 30 sack spot. Sp IOCD approved to rate @ 150' drop Casing and circulate and above is true and	E 19.15.7.14 NMA 100 bbl. Salt Gel TG Gun. Attemp Spot 30 sacks Clas of 30 sacks Clas tag. Perforate @ 0 down to 650 & s ulate out interme Rig Release D d complete to the backs	Mud, Spot 30 sact to establish rate. ass C 2645'-2349' empt to establish rates C 1515'-1209'. Very 1599'. Attempt to espot. Perforate @diate. Total of 120 ate: 11/0	ks Class C 5900'-56 Pressured up to 150. WOC. Tag Plug @ ate. Pressured up to NOC. Overnight. establish rate. Press 150'. Establish circusacks Class C.	bore diagram of 604'. Spot 30 sacks C 600 PSI. Notify Gilbert 6 2335'. Tag approved 6 1500 PSI. Notify 6 ured up. Notify Gilbert 6 ilation out intermediat
of staprop 2-6-18 Notify 2-8-18 Set Cl 2-9-18 Load & 1256'-3960'. I 2-12-18 Perfor NMOCD. He aby NMOCD. F Gilbert NMOC 2-13-18 Tag F NMOCD. OCI Spot @ 650'- Spud Date: I hereby certify Type or print For State Use APPROVED	arting any proposed osed completion or Gilbert NMOCD. I BP @ 5900'. Notify Test Casing 500 Notify NMOCD. I approved 30 sack Perforate @ 1465' CD. He approved 30 sack Perforate @ 1220'. NMOD approved perfor Surface in 5-1/2" O9/30/ fy that the information of the conly Caitlin Conly	work). SEE RULI recompletion. MIRU W/S Unit. fy NMOCD. PSI. Circulate 1 8 shot 1-9/16" R spot @ 2645'. S W/8 shot 1-9/16 30 sack spot. Sp IOCD approved to rate @ 150' drop Casing and circulate and above is true and	E 19.15.7.14 NMA OO bbl. Salt Gel TG Gun. Attemp Spot 30 sacks Claster TG Gun. Atte ot 30 sacks Claster ag. Perforate @ down to 650 & sulate out interme Rig Release D d complete to the bear of th	Mud, Spot 30 sact to establish rate. ass C 2645'-2349' empt to establish rates C 1515'-1209'. Very 1599'. Attempt to espot. Perforate @diate. Total of 120 ate: 11/0	ks Class C 5900'-56 Pressured up to 156 WOC. Tag Plug @ ate. Pressured up to WOC. Overnight. establish rate. Pressu 150'. Establish circu sacks Class C. 27/1992 e and belief. DATE DXENERGY.COM PHON	bore diagram of 604'. Spot 30 sacks C 604'. Spot 30 sacks C 600 PSI. Notify Gilbert 2335'. Tag approved 5 1500 PSI. Notify Gilbert 1500 psi. Notif