

Submit 1 Copy To Appropriate District Office
District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised July 18, 2013

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO.	30-005-64315
5. Indicate Type of Lease	STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.	
7. Lease Name or Unit Agreement Name	Huckleberry State
8. Well Number	1
9. OGRID Number	1092
10. Pool name or Wildcat	
11. Elevation (Show whether DR, RKB, RT, GR, etc.)	

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>
2. Name of Operator ARMSTRONG ENERGY CORPORATION
3. Address of Operator P.O. Box 1973, Roswell, NM 88202-1973
4. Well Location Unit Letter <u>J</u> : <u>2402</u> feet from the <u>South</u> line and <u>1610</u> feet from the <u>East</u> line Section <u>10</u> Township <u>15S</u> Range <u>28E</u> NMPM Chaves County
11. Elevation (Show whether DR, RKB, RT, GR, etc.)

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐
CLOSED-LOOP SYSTEM ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☐
CASING/CEMENT JOB ☐
OTHER: Perf & Acidize ☒

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

10-15-18 TIH, tie in and perforate 9946' - 9960', 2 spf, 30 holes.
10-17-18 Pump 500 gal 20% NEFE acid, 1,750 gal 20% NEFE acid with 50 ball sealers, 250 gal 20% NEFE acid.
10-18-18 NU BOP, get off on/off tool. Pump 70 bbls 2% KC2 water down casing and out tubing (recovered 20-25 frac balls, appears to be floaters). Get back on on/off tool, test packer to 500#, held OK. ND BOP.
10-23-18 RU Crane Acidizing, circ hole w/ 220 bbls 2% KCL water @ 9910.65'. Spot 250 gals 10% NEFE @ 9910.65'.
TIH, tie in and perf 9892'-9901' and 9906'-9912' w/ 2 SPF, 34 holes.

Spud Date:

08/30/2018

Rig Release Date:

09/20/2018

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Kyle Apers TITLE VP - Engineering DATE 11-13-2018
Type or print name Kyle Apers E-mail address: kelpers@aecnm.com PHONE: 575-625-2222
APPROVED BY: Rusty Hen TITLE Business As Spec A DATE 12-12-2018
Conditions of Approval (if any):