Form 3160-5 (June 2015)

UNITED STATES

FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018

DEPARTMENT OF THE INTERIOR

BUREAU OF LAND MANAGEMENT SON WELLS

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to refer the proposals.

A POR SINGLE OF THE INTERIOR

Expires: Ja

OMB NO
Ex

AMESIO 6. If Indian, Allottee or Tribe Name

abandoned wei	i. Use form 3100-3 (APD)	, ioi such pro	•	ANIMEDI ANIMEDI	- 1 4 11 1 11 11 11 11 11 11 11 11 11 11	
SUBMIT IN 1	RIPLICATE - Other instr	uctions on pa	ige 2 ARTES	SIA DISTR	7. If Unit or CA/Agree	ement, Name and/or No.
Type of Well ☐ Gas Well ☐ Oth	er		MAR	1 1 207	8. Well Name and No. LOCO HILLS 1/2	B2AB FED COM 1H
Name of Operator MEWBOURNE OIL COMPAN	Contact: J Y E-Mail: jlathan@me	ACKIE LATHA wbourne.com	N RE	CEIVED	9. API Well No. 30-015-45582-0	00-S1
3a. Address P O BOX 5270 HOBBS, NM 88241 3b. Phone No. (include area code) Ph: 575-393-5905)	10. Field and Pool or LOCO HILLS-B	Exploratory Area ONE SPRING, EAST
4. Location of Well (Footage, Sec., T., R., M., or Survey Description) 11. County or Parish, State						
Sec 36 T17S R30E SESE 300FSL 205FEL 32.784508 N Lat, 103.918152 W Lon					EDDY COUNTY	/, NM
12. CHECK THE AP	PPROPRIATE BOX(ES) 1	O INDICATI	E NATURE C	F NOTICI	E, REPORT, OR OTH	HER DATA
TYPE OF SUBMISSION			ТҮРЕ О	F ACTION		
☐ Notice of Intent	☐ Acidize	☐ Deepe	n	☐ Produ	ction (Start/Resume)	■ Water Shut-Off
_	☐ Alter Casing	Hydra	ulic Fracturing	☐ Recla	mation	■ Well Integrity
Subsequent Report ■	Casing Repair	☐ New C	Construction	□ Recor	nplete	Other
☐ Final Abandonment Notice	□ Change Plans	☐ Plug a	nd Abandon	□ Temp	orarily Abandon	Well Spud
	☐ Convert to Injection	🗖 Plug E	Back	■ Water	Disposal	
13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection. 3/04/19 Spud 17 1/2" hole @ 515'. Ran 500' of 13 3/8" 54.5# J55 ST&C Csg. Cemented with 525 sks Class C 0.5% CacCl2. Mixed @ 14.8#/g w/1.33 yd. Displaced w/ 70 bbls of FW. Plug down @ 6:00 AM 03/05/19. Circ 210 sks of cmt to the pit. Test BOPE to 5000# & Annular to 3500#. At 4:15 A.M. 03/06/19, tested csg to 1500# for 30 mins, held OK. Drilled out with 12 1/4" bit. Charts & Schematic attached. Bond on file: NM1693 nationwide & NMB000919 14. I hereby certify that the foregoing is true and correct. Electronic Submission #457057 verified by the BLM Well Information System						
Com	Electronic Submission #4: For MEWBOUR mitted to AFMSS for proces	NE OIL COMPA	NNY, sent to th	e Carlsbad	•	
Name (Printed/Typed) JACKIE LATHAN			Title REGUL	ATORY		
Signature (Electronic S	Submission)	,	Date 03/06/2	n19		
	THIS SPACE FO				JSE	
		T		······································		MAR 0 6 2019
Approved By			Title ACCE	pted fo	or Record	Date
Conditions of approval, if any, are attached certify that the applicant holds legal or equ which would entitle the applicant to condu	itable title to those rights in the	subject lease		nathon (arlsbad Fig		
Title 18 U.S.C. Section 1001 and Title 43 States any false, fictitious or fraudulent s					make to any department or	agency of the United



WELDING • BOP TESTING NIPPLE UP SERVICE • BOP LIFTS • TANDEM MUD AND GAS SEPARATORS

Lovington, NM • 575-396-4540

Pa.	of	
. 9.	 vi	

Company: MAWDOVINE	Date: 3-5-/	19 involce # B097193	
LOGO HILLS 12 BZAG H	MONH Drilling Contractor	- Peterson Res 250	_
Plug Sizo &Type: 12172	Driff Pipe Stee	Tesser: TBUU	_
Required BOP:	Installed BOP:	P	
'Appropriate Casing Valve Must Be Open During BOP Tool '	26A	* Check Valve Must Be Open/Disabled To Test Kill Line Valv	VBC
Annular #15 Pipe Rams #12 Blind Rams #13 Pipe Rams #14 Pipe Rams #14	#3 #5 #6 #5 #6 #5 #6 #5 #6 #6 #6 #6 #6 #6 #6 #6 #6 #6 #6 #6 #6	Dert Volve 919 Stand Pipe Valve 824 Top Drive 822 Stand Pipe Valve 824 Top Drive 824 Top Drive 824 Top Pump Valve 918 Manual 180P 916 Pump Valve 820 821	

TEST 0	MEMS TESTED	TEST LENGTH	LOW PSI	HIGH PSI		. REMARKS
	15,97	10-10	210	3,100	Pussed	XT38
<u>}.</u>	1297	10-10	2.17)	500	Pessed	YT 38
3	12/0.8	10-0	包成	5900	P4550d	XT 38
U	1210, 86 (0A 3) 26A	1040	210	100	Pissal	X7 38
5.		10-10	LV	5000	Pussal	XT 35
6	18	10-10	710	500	P455rd	YI 38
7.	707/2223	10-10	201	5000	P655-91	XT 38
6.	16	10-10	מכ	500	Pussed	XT 🔏
9	1311 252654620	BIMP	TEST	500	125500	XT 38
10	13/15/12	10-10	210	500	1455 ed	Xr 38
177.	13/13/46	10-10	·201	500	Pissed	X7 38
12.	14	10-10	210	5000	1149521	4/zif 7' Rams
-	77					
				-		
 						
	:					
			-			
-		7 .	-	<u> </u>		
				+		<u></u>
1			1	l '	1	

MAN WELDING SERVICES, IV.

Company Mewbourne		Date 3-5-19
Company Mew Mourne Lease 100 Hills		County Eddy
Drilling Contractor Putters	04 200	Plug & Drill Pipe Size / 7 (-27 - 1738
Accumulator Pressure: 300) / Manifol	ld Pressure: 1500 Annular Pressure: 400
		nction Test - OO&GO#2
		GEN BOTTLES (III.A.2.c.i. or ii or iii)
		and if applicable HCR is closed. ing pressure! (Shut off all pumps)
1. Open HCR Valve.	If applicable)	•
Close annular.		
3. Close all pipe rams		ate closing the blind ram.
		chieve the 50+ % safety factor. (5M and greater systems).
6. Record remaining	pressure 1500	psi. Test Fails if pressure is lower than required.
		b. {1200 psi for a 2000 & 3000 psi system }
7. If annular is closed	, open it at this time	e and close HCR.
To Check - PRECHARGE (Start with manifold pr a. {800 psi for	essure at, or above,	SPHERICAL (III.A.2.d.) maximum acceptable pre-charge pressure: 1 b. {1100 psi for 2000 and 3000 psi system}
Open bleed line to Close bleed line. E Record pressure of	the tank, slowly (graphy bump electric points)	gauge needle will drop at the lowest bottle pressure) to pump and see what pressure the needle jumps up to. Test fails if pressure drops below minimum. tem } b. {900 psi for a 2000 & 3000 psi system}
To Check - THE CAPACIT	Y OF THE ACCU	MULATOR PUMPS (III.A.2.f.)
• Isolate the accumulate	r bottles or spheric	al from the pumps & manifold.
• Open the bleed off va	ve to the tank, (ma	nifold psi should go to 0 psi} close bleed valve.
1. Open the HCR val	ve, {if applicable}	
2. Close annular		
3. With pumps only,	time how long it tal	kes to regain the required manifold pressure. st fails if it takes over 2 minutes.
4. Record elapsed to	me / / / / . 183	h (1200 psi for a 2000 & 3000 psi system)











