orm 3160-5 June 2015)	UNITED STATE PARTMENT OF THE I		OCD Artes	sia	FORM APPROVED OMB No. 1004-0137 Expires: January 31, 2018		
	EAU OF LAND MAN				5. Lease Serial No. NMNM86025		
	NOTICES AND REPO			6. If Indian, Allo	ottee or Tribe Name		
	form for proposals a Use Form 3160-3 (A						
SUBMIT IN	TRIPLICATE - Other instru	uctions on page 2	2		Agreement, Name	and/or No.	
1. Type of Well				ARCO FEDER			
✓ Oil Well Gas			8. Well Name an	^{id No.} #2			
Name of Operator SOUTHWEST ROYALTIES, INC.				9. API Well No.	30-015-20632		
		3b. Phone No. <i>(in</i> (432) 207-3054	clude area code)		10. Field and Pool or Exploratory Area GRAYBURG JACKSON; SR-Q-G-SA		
4. Location of Well (Footage, Sec., T.,R.,M., or Survey Description) L, 1980' FSL & 660' FWL, SEC 17, T17S, R30E				11. Country or P EDDY	arish, State	1999 Blann	
12. CHI	ECK THE APPROPRIATE B	OX(ES) TO INDI	CATE NATURE OF	NOTICE, REPORT OF	R OTHER DATA	· ·	
TYPE OF SUBMISSIÓN			ТҮРЕ С	PF ACTION			
✓ Notice of Intent	Acidize	Deepen	lic Fracturing	Production (Start/Rest Reclamation		er Shut-Off Integrity	
Subsequent Report	Casing Repair	=	onstruction	Recomplete	Othe	ar .	
Final Abandonment Notice	Change Plans	Plug an Plug Ba] Temporarily Abandon] Water Disposal			
the Bond under which the work wi completion of the involved operation completed. Final Abandonment Not is ready for final inspection.) NOTICE OF INTENT TO PLUG	ions. If the operation results in otices must be filed only after	n a multiple compl all requirements, i	with BLM/BIA. Re etion or recompletion neluding reclamation 8-/22/19	non Erew international in the electromagnetic data CONDITIO	Contribe operation	e filed once testing has been as determined that the site	
completion of the involved operati completed. Final Abandonment No is ready for final inspection.) NOTICE OF INTENT TO PLUG - RU WELL SERVICE UNIT. PC - NU BOP. UNSEATANCHORS - RU WIRELINE. SET CIBP @ 	ions. If the operation results in otices must be filed only after G AND ABANDON DH LD RODS AND PUMP. . TOH W/ 2-7/8" TBG. 1900'. TBG. TAG CIBP. CIRCUL/ OF CMT. .ES AT 1100'. SQUEEZE 5 ATE CLASS C CMT TO S NSTALL BELOW GROUNI QUIPMENT INCLUDING 5	n a multiple compl all requirements, i ACCEPTED A ATE HOLE W/ 10 50 SXS CLASS C URFACE, D DRY HOLE MA ELECTRIC POLE	with BLM/BIA. Re etion or recompletic ncluding reclamatio 8 /22/19 or record - NM # GELLED BRINE CMT. WOC FOR RKER. :S, ETC.	quired subsequent report non-provide the subsequent report non-provide the subsequent report CONDITIO Soci So	CHEDHEG NS OF A class c cmt. 2 950	e fied once testing has been destetennined that the site PPROVAL	
completion of the involved operati completed. Final Abandonment No is ready for final inspection.) NOTICE OF INTENT TO PLUG - RU WELL SERVICE UNIT. PC - NU BOP. UNSEATANCHORS - RU WIRELINE. SET CIBP @ -1.TIH W/ OPEN ENDED 2-7/8" - WOC FOR 4 HRS. TAG TOP - WOC FOR 4 HRS. TAG TOP - PERFORATE SQUEEZE HOL - PERFORATE SQUEEZE HOL - PERFORATE AT 400'. CIRCUL - PERFOATE AT 400'. CIRCUL - MOVE OUT ALL SURFACE E	ions. If the operation results in otices must be filed only after G AND ABANDON DH LD RODS AND PUMP. 5. TOH W/ 2-7/8" TBG. 1900'. TBG. TAG CIBP. CIRCUL/ OF CMT. .ES AT 1100'. SQUEEZE S ATE CLASS C CMT TO S VSTALL BELOW GROUND QUIPMENT INCLUDING E DOCATION AND ROAD. PR	n a multiple compl all requirements, i Accepted 1 ATE HOLE W/ 10 50 SXS CLASS C URFACE. D DRY HOLE MA ELECTRIC POLE EPARE LOCATI	with BLM/BIA. Re etion or recompletic ncluding reclamatio 8 /22/19 or record - NM # GELLED BRINE CMT. WOC FOR RKER. :S, ETC.	quired subsequent report non-provide the subsequent report non-provide the subsequent report CONDITIO Soci So	NS OF A CLASS C CMT. 2 950 JIREMENTS.	pproval pproval pproval pproval proval proval preserve preserve proval proval proval proval proval proval proval proval	
completion of the involved operation completed. Final Abandonment Notice of final inspection.) NOTICE OF INTENT TO PLUG NOTICE OF INTENT TO PLUG PLUG PLUG NOTICE OF INTENT TO PLUG PLUG NOTICE OF INTENT TO PLUG PLUG NOTICE OF INTENT TO PLUG NOTICE OF INTENT TO PLUG PLUG NOTICE OF INTENT TO PLUG NOTICE OF INTENT TO PLUG N	ions. If the operation results in otices must be filed only after G AND ABANDON DH LD RODS AND PUMP. 5. TOH W/ 2-7/8" TBG. 1900'. TBG. TAG CIBP. CIRCULA OF CMT. .ES AT 1100'. SQUEEZE & ATE CLASS C CMT TO S VSTALL BELOW GROUND QUIPMENT INCLUDING E DCATION AND ROAD. PR DRK USING A STEEL PIT.	n a multiple compl all requirements, i Accepted 1 ATE HOLE W/ 10 50 SXS CLASS C URFACE. D DRY HOLE MA ELECTRIC POLE EPARE LOCATI	with BLM/BIA. Re etion or recompletic ncluding reclamatio 8 /22/19 or record - NM # GELLED BRINE CMT. WOC FOR RKER. :S, ETC.	quired subsequent report non- non- non- no- no- soco	NS OF A CLASS C CMT. 2 950 JIREMENTS.	e filed once testing has been as determined that the site	
completion of the involved operation completed. Final Abandonment Notics ready for final inspection.) NOTICE OF INTENT TO PLUG PRUWELL SERVICE UNIT. PC 2-NU BOP. UNSEATANCHORS - RU WIRELINE. SET CIBP (a) - TIH W/ OPEN ENDED 2-7/8" - 5-WOC FOR 4 HRS. TAG TOP (c) - PERFORATE SQUEEZE HOLL - PERFORATE SQUEEZE HOLL - PERFORATE SQUEEZE HOLL - PERFORATE AT 400'. CIRCUL - PERFORATE AT 400'. CIRCUL - ND BOP. CUT WELLHEAD. IN - MOVE OUT ALL SURFACE E - REMOVE CALICHE FROM LC - **NO SURFACE PIT. ALL WO	ions. If the operation results in otices must be filed only after G AND ABANDON DH LD RODS AND PUMP. 5. TOH W/ 2-7/8" TBG. 1900'. TBG. TAG CIBP. CIRCULA OF CMT. .ES AT 1100'. SQUEEZE & ATE CLASS C CMT TO S VSTALL BELOW GROUND QUIPMENT INCLUDING E DCATION AND ROAD. PR DRK USING A STEEL PIT.	n a multiple compl all requirements, i ACCEPTED A ATE HOLE W/ 10 50 SXS CLASS C URFACE, D DRY HOLE MA ELECTRIC POLE EPARE LOCATI ELECTRIC POLE EPARE LOCATI	with BLM/BIA. Re etion or recompletic ncluding reclamatic 8 /22/19 for record - NM # GELLED BRINE CMT. WOC FOR RKER. S, ETC. ON FOR REGROU	quired subsequent report non-provide the subsequent report non-provide the subsequent report CONDITIO SADT 25 5 X SADT 25 5 X SAD	NS OF A CLASS C CMT. 2 950 JIREMENTS.	PPROVAL PPROVAL A ba: 1 35 cm ²	
completion of the involved operation completed. Final Abandonment Notice of final inspection.) NOTICE OF INTENT TO PLUG PARU WELL SERVICE UNIT. PC NU BOP. UNSEATANCHORS RU WIRELINE. SET CIBP (Complete THW/ OPEN ENDED 2-7/8" 5-WOC FOR 4 HRS. TAG TOP (Complete PERFORATE SQUEEZE HOLD PERFORATE SQUEEZE HOLD PERFORATE AT 400'. CIRCUL ROBOP. CUT WELLHEAD. IN PERFORATE AT 400'. CIRCUL ROBOP. CUT WELLHEAD. IN PERFORATE AT 400'. CIRCUL ROBOP. CUT WELLHEAD. IN PORTO ALL SURFACE E REMOVE CALICHE FROM LOC **NO SURFACE PIT. ALL WO	ions. If the operation results in otices must be filed only after G AND ABANDON DH LD RODS AND PUMP. 5. TOH W/ 2-7/8" TBG. 1900'. TBG. TAG CIBP. CIRCULA OF CMT. .ES AT 1100'. SQUEEZE & ATE CLASS C CMT TO S VSTALL BELOW GROUND QUIPMENT INCLUDING E DCATION AND ROAD. PR DRK USING A STEEL PIT.	n a multiple completion all requirements, in ACCEPTED A ACCEPTED A ACCEPTED A ATE HOLE W/ 10 50 SXS CLASS C URFACE. D DRY HOLE MA ELECTRIC POLE IEPARE LOCATI A ATE HOLE W/ 10 50 SXS CLASS C URFACE. D DRY HOLE MA ELECTRIC POLE IEPARE LOCATI A A ACCEPTED A A ACCEPTED A A A A A A A A A A A A A A A A A A A	with BLM/BIA. Re etion or recompletic ncluding reclamatic 8 /22/19 for record - NM # GELLED BRINE CMT. WOC FOR RKER. S, ETC. ON FOR REGROU	quired subsequent report INTERNIA INTERNIATION CONDITIO SANT 25 5× SANT 25 5× SANT 25 5× A HRS. TAG CMT. (WTH PER BLM REQU Ker recursor Y ANALYST	NS OF A CLASS C CMT. 2 950 JIREMENTS.	Artesia District AUG 2 I 2019	
completion of the involved operation completed. Final Abandonment Notice of final inspection.) NOTICE OF INTENT TO PLUG RU WELL SERVICE UNIT. PC NU BOP. UNSEATANCHORS RU WIRELINE. SET CIBP (a) THW/ OPEN ENDED 2-7/8" S-WOC FOR 4 HRS. TAG TOP (a) PERFORATE SQUEEZE HOLD PERFORATE SQUEEZE HOLD PERFORATE SQUEEZE HOLD ND BOP. CUT WELLHEAD. IN MOVE OUT ALL SURFACE E REMOVE CALICHE FROM LC **NO SURFACE PIT. ALL WO DEC OF A PLOAD (C) SATURDATE SATURDATE DEC OF A PLOAD (C) Thereby certify that the foregoing is NDSAY LIVESAY	ions. If the operation results in otices must be filed only after G AND ABANDON DH LD RODS AND PUMP. 5. TOH W/ 2-7/8" TBG. 1900'. TBG. TAG CIBP. CIRCULA OF CMT. .ES AT 1100'. SQUEEZE & ATE CLASS C CMT TO S VSTALL BELOW GROUND QUIPMENT INCLUDING & DCATION AND ROAD. PR DCATION AND ROAD. PR DCATION AND ROAD. PR ORK USING A STEEL PIT.	n a multiple completion all requirements, in ACCEPTED A ACCEPTED A ACCEPTED A ATE HOLE W/ 10 50 SXS CLASS C URFACE. D DRY HOLE MA ELECTRIC POLE EPARE LOCATI A MINING/Typed) T	with BLM/BIA. Re etion or recompletic ncluding reclamatic 8 /22/19 for record - NM # GELLED BRINE CMT. WOC FOR RKER. S, ETC. ON FOR REGROU	quired subsequent report INFIGHT AFT INFIGHT AFT INFIGHT INFIGHT AFT INFIGHT A	NS OF A NS OF A CLASS C CMT. 2 950 JIREMENTS.	PPROVAL PPROVAL A ba: 1 3.5 cmt Difference D	
completion of the involved operatic completed. Final Abandonment Notice of final inspection.) NOTICE OF INTENT TO PLUG RU WELL SERVICE UNIT. PC NU BOP. UNSEATANCHORS RU WIRELINE. SET CIBP @ TIH W/ OPEN ENDED 2-7/8" SWOC FOR 4 HRS. TAG TOP (PERFORATE SQUEEZE HOD PERFORATE SQUEEZE HOD PERFORATE SQUEEZE HOD ND BOP. CUT WELLHEAD. IN POVE OUT ALL SURFACE E REMOVE CALICHE FROM LC **NO SURFACE PIT. ALL WO DESAY LIVESAY	ions. If the operation results in otices must be filed only after G AND ABANDON DH LD RODS AND PUMP. 5. TOH W/ 2-7/8" TBG. 1900'. TBG. TAG CIBP. CIRCULA OF CMT. .ES AT 1100'. SQUEEZE & ATE CLASS C CMT TO S VSTALL BELOW GROUND QUIPMENT INCLUDING & DCATION AND ROAD. PR DCATION AND ROAD. PR DCATION AND ROAD. PR ORK USING A STEEL PIT.	n a multiple completion all requirements, in ACCEPTED A ACCEPTED A ACCEPTED A ATE HOLE W/ 10 50 SXS CLASS C URFACE. D DRY HOLE MA ELECTRIC POLE EPARE LOCATI A MINING/Typed) T	with BLM/BIA. Re etion or recompletic ncluding reclamation 8 /22/19 for record - NM # GELLED BRINE CMT. WOC FOR RKER. S, ETC. ON FOR REGROM	quired subsequent report INFIGHT AFT INFIGHT AFT INFIGHT INFIGHT AFT INFIGHT A	NS OF A NS OF A CLASS C CMT. 2 950 JIREMENTS.	Artesia District AUG 2 I 2019	
completion of the involved operation completed. Final Abandonment Notice of final inspection.) NOTICE OF INTENT TO PLUG RUWELL SERVICE UNIT. PC NU BOP. UNSEATANCHORS RUWIRELINE. SET CIBP @ HITH W/ OPEN ENDED 2-7/8" FWOC FOR 4 HRS. TAG TOP (PERFORATE SQUEEZE HOL PERFORATE SQUEEZE HOL ND BOP. CUT WELLHEAD. IN PERFORTE SQUEEZE HOL NOVE OUT ALL SURFACE E REMOVE CALICHE FROM LC **NO SURFACE PIT. ALL WO DEAD OF FUNCTION IN Signature	ions. If the operation results in otices must be filed only after G AND ABANDON DH LD RODS AND PUMP. 5. TOH W/ 2-7/8" TBG. 1900'. TBG. TAG CIBP. CIRCULA OF CMT. .ES AT 1100'. SQUEEZE & ATE CLASS C CMT TO S VSTALL BELOW GROUND QUIPMENT INCLUDING & DCATION AND ROAD. PR DCATION AND ROAD. PR DCATION AND ROAD. PR ORK USING A STEEL PIT.	n a multiple completion all requirements, in ACCEPTED A ACCEPTED A ACCEPTED A ATE HOLE W/ 10 50 SXS CLASS C URFACE. D DRY HOLE MA ELECTRIC POLE EPARE LOCATI A MINING/Typed) T	with BLM/BIA. Re etion or recompletic ncluding reclamatic 8 /22/19 for record - NM # GELLED BRINE CMT. WOC FOR RKER. S, ETC. ON FOR REGROU	quired subsequent report INFIGHT AFT INFIGHT AFT INFIGHT INFIGHT AFT INFIGHT A	NS OF A NS OF A CLASS C CMT. 2 950 JIREMENTS.	Artesia District AUG 2 I 2019	
completion of the involved operation completed. Final Abandonment Notice of final inspection.) NOTICE OF INTENT TO PLUG - RU WELL SERVICE UNIT. PC - NU BOP. UNSEATANCHORS - RU WIRELINE. SET CIBP (a) - HI W/ OPEN ENDED 2-7/8" - SWOC FOR 4 HRS. TAG TOP (- PERFORATE SQUEEZE HOLL - PERFORATE SQUEEZE HOLL - PERFORATE SQUEEZE HOLL - ND BOP. CUT WELLHEAD. IN - MOVE OUT ALL SURFACE E - REMOVE CALICHE FROM LOC - **NO SURFACE PIT. ALL WO - REMOVE CALICHE FROM LOC - Thereby certify that the foregoing is NDSAY LIVESAY	ions. If the operation results in otices must be filed only after G AND ABANDON DH LD RODS AND PUMP. TOH W/ 2-7/8" TBG. 1900'. TBG. TAG CIBP. CIRCUL/ OF CMT. ES AT 1100'. SQUEEZE & ATE CLASS C CMT TO SINSTALL BELOW GROUND QUIPMENT INCLUDING & DCATION AND ROAD. PR DCATION AND ROAD. PR DCATION AND ROAD. PR DCATION AND ROAD. PR DCATION AND ROAD. PR CALL DELOW GROUND CALL D	n a multiple complete all requirements, i ACCEPTED 1 ATE HOLE W/ 10 50 SXS CLASS C URFACE, D DRY HOLE MA ELECTRIC POLE EPARE LOCATI I FOR FEDEF	with BLM/BIA. Re etion or recompletic ncluding reclamation 8 /22/19 or record - NA # GELLED BRINE CMT. WOC FOR RKER. S, ETC. ON FOR REGROM	quired subsequent report INFIGHT AFT INFIGHT AFT INFIGHT INFIGHT AFT INFIGHT A	NS OF A NS OF A CLASS C CMT. 2 950 JIREMENTS.	Artesia District AUG 2 I 2019	

U

۲

، ذ


•

8	
\mathcal{N}	
ſ∕₽	

SOUTHWEST ROYALTIES, INC. ARCO FEDERAL #2


30-015-20632

CURRENT GRAYBURG JACKSON; SR Q-G-SA WELL

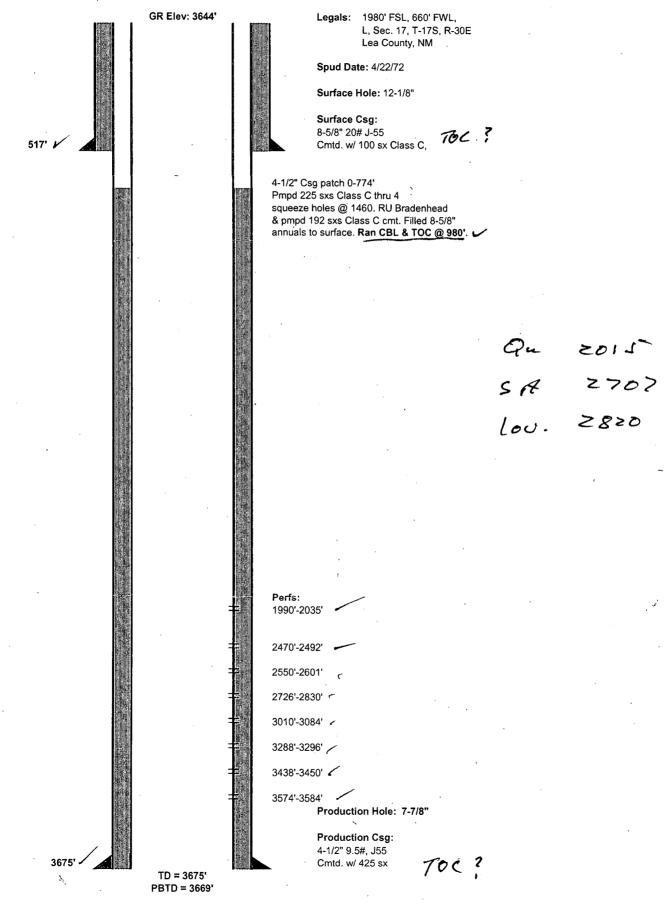

SOUTHWEST ROYALTIES, INC. ARCO FEDERAL #2

30-015-20632

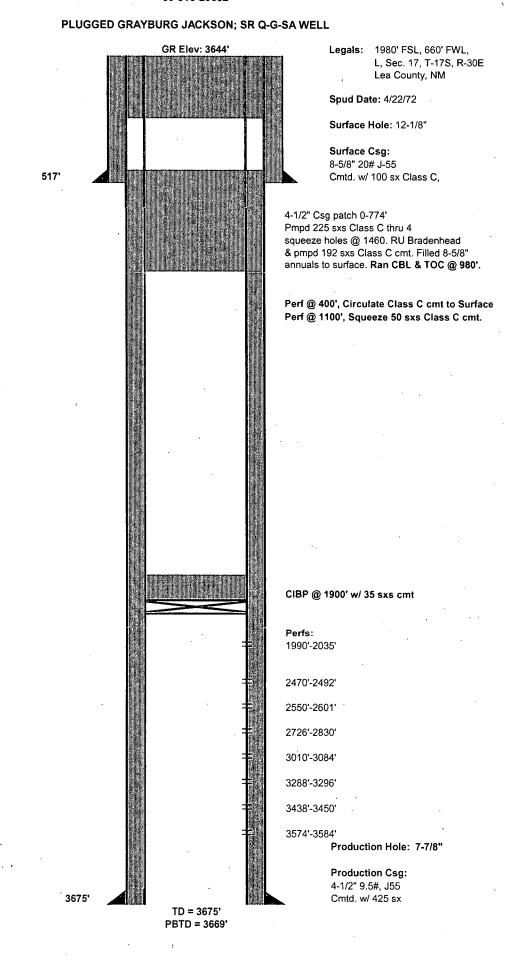

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification</u>: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement</u>: Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water Minimum nine (9) pounds per gallon.

5 <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Below Ground Level Cap (Lesser Prairie-Chicken Habitat)</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged</u>.

8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:</u> From March 1st through June 15th annually, abandonment activities will be allowed except between the hours from 3 00 am and 9 00 am. Normal vehicle use on existing roads will not be restricted