					NMOCD
		Ì	,		
	-				
	orma 3160-5 April 2004)	DEPARTMENT	D STATES OF THE INTERIOR	.IAN 2920 OCD-ARTE	OMU No. 1004-0137
	BURFAU OF LAND MANAGEMENT SUNDRY NOTICES AND REPORTS ON WELLS				5. Lense Serial No. NMNM080219
	Do not use this form for proposals to drill or to re-enter an abandoncd well. Use Form 3160-3 (APD) for such proposals.				6. If Indian. Allouen or Tribe Namu
_	SUBMIT IN TRIPLICATE - Other Instructions on reverse side				7. II'l Init of CA/Agreenent, Name and/or No
L.	Type of Well Oil Well Gas Woll	Other			8. Well Name and Nu.
2.	Name of Operator				Hondo Federal #1
	intage Drilling LLC				9. API Well No.
-	a Address 1710 S. Huldoman Dd. Au		30. Plause No. (Include urril co	MC)	30-005-21013 10. Field and Pool, or Exploratory Area
	10 S. Haldeman Rd, Ar Invention of Well (Fundinge, Sec., T.,				SE Chaves Queen Gas Area A
1	1980 FNL, 660 FEL				11. County or Parish, Sinte
<u>_S</u>	ec. 21, T-13-S, R-31-E			·	Chaves, NM
		PPROPRIATE BOD	K(ES) TO INDICATE NA		REPORT, OR OTHER DATA
-	TYPE OF SUBMISSION			TYPE OF ACTION	
R	Notice of Intent	Acidene		Production (Standilles	
<u>د</u>	-	Casing Kepsir	New Construction	Reclamation	Well lancarity
	_ Subsequent Report	Change Plans		Temportaly Abapdo	Other
Ľ	Final Abandonment Notice	Convert to Injection	5	Water Dispusal	
	testing has been completed. Find	blved uperations. If the al Abandonment Notices r final inspection.)	operation results in a multiple	completion or recompletion	quired subsequent reports shall be filed within 3 b in a new interval, a Form 3160-4 shall be file clamantion, have been completed, and the opera
P Se P	testing has been completed. Find	olved uperations. If the al Abandonment Notices final inspection.) 1. 35' coment. 392, 45 sx. cemen	operation results in a multiple s shall be filed only utter all at, displace to 1850'. V	completion or recompletion requirements, including rec VOC & tag	in a new interval, a Form 3160-4 shall be file
P S P P P S	testing has been completed. Fin determined that the site is ready fin AIRU plugging equipmen 'OH w/ rods & thg. et CIBP @ 2700', Cap w/ 'erf. 4 1/2 cag. (2) 1900' &	al Abandoument Noticer final inspection.) 1. 35' coment. 352. 45 sx. coment 92. 45 sx coment	internation results in a multiple s shall be filed only utter all at, displace to 1850'. V t, displace to 1050. We minimum 50	Completion or recompletion requirements, including rec VOC & tag OC & tag.	in a new interval, a Form 3160-4 shall be file
P S P P P S	testing has been completed. Fin determined that the site is ready fin AIRU plugging equipmen OH w/ rods & thg. et CIBP @ 2700', Cap w/ verf. 4 1/2 csg. @ 1900' & verf. 4 1/2 csg. @ 1300' & verf. 4 1/2 csg. @ 400' & s et 60' surface plug across but off wellhead and weld	ACHED	inperation results in a multiple s shall be filed andy utter all ht, displace to 1850'. V t, displace to 1050. We Minimum 50 ker. SURPACE f	VOC & tag OC & tag C & tag OC & tag Amenc	a in a new (nurva), a form 3160-4 shall be file lamantion, have been completed, and the opera
P S P P P S	testing has been completed. Fin determined that the site is ready fin AIRU plugging equipment OH w/ rods & tbg. et CLBP @ 2700', Cap w/ Perf. 4 1/2 csg. @ 1990' & Perf. 4 1/2 csg. @ 1300' & Perf. 4 1/2 csg. @ 400' & si et 60' surface plug across Cut off wellhead and weld	ACHED	inperation results in a multiple s shall be filed andy utter all ht, displace to 1850'. V t, displace to 1050. We Minimum 50 ker. SURPACE f	VOC & tag OC & tag C & tag OC & tag Amenc	APPROVED
P S P P S C	testing has been completed. Fin determined that the site is ready fin AIRU plugging equipment OH w/ rods & tbg. et CLIPP @ 2700', Cap w/ erf. 4 1/2 csg. @ 1990' & erf. 4 1/2 csg. @ 1990' & erf. 4 1/2 csg. @ 1300' & erf. 4 1/2 csg. @ 400' & si et 60' surface plug across out off wellhead and weld SEE ATT GONDITIONS	ACHEDF SOFAPP	inperation results in a multiple s shall be filed andy utter all ht, displace to 1850'. V t, displace to 1050. We Minimum 50 ker. SURPACE f	VOC & tag OC & tag C & tag OC & tag Amenc	APPROVED
Pr 54 Pr 90 Pr 90 St C	testing has been completed. Fin determined that the site is ready fin AIRU plugging equipment OH w/ rods & tbg. et CLIPP @ 2700', Cap w/ Perf. 4 1/2 csg. @ 1990' & erf. 4 1/2 csg. @ 1990' & erf. 4 1/2 csg. @ 1300' & erf. 4 1/2 csg. @ 400' & si et 60' surface plug across out off wellhead and weld SEE ATT GONDITIONS	ACHEDF SOFAPP	inperation results in a coultiple s shall be filed any utter all in, displace to 1850'. V minimum 50 ker. SURFACE f NOR ROVAL	VOC & tag OC & tag OC & tag DC & tag Ameno Januai	APPROVED
P <sup>(</sup> Si P <sup>(</sup> ) P <sup>(</sup> Si C	testing has been completed. Fin determined that the site is ready fin AIRU plugging equipment OH w/ rods & tbg. et CLBP @ 2700', Cap w/ Perf. 4 1/2 csg. @ 1990' & erf. 4 1/2 csg. @ 1990' & erf. 4 1/2 csg. @ 1300' & erf. 4 1/2 csg. @ 400' & si et 60' surface plug across but off wellhead and weld SEE ATT CONDITIONS	ACHEDF SOFAPP	inperation results in a multiple s shall be filed and utter all at, displace to 1850'. V t, displace to 1050. We Minimum 50 ker. SURFACE f OR ROVAL	VOC & tag OC & tag OC & tag OC & tag Amenc Januai	APPROVED
P <sup>(</sup> Si P <sup>(</sup> ) P <sup>(</sup> Si C	testing has been completed. Fin determined that the site is ready fin AIRU plugging equipment OH w/ rods & tbg. et CLIPP @ 2700', Cap w/ Perf. 4 1/2 csg. @ 1990' & erf. 4 1/2 csg. @ 1990' & erf. 4 1/2 csg. @ 1300' & erf. 4 1/2 csg. @ 400' & si et 60' surface plug across out off wellhead and weld SEE ATT GONDITIONS	ACHED F S OF APP	in a coultiple s shall be filed any utter all in displace to 1850'. V in displace to 1050. We Minimum 50 ker. SURFACE for ROVAL Title Date Title Title Date Title	WOC & tag OC & tag OC & tag OC & tag Ameno Januai	APPROVED led P & A procedur cy 24, 2008
P <sup>i</sup> Si Pi Pi Pi Si C	testing has been completed. Fin determined that the site is ready fin AIRU plugging equipment OH w/ rods & tbg. et CLBP @ 2700', Cap w/ Perf. 4 1/2 csg. @ 1990' & erf. 4 1/2 csg. @ 1990' & erf. 4 1/2 csg. @ 1300' & erf. 4 1/2 csg. @ 400' & si et 60' surface plug across but off wellhead and weld SEE ATT CONDITIONS	ACHED F S OF APP	inperation results in a multiple s shall be filed and utter all at, displace to 1850'. V t, displace to 1050. We Minimum 50 ker. SURFACE f OR ROVAL	VOC & tag OC & tag OC & tag Amenc Janual Janual a 1/8/08 OR STATE OFFIC	APPROVED led P & A procedur cy 24, 2008
P'S PP P S C	testing has been completed. Fin determined that the site is ready far AIRU plugging equipmen OH w/ rods & tbg. et CLBP @ 2700', Cap w/ Perf. 4 1/2 csg. @ 1900' & Perf. 4 1/2 csg. @ 1300' & Perf. 4 1/2 csg. @ 400' & si et 60' surface plug across int off wellhead and weld SEE ATT GONDITIONS . Thereby certify that the foregoing is Name (Printed Typed) togger Brooks	ACHED F ACHED F ACH	operation results in a coultiple s shall be filed anly utter all in, displace to 1850'. V minimum 50 ker. SURFACE f OR ROVAL	VOC & tag OC & tag OC & tag OC & tag Amenc Januar Januar	b is a new faterval a Form 3160-4 shall be file clamantion. have been completed, and the opera- led P & A procedure ry 24, 2008 E USE Date $1/2.4/2028$



## BUREAU OF LAND MANAGEMENT Roswell Field Office 2909 West Second Street Roswell, New Mexico 88201 505-627-0272

## Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

2

. . . . .

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon. If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

2. <u>Notification</u>: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 505-627-0272, Eddy County call 505- 234-5972; for wells in Lea County call 505-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either class "C", for up to 7,500 feet of depth, mixed at 14.8 lbs./gal. with 6.3 gallons of fresh water per sack or class "H", for deeper than 7,500 feet plugs, mixed at 16.4 lbs./gal. with 4.3 gallons of fresh water per sack.

ł.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement. The following information shall be permanently inscribed on the dry hole marker: Well name and number, the name of the operator, the lease serial number, the surveyed location (the quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer; such as metes and bounds).

7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and five copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>

8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration conditions of approval will be developed and furnished to you.