



UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

OCD-ARTESIA

FORM APPROVED
OMB No 1004-0137
Expires July 31, 2010

SUNDRY NOTICES AND REPORTS ON WELLS
*Do not use this form for proposals to drill or to re-enter an
abandoned well. Use Form 3160-3 (APD) for such proposals.*

SUBMIT IN TRIPLICATE - Other Instructions on page 2.

1 Type of Well <input type="checkbox"/> Oil Well <input type="checkbox"/> Gas Well <input checked="" type="checkbox"/> Other		2 Name of Operator Marbob Energy Corporation		3a Address PO Box 227 Artesia, NM 88211-0227		3b Phone No (include area code) (575) 748-3303		5 Lease Serial No NMLC028731B
4 Location of Well (Footage, Sec., T., R., M., or Survey Description) 660 FNL 1980 FWL, Sec. 14-T17S-R29E, Unit C		7 If Unit or CA Agreement Name and/or No NMNM111789X		8 Well Name and No Dodd Federal Unit #27 WIW		9 API Well No 30-015-02978		6 If Indian, Allottee, or Tribe Name
								10 Field and Pool, or Exploratory Area Grbg Jackson SR Q Grbg SA
								11 County or Parish, State Eddy Co., NM

12. CHECK APPROPRIATE BOX(S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION				
<input type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize	<input type="checkbox"/> Deepen	<input type="checkbox"/> Production (Start/Resume)	<input type="checkbox"/> Water Shut-off	
<input checked="" type="checkbox"/> Subsequent Report	<input type="checkbox"/> Altering Casing	<input type="checkbox"/> Fracture Treat	<input type="checkbox"/> Reclamation	<input type="checkbox"/> Well Integrity	
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> New Construction	<input type="checkbox"/> Recomplete	<input type="checkbox"/> Other _____	
	<input type="checkbox"/> Change Plans	<input type="checkbox"/> Plug and abandon	<input type="checkbox"/> Temporarily Abandon		
	<input checked="" type="checkbox"/> Convert to Injection	<input type="checkbox"/> Plug back	<input type="checkbox"/> Water Disposal		

13 Describe Proposed or Completed Operation (clearly state all pertinent details including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleate horizontally, give subsurface locations and measured and true vertical depths or pertinent markers and sands. Attach the Bond under which the work will performed or provide the Bond No on file with the BLM/ BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleation in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notice shall be filed only after all requirements, including reclamanation, have been completed, and the operator has determined that the site is ready for final inspection.)

Converted to Water Injection Well

See Attachment

Accepted for record
NMOCD

* Plans for well (WIW SI)?

14 I hereby certify that the foregoing is true and correct
Name (Printed/Typed)

Signature Diapa J. Briggs		Title Production Analyst
Date June 17, 2008		ACCEPTED FOR RECORD
THIS SPACE FOR FEDERAL OR STATE OFFICE USE		
Approved by Conditions of approval, if any are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.		Title Office
Title 18 U.S.C. Section 1001 AND Title 13 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.		Date JUN 21 2008
(Instructions on page 2)		BUREAU OF LAND MANAGEMENT CARLSBAD FIELD OFFICE

MARBOB ENERGY CORPORATION
DODD FEDERAL UNIT #27 WIW
MARY DODD B #6
660 FNL 1980 FWL, SEC. 14-T17S-R29E, UNIT C
30-015-02978, GRBG JACKSON SR Q GRBG SA
EDDY COUNTY, NM

3/4/08 **CONVERT TO INJ WELL:** RU WOU. UNSEAT PMP. POOH W/ RODS
WAREHOUSE 172 - 3/4" RODS. LD PMP. WATSON HOT OIL PMPD 75 BBLS WTR
DN CSG TO KILL GAS. ND TBG. NU BOP. POOH & LD 68 JTS TBG & WELL
STARTED FLOWING OUT TBG. COULDN'T GET KILL TRUCK. SWI. SDFTD. -

3/5/08 BASIC PMPD 30 BBLS WTR DN TBG. FINISH POOH W/ 66 JTS OF TBG. L/D. L&R
BROUGHT 145 JTS WORK STRING. RIH W/ 3 7/8" BIT, 4 1/2" CSG SCRAPER &
134 JTS TO 4336'. POOH W/ TBG & SCRAPER. RIH W/ CIBP, RTTS & 105 JTS.
SET CIBP @ 3400'. SET PKR ABV PLUG. BASIC LOADED TBG. TEST TO 2000 # &
WOULDN'T HOLD. UNSEAT PKR. MOVE UP 1 JT. WOULDN'T TEST. MOVE PKR
DN ON TOP OF PLUG & WOULDN'T HOLD #. POOH W/ TBG & PKR. RIH W/ R-4
PKR & TBG. SET PKR 1' ABV PLUG & TEST TO 2000# & HELD. PKR WOULDN'T
RLS. TRY TO WORK LOOSE & WOULDN'T COME LOOSE. SWI. SDFTD. -
MANUEL

3/6/08 TRY TO WORK PKR LOOSE. WOULDN'T COME LOOSE. CALL ROTARY W/L. RU
ROTARY W/L TO CUT TBG @ 3400'. RD ROTARY W/L. POOH W/ TBG 10'. CUT
OFF PIECE OF TBG. RIH W/ O/S, BUMPER SUB, HYD JARS, 6 - 3 1/4" DCS & TBG.
GOT ON CUT OFF JT & JAR ON PKR TO WORK IT LOOSE. O/S CAME OFF. POOH
W/ TBG, DCS & TOOLS. SWI. SDFTD. - *MANUEL*

3/7/08 RIH W/ 2 5/16 GRAPPLE ON O/S, BUMPER SUB, HYD JARS, DCS & TBG. GOT ON
CUT OFF JT & JAR ON PKR. GOT PKR LOOSE. POOH W/ TBG, DCS & HAD PART
OF PKR. LEFT 2 SLIPS, TOP CONE, RUBBER, BTM RING & COLLAR OFF PKR IN
HOLE. SWI. SDFTD. - *MANUEL*

3/8/08 RIH W/ 3 15/16 CUT RITE SHOE, DCS & TBG. TAG @ 3396'. PU SWIVEL & DRILL
TO 3398'. L/D SWIVEL. POOH W/ TBG, DCS & SHOE. HAD CONE OFF PKR
INSIDE SHOE. MADE 2 MAGNET RUNS ON SANDLINE. GOT PIECE OF METAL &
METAL SHAVINGS. SWI. SDFTD. - *MANUEL*

3/10/08 RIH W/ TAPER TAP & TBG. TAG COLLAR ON TOP OF PLUG TO GET COLLAR.
POOH W/ TBG & TAPER TAP. DIDN'T GET COLLAR. RIH W/ MILL SHOE, DC &
TBG. TAG @ 3398'. PU SWIVEL & DRILL DN TO 3399'. LD SWIVEL & POOH W/
TBG, DC & HAD SHEAR RING. COLLAR STUCK INSIDE SHOE. SWI. SDFTD. -

3/11/08 RIH W/ MIL SHOE, DC & TBG. TAG @ 3399'. PU PWR SWIVEL. DO PLUG. LD
SWIVEL. RIH TO 4330'. POOH W/ TBG & DC. RIH W/ DRILL BIT, 4 1/2" CSG
SCRAPER & TBG TO TD. POOH W/ TBG & SCRAPER. RIH W/ CIBP, RTTS & TBG.
SET @ 3992'. SET RTTS & TEST PLUG TO 2000#. HELD. POOH W/ TBG & RTTS.
SWI. SDFTD. - *MANUEL*

3/12/08 RIH W/ CMNT RETAINER & 84 JTS OF TBG. HLS PMPD 12 BBLS THROUGH
RETAINER @ 2725'. HLS PMPD 28 BBLS TO LOAD CSG & PRESS UP TO 500#.
HLS PMPD 15 BBLS OF WTR EST RATE 2 BPM @ 85#. PMP CMNT & SQUEEZE
SAN ANDRES PERFS. 600 SX CMNT. PO STINGER & CLN CMNT OUT OF TBG.
RD HLS. POOH W/ TBG. SWI. SDFTD. - *MANUEL*

3/13/08 RIH W/ 3 7/8" DRILL BIT, DC & TBG. TAG @ 2719. PU SWIVEL & DRILL CMNT &
RETAINER @ 2725' & CMNT WAS STILL GREEN. PU 2 JTS. SWI. SDFTD. -
MANUEL

3/14/08 START DRILLING OUT CMNT @ 2728'. DRILL DN TO 3148'. CIRC CLN. PU 2 JTS.
SWI. SDFTD. - *MANUEL*

**MARBOB ENERGY CORPORATION
DODD FEDERAL UNIT #27 WIW
MARY DODD B #6
660 FNL 1980 FWL, SEC. 14-T17S-R29E, UNIT C
30-015-02978, GRBG JACKSON SR Q GRBG SA
EDDY COUNTY, NM**

3/17/08 START DO CMNT @ 3148'. FELL OUT OF CMNT @ 3320'. CIRC CLN. TEST CSG TO 1000# WATCH FOR 10 MIN & HELD. LD SWIVEL. RIH W/ 20 JTS OF TBG. TAG CIBP @ 4035'. PU SWIVEL. DO PLUG. FELL OUT @ 4053'. LD SWIVEL. RIH W/ 9 JTS. TAG @ 4330'. POOH W/ TBG & LD DCS. RIH W/ DRILL BIT, 4 1/2" CSG

3/18/08 L&R DELIVERED 130 JTS PC TBG. HAUL OFF W/S 145 JTS. TALLY TBG. RIH W/ R-4 NP PKR & 125 JTS 2 3/8" PC TBG. BASIC PMPD 25 BBLS PKR FL. WAIT 10 MIN. SET PKR @ 4010'. LOAD CSG W/ 25 BBLS PKR FL. PRESS UP TO 300# ON CHART. COULDN'T GET TEST. OCD WAS NOTIFIED. SWI. SDFTD. - *MANUEL*

3/19/08 BASIC PRESS UP TO 300#. LVL @ 260#. FL FORMED & COULDN'T GET GOOD TEST. COME BACK @ LATER DATE. - *MANUEL*

5/29/08 RU OK HOT OIL ON CSG. 1/2 BBLS TO LOAD CSG. PRESS TEST TO 345# FOR 30 MIN WITH A CHART RECORDER. TEST OK. RD OK HOT OIL. SWI. FINAL REPORT. - *MANUEL*