UNITED STATES DEPARTMENT OF THE INTERIOR

BUREAU OF LAND MANAGEMENT .

FORM APPROVED OMB No 1004-0137 Expires July 31, 2010

5 Lease Serial No

	LC	060398
--	----	--------

-		Y NOTICES ANI	-,						000398	
		this form for prop well. Use Form 31					6 If India	in, Allottee or	Tribe Name	
							7 If Unit	or CA/Agreem	ent, Name and/o	r No
SUE	SWII IN	TRIPLICATE - O	tner instruction	nspread	EIVED					*
1. Type of Well	🔽	•	*			, .	& Wall N	ame and No	087730 NN	171059
Oil Well Gas W	Vell 🔀	Other		N 0√	-4 2009	\dashv		,	emier Ut T	∵ 1 <u>#</u> 27.
Nordstrand Engine	ering In	, .					9 API W		enner ot i	1 1 1122
3a Address	cime in		3b Phone No (includ	ie MMQeC	D ARTESI			30-01	5-03860	. , ,
3229 D'Amico St.#2	200,Ho	uston,TX 77019	713-520-1555		,		10 Field		ploratory Area	
4 Location of Well (Footage	Sec, T, R	., M., or Survey Description	on) -				V	est Hensl	naw Grayb	urg
1980' FSL & 1980' I	· .				· · · · · · · · · · · · · · · · · · ·	,`	11 Coun	y or Parish, St		,
Sec. 4 (S), T-16-S, R		·			,				Co. NM	* 1
· · · · · · · · · · · · · · · · · · ·		PROPRIATE BOX	(ES) TO INDICA			· · · · · · · · · · · · · · · · · · ·	ORT, O	R OTHER I	DATA	
TYPE OF SUBMIS	SION				YPE OF ACTION	ON .		<u> </u>	· · · · · · · · · · · · · · · · · · ·	
, , ,		Acidize	Deepen		Production (Start	Resume)	□ w	ater Shut-Off	<i>:</i>	
Notice of Intent		Alter Casing	Fracture Tr	eat [Reclamantion		□ v	ell Integrity	٠,	
Subsequent Report		Casing Repair	New Constr	ruction	Recomplete			ther	1	
V F 1 AT		Change Plans	Plug and A	bandon [Temporarily Aba	ndon				
Final Abandonment Notice	ce 1	Convert to Injection	Plug Back	[Water Disposal	٠,				
3 Describe Proposed or C	Completed	Operation (clearly state	all pertinent details.	including es	timated starting date	e of any	proposed	work and an	proximate dura	tion thereo
@ 2750'. circulate h cement. SDFN. 10/08/09 Tag plug (iole w/ r @ 1761'	. POH w/ tbg. Pe	Spot 25 sx clas rf csg. @ 1250'	ss C ceme	nt on top of C	IBP. P 950'.	OH to	2013'. Spein rate @	ot 25 sx cla 900 psi. Se	ss C ₁ z'd. 70
@ 2750'. circulate h cement. SDFN. 10/08/09 Tag plug (sx class C cement. V cement. SDFN.	ole w/ r @ 1761' VOC 4	ND well head and nud laiden fluid. . POH w/ tbg. Pe hours. Tag plug (Spot 25 sx clas rf csg. @ 1250' @ 1003'. POH	ss C ceme '. RIH and w/ tbg. Pe	nt on top of C d set packer @ erf csg. @ 450	IBP. P 950'. '. Set p	OH to Pump acker	2013'. Spein rate @ @ 60'. Sq	ot 25 sx cla 900 psi. So z'd 70 sx cl	ss C pz'd. 70 ass C
@ 2750'. circulate h cement. SDFN. 10/08/09 Tag plug (sx class C cement. V	ole w/ r @ 1761' WOC 4 ! lug @ 30	ND well head and nud laiden fluid. . POH w/ tbg. Pe hours. Tag plug @ 00'. Perf. csg. @ 6	Spot 25 sx clas rf csg. @ 1250' @ 1003'. POH 60'. Sqz'd 30 sx	ss C ceme '. RIH and w/ tbg. Pe c class C c	nt on top of C d set packer @ erf csg. @ 450 ement down 5	IBP. P 950'. '. Set p	OH to Pump acker	2013'. Spein rate @ @ 60'. Sq	ot 25 sx cla 900 psi. So z'd 70 sx cl	ss C qz'd. 70 ass C
@ 2750'. circulate h cement. SDFN. 10/08/09 Tag plug (sx class C cement. V cement. SDFN. 10/09/09 Tagged pl	ole w/ r @ 1761' WOC 4 ! lug @ 30	ND well head and nud laiden fluid. . POH w/ tbg. Pe hours. Tag plug @ 00'. Perf. csg. @ 6	Spot 25 sx clas rf csg. @ 1250' @ 1003'. POH 60'. Sqz'd 30 sx	ss C ceme '. RIH and w/ tbg. Pe c class C c	nt on top of C d set packer @ erf csg. @ 450 ement down 5	IBP. P 950'. '. Set p 5 1/2 ar	OH to Pump acker id up a	2013'. Spin rate @ @ 60'. Sqannulas to	ot 25 sx cla 900 psi. So z'd 70 sx cl surface. C	ss C qz'd. 70 ass C ut off
@ 2750'. circulate h cement. SDFN. 10/08/09 Tag plug (sx class C cement. V cement. SDFN. 10/09/09 Tagged pl	ole w/ r @ 1761' WOC 4 ! lug @ 30	ND well head and nud laiden fluid. . POH w/ tbg. Pe hours. Tag plug @ 00'. Perf. csg. @ 6	Spot 25 sx clas rf csg. @ 1250' @ 1003'. POH 60'. Sqz'd 30 sx	ss C ceme '. RIH and w/ tbg. Pe c class C c	nt on top of C d set packer @ erf csg. @ 450 ement down 5	IBP. P 950'. '. Set p 5 1/2 ar	OH to Pump acker id up a	2013'. Spin rate @ @ 60'. Sqannulas to	ot 25 sx cla 900 psi. So z'd 70 sx cl surface. C	ss C nz'd. 70 ass C ut off
@ 2750'. circulate h cement. SDFN. 10/08/09 Tag plug (sx class C cement. V cement. SDFN. 10/09/09 Tagged pl	ole w/ r @ 1761' WOC 4 ! lug @ 30	ND well head and nud laiden fluid. . POH w/ tbg. Pe hours. Tag plug @ 00'. Perf. csg. @ 6	Spot 25 sx clas rf csg. @ 1250' @ 1003'. POH 60'. Sqz'd 30 sx	ss C ceme '. RIH and w/ tbg. Pe c class C c	nt on top of C d set packer @ erf csg. @ 450 ement down 5	IBP. P 950'. '. Set p 5 1/2 ar	OH to Pump acker id up a	2013'. Spin rate @ @ 60'. Sqannulas to	ot 25 sx cla 900 psi. So z'd 70 sx cl	ss C nz'd. 70 ass C ut off
@ 2750'. circulate h cement. SDFN. 10/08/09 Tag plug (sx class C cement. V cement. SDFN. 10/09/09 Tagged pl	0 1761' @ 1761' WOC 4 lug @ 30 on Dry	ND well head and nud laiden fluid. . POH w/ tbg. Pe hours. Tag plug @ 00'. Perf. csg. @ 6 Hole Marker. Cl	Spot 25 sx clas rf csg. @ 1250' @ 1003'. POH 60'. Sqz'd 30 sx ean location, r	ss C cemel '. RIH and w/ tbg. Pe c class C c igged dow	nt on top of C d set packer @ erf csg. @ 450 ement down 5	IBP. P 950'. '. Set p 5 1/2 ar	OH to Pump acker id up a	2013'. Spin rate @ @ 60'. Sqannulas to	ot 25 sx cla 900 psi. So z'd 70 sx cl surface. C	ss C qz'd. 70 ass C ut off
@ 2750'. circulate h cement. SDFN. 10/08/09 Tag plug (sx class C cement. V cement. SDFN. 10/09/09 Tagged pl	@ 1761' @ 1761' WOC 4 lug @ 30 on Dry	ND well head and nud laiden fluid. . POH w/ tbg. Pe hours. Tag plug @ 600'. Perf. csg. @ 6 Hole Marker. Cl	Spot 25 sx clas rf csg. @ 1250' @ 1003'. POH 50'. Sqz'd 30 sx ean location, r	ss C cemel '. RIH and w/ tbg. Pe c class C c igged dow	nt on top of C d set packer @ erf csg. @ 450 ement down 5	IBP. P 950'. '. Set p 5 1/2 ar	OH to Pump acker id up a	in rate @ @ 60'. Sq: annulas to	ot 25 sx cla 900 psi. So z'd 70 sx cl surface. C	ss C qz'd. 70 ass C ut off
@ 2750'. circulate h cement. SDFN. 10/08/09 Tag plug (sx class C cement. V cement. SDFN. 10/09/09 Tagged pl	(Accession of the leading wide) with the leading with the	ND well head and nud laiden fluid. POH w/ tbg. Pe hours. Tag plug @ 00'. Perf. csg. @ 6 Hole Marker. Checepted as to pluggebility under bond	Spot 25 sx class rf csg. @ 1250' @ 1003'. POH 50'. Sqz'd 30 sx ean location, right regions of the well is retained until	ss C cemel '. RIH and w/ tbg. Pe c class C c igged dow	nt on top of C d set packer @ erf csg. @ 450 ement down 5	IBP. P 950'. '. Set p 5 1/2 ar	OH to Pump acker id up a	2013'. Spin rate @ @ 60'. Sqannulas to	ot 25 sx cla 900 psi. So z'd 70 sx cl surface. C	ss C qz'd. 70 ass C ut off
@ 2750'. circulate h cement. SDFN. 10/08/09 Tag plug (sx class C cement. V cement. SDFN. 10/09/09 Tagged pl	(Accession of the leading wide) with the leading with the	ND well head and nud laiden fluid. POH w/ tbg. Pe hours. Tag plug @ 00'. Perf. csg. @ 6 Hole Marker. Checepted as to pluggebility under bond	Spot 25 sx class rf csg. @ 1250' @ 1003'. POH 50'. Sqz'd 30 sx ean location, right regions of the well is retained until	ss C cemel '. RIH and w/ tbg. Pe c class C c igged dow	nt on top of C d set packer @ erf csg. @ 450 ement down 5	IBP. P 950'. '. Set p 5 1/2 ar	OH to Pump acker id up a	in rate @ @ 60'. Sq: annulas to	ot 25 sx cla 900 psi. So z'd 70 sx cl surface. C	ss C qz'd. 70 ass C ut off
@ 2750'. circulate h cement. SDFN. 10/08/09 Tag plug (sx class C cement. V cement. SDFN. 10/09/09 Tagged pl	(Accession of the leading wide) with the leading with the	ND well head and nud laiden fluid. . POH w/ tbg. Pe hours. Tag plug @ 600'. Perf. csg. @ 6 Hole Marker. Cl	Spot 25 sx class rf csg. @ 1250' @ 1003'. POH 50'. Sqz'd 30 sx ean location, right regions of the well is retained until	ss C cemel '. RIH and w/ tbg. Pe c class C c igged dow	nt on top of C d set packer @ erf csg. @ 450 ement down 5	950'. Set p 5 1/2 ar	OH to Pump acker ad up a	in rate @ @ 60'. Sq. nnnulas to TED F	ot 25 sx cla 900 psi. So 2'd 70 sx cl surface. C OR RE 1 2009	ss C qz'd. 70 ass C ut off COR[
@ 2750'. circulate h cement. SDFN. 10/08/09 Tag plug (sx class C cement. V cement. SDFN. 10/09/09 Tagged pl	(Accession of the leading wide) with the leading with the	ND well head and nud laiden fluid. POH w/ tbg. Pe hours. Tag plug @ 00'. Perf. csg. @ 6 Hole Marker. Checepted as to pluggebility under bond	Spot 25 sx class rf csg. @ 1250' @ 1003'. POH 50'. Sqz'd 30 sx ean location, right regions of the well is retained until	ss C cemel '. RIH and w/ tbg. Pe c class C c igged dow	nt on top of C d set packer @ erf csg. @ 450 ement down 5	950'. Set p 5 1/2 ar	OH to Pump acker id up a	in rate @ @ 60'. Squannulas to OTED F NOV U OF LANG	ot 25 sx cla 900 psi. So z'd 70 sx cl surface. C	ss C qz'd. 70 ass C ut off CORI
@ 2750'. circulate h cement. SDFN. 10/08/09 Tag plug (sx class C cement. V cement. SDFN. 10/09/09 Tagged pl well head and weld	Ac Ling was	ND well head and nud laiden fluid. POH w/ tbg. Pe hours. Tag plug (200'. Perf. csg. (200') Hole Marker. Clucepted as to pluggability under bondurface restoration i	Spot 25 sx class rf csg. @ 1250' @ 1003'. POH 50'. Sqz'd 30 sx ean location, right regions of the well is retained until	ss C cemel '. RIH and w/ tbg. Pe c class C c igged dow	nt on top of C d set packer @ erf csg. @ 450 ement down 5	950'. Set p 5 1/2 ar	OH to Pump acker id up a	in rate @ @ 60'. Sq. nnnulas to TED F	ot 25 sx cla 900 psi. So 2'd 70 sx cl surface. C OR RE 1 2009	ss C qz'd. 70 ass C ut off CORI
@ 2750'. circulate h cement. SDFN. 10/08/09 Tag plug (sx class C cement. V cement. SDFN. 10/09/09 Tagged pl well head and weld	Ac Ling was	ND well head and nud laiden fluid. POH w/ tbg. Pe hours. Tag plug (200'. Perf. csg. (200') Hole Marker. Clucepted as to pluggability under bondurface restoration i	Spot 25 sx class rf csg. @ 1250' @ 1003'. POH 50'. Sqz'd 30 sx ean location, right regions of the well is retained until	ss C ceme '. RIH and w/ tbg. Po c class C c igged down	nt on top of C d set packer @ erf csg. @ 450 ement down 5 vn moved off.	950'. Set p	Pump acker and up a	in rate @ @ 60'. Squannulas to OTED F NOV U OF LANG	ot 25 sx cla 900 psi. So 2'd 70 sx cl surface. C OR RE 1 2009	ss C qz'd. 70 ass C ut off COR[
@ 2750'. circulate h cement. SDFN. 10/08/09 Tag plug (sx class C cement. V cement. SDFN. 10/09/09 Tagged pl well head and weld	Ac Ling was	ND well head and nud laiden fluid. POH w/ tbg. Pe hours. Tag plug (200'. Perf. csg. (200') Hole Marker. Clucepted as to pluggability under bondurface restoration i	Spot 25 sx class rf csg. @ 1250' @ 1003'. POH 50'. Sqz'd 30 sx ean location, right regions of the well is retained until	ss C ceme '. RIH and w/ tbg. Po c class C c igged down	nt on top of C d set packer @ erf csg. @ 450 ement down 5 vn moved off.	950'. Set p 1/2 ar	Pump acker and up a	in rate @ @ 60'. Squannulas to OTED F NOV U OF LANG	ot 25 sx cla 900 psi. So 2'd 70 sx cl surface. C OR RE 1 2009	ss C nz'd. 70 ass C ut off COR[
@ 2750'. circulate h cement. SDFN. 10/08/09 Tag plug (sx class C cement. V cement. SDFN. 10/09/09 Tagged pl well head and weld	Action of the state of the stat	ND well head and nud laiden fluid. POH w/ tbg. Pe hours. Tag plug (200'. Perf. csg. (200') Hole Marker. Clucepted as to pluggability under bondurface restoration i	Spot 25 sx class rf csg. @ 1250' @ 1003'. POH 50'. Sqz'd 30 sx ean location, right is retained until s completed.	ss C ceme '. RIH and w/ tbg. Po c class C c igged down	nt on top of C d set packer @ erf csg. @ 450 ement down 5 vn moved off.	950'. Set p 1/2 ar	Pump acker and up a	in rate @ @ 60'. Squannulas to OTED F NOV U OF LANG	ot 25 sx cla 900 psi. So 2'd 70 sx cl surface. C OR RE 1 2009	ss C qz'd. 70 ass C ut off COR[
@ 2750'. circulate h cement. SDFN. 10/08/09 Tag plug (sx class C cement. V cement. SDFN. 10/09/09 Tagged pl well head and weld 14 I hereby certify that the f Name (Pynted Tagged)	Action of the state of the stat	ND well head and nud laiden fluid. POH w/ tbg. Pe hours. Tag plug (200'. Perf. csg. (200'). Hole Marker. Characteristic and correct (100'). True and correct (100'). True and correct (100').	Spot 25 sx class rf csg. @ 1250' @ 1003'. POH 50'. Sqz'd 30 sx ean location, right is retained until s completed.	ss C cemel '. RIH and w/ tbg. Po c class C c igged dow bore. il	nt on top of C d set packer @ erf csg. @ 450 ement down 5 on moved off.	950'. Set p 1/2 at	Pump acker ad up a	in rate @ @ 60'. Squannulas to OTED F NOV U OF LANG	ot 25 sx cla 900 psi. So 2'd 70 sx cl surface. C OR RE 1 2009	ss C qz'd. 70 ass C ut off CORC
@ 2750'. circulate h cement. SDFN. 10/08/09 Tag plug (sx class C cement. V cement. SDFN. 10/09/09 Tagged pl well head and weld 14 I hereby certify that the f Name (Printed Tagged)	Action of the state of the stat	ND well head and nud laiden fluid. POH w/ tbg. Pe hours. Tag plug (200'. Perf. csg. (200'). Hole Marker. Characteristic and correct (100'). True and correct (100'). True and correct (100').	Spot 25 sx class rf csg. @ 1250' @ 1003'. POH 60'. Sqz'd 30 sx ean location, right is retained until s completed.	ss C cemel '. RIH and w/ tbg. Po c class C c igged dow bore. il	nt on top of C d set packer @ erf csg. @ 450 ement down 5 on moved off.	950'. Set p 1/2 at	Pump acker ad up a	in rate @ @ 60'. Squannulas to OTED F NOV U OF LANG	ot 25 sx cla 900 psi. So 2'd 70 sx cl surface. C OR RE 1 2009	ss C qz'd. 70 ass C ut off
@ 2750'. circulate h cement. SDFN. 10/08/09 Tag plug (sx class C cement. V cement. SDFN. 10/09/09 Tagged pl well head and weld 14 I hereby certify that the f Name (Printed Tagged)	Action of the state of the stat	ND well head and nud laiden fluid. POH w/ tbg. Pe hours. Tag plug (200'. Perf. csg. (200'). Hole Marker. Characteristic and correct (100'). True and correct (100'). True and correct (100').	Spot 25 sx class rf csg. @ 1250' @ 1003'. POH 60'. Sqz'd 30 sx ean location, right is retained until s completed.	ss C ceme '. RIH and w/ tbg. Pe c class C c igged dow bore. il Trile Date	nt on top of C d set packer @ erf csg. @ 450 ement down 5 on moved off.	950'. Set p 1/2 at	Pump acker ad up a	in rate @ @ 60'. Squannulas to OTED F NOV U OF LANG	ot 25 sx cla 900 psi. So 2'd 70 sx cl surface. C OR RE 1 2009	ss C qz'd. 70 ass C ut off CORC
@ 2750'. circulate h cement. SDFN. 10/08/09 Tag plug (sx class C cement. V cement. SDFN. 10/09/09 Tagged pl well head and weld 14 I hereby certify that the f Name (Printed Trage) Signature	Ac Li St	ND well head and nud laiden fluid. POH w/ tbg. Pe hours. Tag plug @ 00'. Perf. csg. @ 6 Hole Marker. Cluber ability under bond arface restoration in true and correct) THIS SPACE.	Spot 25 sx class rf csg. @ 1250' @ 1003'. POH 50'. Sqz'd 30 sx ean location, right is retained until s completed.	ss C cemel '. RIH and w/ tbg. Po c class C c igged dow bore. il Title Date ERAL OR	ement down 5 or moved off. President STATE OFF	950'. Set p 1/2 at	Pump acker ad up a	in rate @ @ 60'. Sq: nnulas to OTED F NOV U OF LANI RLSBAD FI	ot 25 sx cla 900 psi. So z'd 70 sx cl surface. C OR RE	ss C qz'd. 70 ass C ut off COR[

(Instructions on page 2)