Form 3160-5

UNITED STATES

FORM APROVED

(February 2005)		SENT OF THE INTERIOR OF LAND MANAGEMENT	OCE) Artesia		NO. 1004-0137 S: March 31, 2007
		ES AND REPORTS ON WI	ELLS	5. Le	ase Serial No.	O. Maron 01, 2001
Do not use this form for proposals to drill or to re-enter an					NM 96822	
abandoned well. Use Form 3160-3 (APD) for such proposals SUBMIT IN TRIPLICATE - Other instructions on page 2					6. If Indian, Allottee or Tribe Name	
				7. Un	it or CA Agree	ment Name and No.
. Type of Well Oil V	Vell 🔲 Gas Well	☑ Other SWD WELL		8 We	Il Name and N	0.
2. Name of Operator					LEVERS FEDERAL 2 SWD	
	ERGY PRODUCTIO	N COMPANY, LP	1 .		'I Well No.	
Ba, Address			3b. Phone No. (include a	· .		0-015-20963
 20 North Broadway, Ste 1500, Oklahoma City, OK 73102 4. Location of Well (Footage, Sec., T., R., M., or Survey Description) 1650 FSL 1650 FEL 2 T21S R25E 			405-552-4615		10. Field and Pool, or Exploratory Area SWD UPPER PENN	
			<i>y</i>		11. County or Parish, State	
					Eddy	NM
TYPE OS SUB	12. CHECK AI	PPROPRIATE BOX(es) TO	INDICATE NATURE OF N	OTICE, REPORT OR E OF ACTION	OTHER DAT	<u> </u>
			r=1		+/Documo)	☐ Water Shut-Off
Notice of Intent		☐ Acidize☐ Alter Casing	☐ Deepen ☐ Fracture Treat	Production (Star	(/Resume)	Well Integrity
Subsequent Rep	port	Casing Repair	New Construction	Recomplete		Other
Final Abandonm	nent Notice	Change Plans	Plug and Abandon	Temporarily Aba	ndon	
	1	Convert to Injection	Plug Back pertinent dates, including estimated	Water Disposal		
 Spot 25 sx (25 Cut 5-1/2" casi Spot 50 sx stul 	0') cmt on CIBP (ng @ +/- 5900'. o plug 50' below s		58'. Tag TOC.	SEE ATTA CONDITIO	- ·	FOR APPROVAL
6. Spot 50 sx cmt 7. Spot 132 sx cn 8. Cut wellhead o	plug @ 2869'. T nt plug from 400' ff 3' BGL.	OC calc. @ 2713'. T				
9. Set dry hole m	arker.	Γ	RECEIVED	,		
				1	JECT TO	LIKE
	ION PROCEDURE		DEC 22 2010			BY STATE
TA	TACHED	1.	MOCD ARTESI		- + = =4.6	wates#
-		[]	AINIOOD / II I I EOI			
4. I hereby certify that	the foregoing is true	and correct				
Name: Ronnie Sla		Title	Operations Tech	nician		
ignature RTM	u Stack	Date	12-15-10			
		THIS SPACE FOR	FEDERAL OR STATE			
pproved by	AAT.		APP	KUVLU		
		//		1_3	. 1	·
	1000	Title		0 \$ 0010	ite	· · · · · · · · · · · · · · · · · · ·
conditions of approval, otice does not warrant	if any are attached.	Approval of this		da 2 1 2010 n Winkler	ite	· · · · · · · · · · · · · · · · · · ·


BUREAU OF LAND MANAGEMENT


renited States any false, fictitious or fraudulent statements or

Office

notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would

entitle the applicant to conduct or operations thereon.

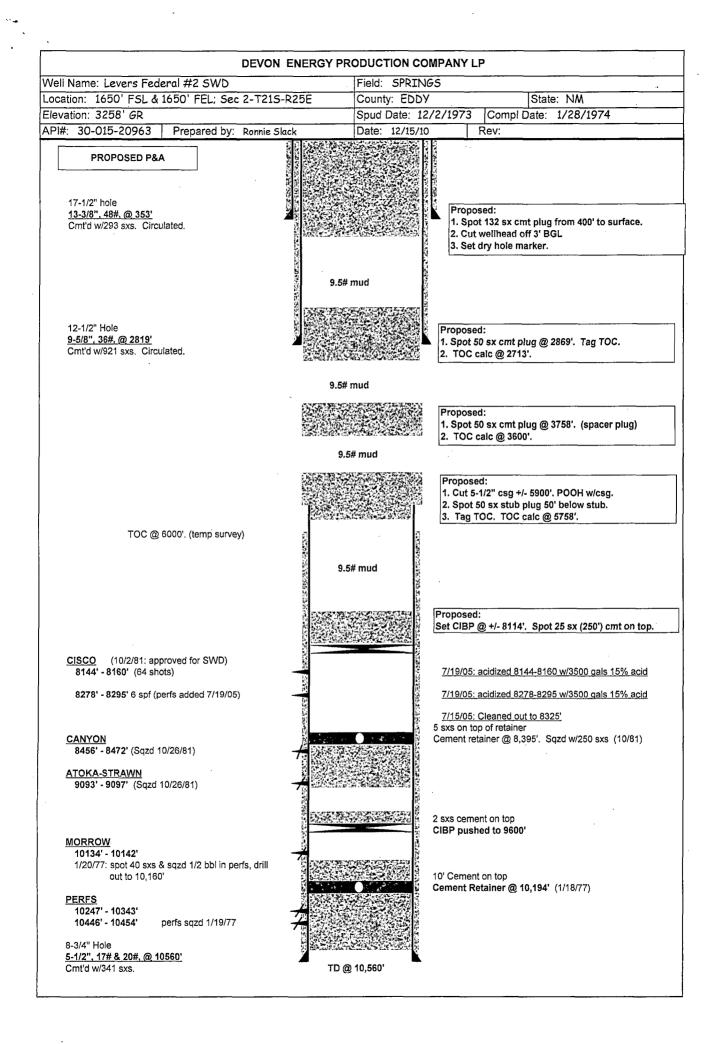

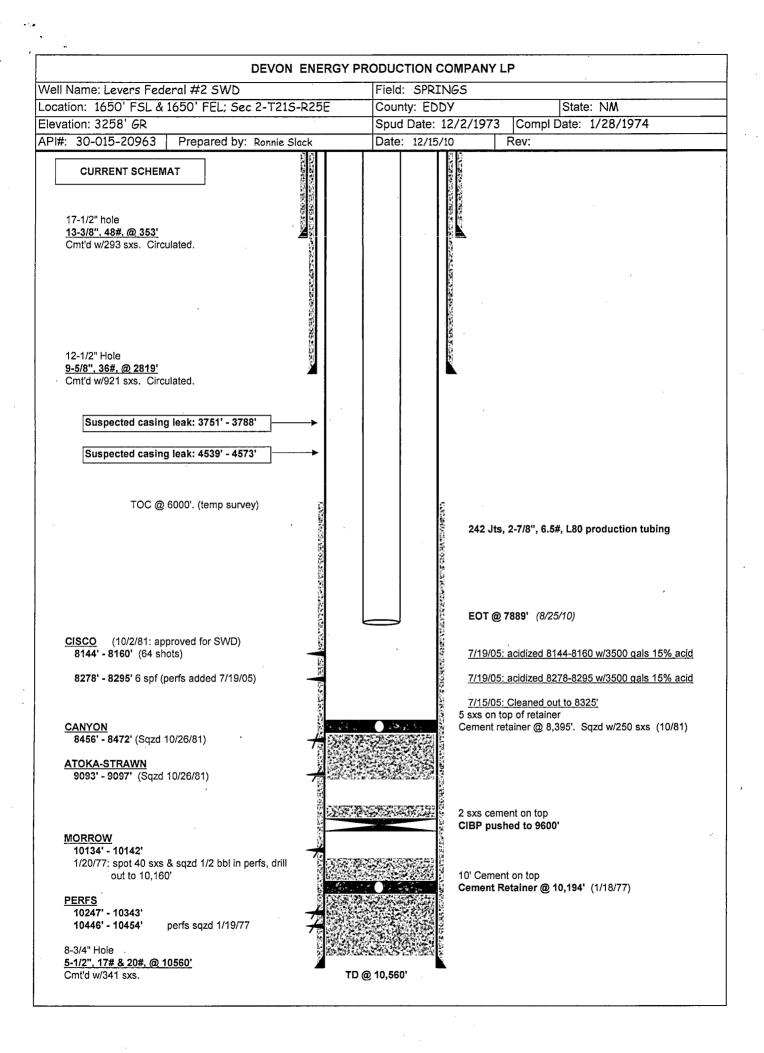

Devon Energy Production Company, LP NM-96822: Levers Federal #2 SWD API: 30-015-20963 Eddy County, New Mexico

RE: Plugging and Abandonment Requirements, Conditions of Approval

- 1. Set CIBP at approx 8094' Otherwise OK
- 2. OK (Perfs)
- 2a. Spot s minimum 25sx of class H cement from 7720'-7540'. (Wolfcamp)
- 3. OK
- 4. Tag 110' above the stub (50sx adequate) or shallower. If multiple cuts are made, contact the BLM for changes Otherwise OK. (Stub)
- 5. Tag at 3600' or shallower Otherwise OK (Spacer)
- 5a. Spot a plug (approx 45sx) from 3200'-3070'. WOC and tag at 3070' or shallower. (Bone Spring)
- 6. Tag at 2713' or shallower Otherwise OK (Casing shoe)
- 6a. Spot a plug from 1860'-1740' (approx 40sx). (Delaware)
- 7. Due to being located within the High Cave/Karst region, a solid cement plug from 400' to surface is required Otherwise OK (Cave/Karst Casing shoe Surface)
- 8. OK
- 9. Verify cement to surface in all annuluses Otherwise OK
- 10. Submit a subsequent report to the BLM.

H₂S monitoring equipment shall be on location.

See attached standard COAs.

DHW 122110

BUREAU OF LAND MANAGEMENT

Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification</u>: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. Cement Requirement: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. In lieu of a cement plug in a cased hole, a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Any plug that requires a tag will have a minimum WOC time of 4 hours.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

- 6. Dry Hole Marker: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified when the wellhead is cut off to verify that cement is to surface in the casing and all annuluses. The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement. The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).
- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and five copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation procedure.

DHW 112309



United States Department of the Interior

BUREAU OF LAND MANAGEMENT

Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its pre-disturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines. Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

1. The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.

- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months of well abandonment.
- 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.
- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Environmental Protection Specialist 575-234-5909, 575-361-2648 (Cell)

Terry Gregston Environmental Protection Specialist 575-234-5958

Bobby Ballard Environmental Protection Specialist 575-234-2230

Randy Rust Natural Resource Specialist 575-234-5943

Linda Denniston Environmental Protection Specialist 575-234-5974

Jennifer Van Curen Environmental Protection Specialist 575-234-5905

Justin Frye Environmental Protection Specialist 575-234-5922 Cody Layton Natural Resource Specialist 575-234-5959

Trishia Bad Bear Natural Resource Specialist 575-393-3612

Todd Suter Surface Protection Specialist 575-234-5987

Doug Hoag Civil Engineering Technician 575-234-5979

Tanner Nygren Natural Resource Specialist 575-234-5975

John Fast Natural Resource Specialist 575-2345996