


30.005-61344

660 S / 1980 W - 32-55-24e

Jack J. Grynberg

Grynberg 32 St. #3

After

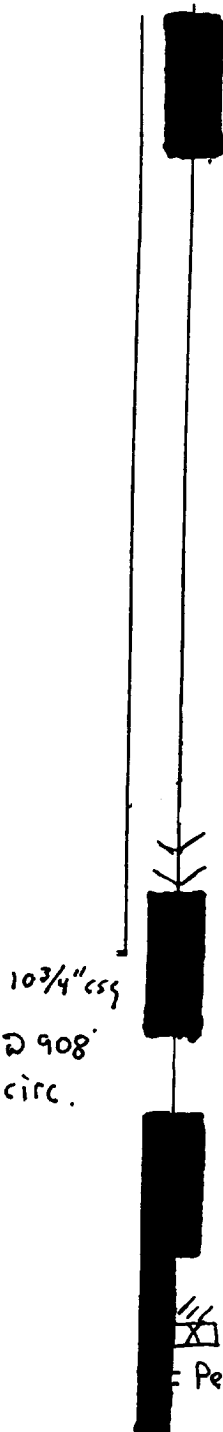

1. Run + set CIBP @ 3673' w/ 35' cement  
or Run tubing to 3673'.

Set 25 sx cement Plug 3673'-3573'. TAG

2. Circulate brine gel.

3. Set 25 sx cement Plug 2180'-2080'.

4. Perforate 4 1/2" casing @ 958'.

R

5. Run Packer, squeeze cement  
100' cement Plug inside + outside 4 1/2" casing. TAG

6. Perforate 4 1/2" casing @ 100'

7. Circulate cement to surface  
inside + outside 4 1/2" casing.

Perfs 3773'-3953'

8. cut + level all surface pits,  
cut deadmen, clear location of junk,  
Erect dry hole marker.

4 1/2" csg

@ 4120'

ToC - 2080'