

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

CONVERSION
SUBMIT IN 1 LOCATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 1004-013
Expires August 31, 1985

d5F

LC-029418 (A)

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to develop a well back to a different reservoir.
Use "APPLICATION FOR RECEIVED BY" for such proposals.)

1.

OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. NAME OF OPERATOR

Texaco Producing Inc.

3. ADDRESS OF OPERATOR

P. O. Box 728, Hobbs, New Mexico 88240

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.
See also space 17 below.)
At surface

Unit Letter H, 1980' FNL & 660' FEL

14. PERMIT NO.

30-015-05368

15. ELEVATIONS (Show whether DF, RT, CR, etc.)

3886' DF

RECEIVED BY

JUN -5 1987

O. C. D.

ARTESIA, OFFICE

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Skelly Unit

9. WELL NO.

30

10. FIELD AND POOL, OR WILDCAT

Grayburg-Jackson
R-ON-GB-SA

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Sec. 23-17S-31E

12. COUNTY OR PARISH 13. STATE

Eddy

NM

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐

FRACTURE TREAT ☐

SHOOT OR ACIDIZE ☐

REPAIR WELL ☐

(Other) ☐

PULL OR ALTER CASING ☐

MULTIPLE COMPLETE ☐

ABANDON* ☐

CHANGE PLANS ☐

X

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐

FRACTURE TREATMENT ☐

SHOOTING OR ACIDIZING ☐

(Other) ☐

REPAIRING WELL ☐

ALTERING CASING ☐

ABANDONMENT* ☐

(Note: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

- 1) MIRU pulling unit. Install BOP.
- 2) RIH with 2 7/8" workstring to \pm 2800'. Install 3000 psi WP tubing valve on 2 7/8" tubing. Sting into cement retainer at 2806'. Backflow until feasible to work on well.
- 3) POH with 2 7/8" tubing. RIH with bit, drill collars, and 2 7/8" tubing. Drill out cement retainer at 2806'. Circulate sand off RBP at 3164'. POH. RIH and retrieve RBP. POH.
- 4) TIH with 4 3/4" bit on 2 7/8" tubing. Clean out to PBTD at 3845'. Circulate hole clean. POH.
- 5) TIH with 2 3/8" tubing, pump, and rods. Place well on production.

18. I hereby certify that the foregoing is true and correct

397-3571

SIGNED

TITLE

Hobbs Area Superintendent

DATE

June 3, 1987

(This space for Federal or State office use)

APPROVED BY

TITLE

AREA MANAGER
CARLSBAD RESOURCE AREA

DATE

6-15-87

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side