

Notice of Intent for the Federal KK #1
Anadarko Petroleum Corporation
5-16-95
Page 2

1. RUPU. TOH with tbg and packer.
2. Set a CIBP within 100' of the top perf (see attached well bore diagram). Circulate casing with chemical water.
3. GIH with packer and establish where the casing leak is. Note: holes in casing should be shallow (300' to 600') based on other wells in this area that had leaks.
4. Do procedure "A" if leak is above the base of the salt section or procedure "B" if leak is below the base of the salt section.

A. GIH with packer on injection tbg and set packer approximately 50' below the casing leak. Run casing integrity test by putting 500# on tbg and casing below the packer for 15 minutes. RDPU and leave the packer set in this well to keep the casing integrity.

B. GIH with tbg open ended and spot 35' of cement of top of CIBP. Pull up and spot 100' of cement across the Queen formation top. TOH. GIH with packer and cement squeeze out holes in casing with enough cement to bring the cement top behind the casing up to the base of the salt. WOC. TOH with packer and test casing to 500# for 15 minutes. This would leave the well in shape to be P&A at a later time by setting the upper plugs or reactivate by drilling out. RDPU.

5. Well would be TA at this time and all the bradenhead valves would be left open and monitored to check for water flows.

Note: The BLM and the NMOCDC would be notified at least 24 hours before starting work on well.