

Subsequent Report  
Plug Back  
Page 2

12. Loaded hole with 10# brine salt gel mud. Shut down; wait 10 minutes - hole standing full.
13. Set Plug #4 (50sx Class C) 3555' - 3361' (tagged). Plug #4 is across 9-5/8" casing shoe.
14. Set 9-5/8" CIBP @ 3355' (as a safety precaution prior to fracing).
15. Perforated Queen 2474' - 2500' @ 2 SPF (total 52 holes with .50 diameter) inside 9-5/8" casing.
16. Acidize Queen (2474' - 2500') with 2000 gal 15% NEFE and 104 B.S.
17. Fraced Queen (2474' - 2500') with 20,000 gas X-linked gel and 25,500# 20/40 sd and 8000# 12/20 sd.
18. Ran tubing and rods. Put well on pump.