

Operator SWR Operating Co. -
Well Featherstone #4
Unit J Section 5 Township 19 Range 31
API # 30-015-05747

TOPS

T. Salt 860
B. Salt 1975
Yates 2440
Glorieta _____
Delaware _____
Bone Sp. _____
Abo _____
Wolfcamp _____
Morrow _____
Devonian _____
Fusselman _____
Other _____

← Perf 8 5/8" 5 1/2" @ 60' - Place 60' of cmt
0'-60' inside & outside of Both
CSG. strings

← Place 100' of cmt 729'-829' inside &
outside of CSG. - TAG

← Perf CSG @ 829'

← Place 100' of cmt 2000'-2100' inside &
outside of CSG. TAG

← Perf CSG @ 2100'

3053' - TOC @ 56%

← 25 SX Plug @ 3500' TAG

3530
3575 - Perfs

5 1/2" 3625
150 SX
7 7/8" hole

- Contact OCD 24 hrs. prior to any work done
- Salt gel mud consisting of 10# brine with 2% of gel per barrel must be placed between each plug
- Install dry hole marker as per rule 202.B.2
- Plugs are to be set from point indicated up. Plugs must not be less than 100' or 25 Sack of cement, whichever is greater, unless specifically indicated.
- Shoe and stub plugs will be 50' above and below shoe or stub and tagged.
- Surface plug will be from 0' - 60'
- Where plugs are required cement must be placed inside and outside of all casing string(s), in the correct footage or sacks required, if no cement exists.
- Plugs to be tagged will be indicated.