## RECEIVED

## DRILLING PROGNOSIS Sweeney Federal Ho. 1. Page Two

## DEC 1 1 1964

O. C. C. ARTESIA, OFFICE

11. Drill 7 7/8" hole to 11600'\*. 12. Run 4 1/2" casing as follows:

> 0 - 3300': 11.6 #/ft, M-80, LT&C 3300 - 8000': 11.6 #/ft., J-55, ST&C 8000 - 11600': 11.6 #/ft., M-80, LT&C

Use float shoe, differential fill-up collar. Use reciprocating scratchers and centralizers to cover productive interval.

- 13. Cement with sufficient 50-50 Pozmix S cement with 0.4% HR-4 to cover somes of interest. Tail in with enough Latex cement to 100° above pay zones. Use 2 sx of lime in 10 bbls. water ahead of cement. Add 2 sx modium bichromate to mad system prior to running casing. Be sure paddle mixer truck is available for mixing Latex cement.
- 14. If float holds, land casing as comented, release pressure immediately, nipple up, WOC 8 hrs., run temperature survey, and release rig.

## DRILLING FLUIDS PROGRAM:

1. SUFFACE HOLE - 0 - 700'1: Spai mai with viscosity as needed to clean hole. Use fiber for loss of circulation if needed. 2. INTERMEDIATE - 700-4000 1: Use saturated brine water. Add water to maintain minimum viscosity needed. If hole gives trouble, lower water loss to 20 cc to run csg. NOTE: If severe loss of circulation is encountered below 2800', hole will be dry drilled using fresh water to intermediate point. Drilling should not be stopped to combat loss of circulation. If necessary, to clean hole before running casing, hole can be cleaned using a slug of and with sufficient viscosity to move cuttings into caverns. 3. BELOW INTERMEDIATE - 4000-11300 1: Clear water treated with surfactant, some treatment with paper may be required to reduce lo losses. Line should be added to keep pH above 10 for corresion control. If necessary to weight up to control any kicking formation, use brins to weight up system. Do not mud up until 11300' is reached. 4. 11300 - T.D.: Use low solids, CMC system with the following properties: Weight: 9.5 to 9.8 lbs./gal. as needed Viscosity: 38-42 seconds Water Loss: 20 - 25 cc Add chemicals and materials as needed to maintain good hole condition to T.D.