

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPLICATE
(Other copies to be
submitted on re-

Budget Bureau No. 1004-
Expires August 31, 1985

5. LEASE DESIGNATION AND SERIAL

LC-029392-B

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Hinkle "F"

9. WELL NO.

8

10. FIELD AND POOL OR WILDCAT

Shugart (Y, Q, G, SR)

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Sec. 27, T-18-S, R-31-E

12. COUNTY OR PARISH 13. STATE

Eddy

N.M.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☐ GAS WELL ☐ OTHER ☒ Plugged & Abandoned

2. NAME OF OPERATOR

Southland Royalty Company

3. ADDRESS OF OPERATOR

21 Desta Drive, Midland, Texas 79705

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.
See also space 17 below.)
At surface

2310' FSL & 990' FWL, Sec. 27, T-18-S, R-31-E

14. PERMIT NO.

30-015-10760

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

3356' GR

RECEIVED BY
MAY 11 1987

O. C. D.
ARTESIA, OFFICE

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐

FRACTURE TREAT ☐

SHOOT OR ACIDIZE ☐

REPAIR WELL ☐

(Other) ☐

PULL OR ALTER CASING ☐

MULTIPLE COMPLETE ☐

ABANDON* ☐

CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐

FRACTURE TREATMENT ☐

SHOOTING OR ACIDIZING ☐

(Other) ☒ P&A'd

REPAIRING WELL ☐

ALTERING CASING ☐

ABANDONMENT* ☒

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.) *

1. RU to perf sqz holes. MIRUCU. RIH w/7" cmt ret & 2 3/8" tbg. Set ret @ 2373'. Est rate 3 BPM @ 1800#. Cmt w/200 sx C1 "C". POH LD stinger. RIH OE. Tag cmt ret @ 2373'. Pmp 225 sx C1 "C" cmt. Pull tbg to 850'. Circ clean. POH w/tbg.
2. RIH w/tbg to cmt. Tag cmt @ 1147'. Perf 4 sqz holes @ 840'. RIH w/7" pkr & 2 3/8" tbg. Set pkr @ 816'. Pmp dwn tbg. No circ. Pmp 70 sx C1 "C" cmt. POH. WOC 2 1/2 hrs. RIH to tag cmt. Could not tag. Set pkr @ 816'. Pmp into sqz holes on vac. Pmp 70 sx C1 "C" cmt. POH. WOC 4 hrs. RIH to 860'. Could not tag cmt. Pmp in on vac. Set pkr @ 816'. Pmp 100 sx C1 "C" w/4% CaCl. POH w/tbg & pkr.
3. RU to pmp cmt. RIH w/pkr & tbg. Set pkr @ 816'. Est rate thru sqz holes @ 840'. 2 BPM @ 1000#. Worked pipe. Broke circ behind 7" csg. Est rate 4 BPM @ 750#. Pmp 60 sx C1 "C" cmt. Circ cmt out 8 5/8". Unseated pkr. Pmp 200 sx C1 "C" cmt. Did not circ. POH. WOC 4 hrs. RIH & tag cmt @ 840'. POH. RIH w/7" pkr. Break circ out 8 5/8" 2 BPM @ 400#. POH.
4. RIH w/7" pkr & tbg to 816'. Pmp 200 sx C1 "C" cmt. Circ cmt thru 8 5/8" csg. Unseat pkr. Circ thru 7" csg. POH LD tbg & pkr. RD unit. Cut off & weld on plate & dry hole marker. Well plugged & abandoned 1/25/87 per BLM & NMOCD.

18. I hereby certify that the foregoing is true and correct

SIGNED

Linda S. C. Rondell

TITLE

Engineering Tech III

DATE

1/26/87

(This space for Federal or State office use)

Orig. Sdr. Linda S. C. Rondell

APPROVED BY

Acting Area Manager

TITLE

DATE

2-23-87

CONDITIONS OF APPROVAL, IF ANY:

Post ID-2
2-6-87
P+A

*See Instructions on Reverse Side