

## NEW MEXICO OIL CONSERVATION COMMISSION

RECEIVED

Supersedes Old  
C-102 and C-103  
Effective 1-1-65

JAN 24 1980

O. C. D.

ARTESIA, OFFICE

## SUNDRY NOTICES AND REPORTS ON WELLS

DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.  
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)OIL  
WELL ☐GAS  
WELL ☒

OTHER-

Name of Operator

Wayman W. Buchanan

Address of Operator c/o Petroleum Technical Services Company,

400 Building of the Southwest, Midland, Texas 79701

Location of Well

UNIT LETTER J 1980 FEET FROM THE East LINE AND 1830 FEET FROM  
THE South LINE, SECTION 18 TOWNSHIP 20-S RANGE 25-E NMPM.

15. Elevation (Show whether DF, RT, GR, etc.)

3,597' KDB

5a. Indicate Type of Lease

State ☐Fee ☒

5. State Oil &amp; Gas Lease No.

NA

7. Unit Agreement Name

Osage Comm.

8. Farm or Lease Name

Osage Comm.

9. Well No.

1

10. Field and Pool, or Wildcat  
North Cemetery

W. F. C. P.

12. County  
Eddy

## Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

## NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐PLUG AND ABANDON ☒TEMPORARILY ABANDON ☐PULL OR ALTER CASING ☐CHANGE PLANS ☐OTHER ☐

## SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐COMMENCE DRILLING OPNS. ☐CASING TEST AND CEMENT JOB ☐OTHER ☐ALTERING CASING ☐PLUG AND ABANDONMENT ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Estimated starting date 2-15-80. Contractor - Lea County Casing Pullers.

12 3/4" 220-lbs. 8 7/8" 3130-lbs. 4 1/2" 9640 TDC 5786 Perfs 7059 - 7122

- 1) Move in and rig up pulling unit. Blow well down and install blow-out preventers. Release packer and pull and lay down tubing and packer. Release pulling unit.
- 2) Move in and rig up casing pulling unit.
- 3) Set cast iron bridge plug on sand line at 7,000' and dump two sacks (20') of cement on plug with dump bailer on sand line.
- 4) Run free point and cut-off 4-1/2" casing at approximately 5,700'.
- 5) Pull and lay down 4-1/2" casing and spot 40 sack cement plug from 3,180' to 3,080'. Lay down all 4-1/2" casing. Remove casing head.
- 6) Spot 10 sack cement plug from 20' to surface in 8-5/8" casing. Set packer and clean location.

\* 30' of cement on BP @ 7000'  
Spot a 35 sack plug in and out of 4 1/2" stick and tag  
" " 40 " " 3080-3180' and tag  
" " 35 " " 900-1000'  
" " 10 " " at surface w/ marker

Intervals between plugs to be filled w/ mud

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED: W. A. Gressett TITLE: Agent

1-23-80

APPROVED BY: W. A. Gressett

TITLE: SUPERVISOR, DISTRICT II.

DATE: JAN 28 1980

CONDITIONS OF APPROVAL, IF ANY:

\* as noted above

Notify N.M.O.C.C. in sufficient time to witness

Plugging