

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	☒
FILE	☒
U.S.G.S.	
LAND OFFICE	
OPERATOR	☒

RECEIVED BY

DEC 08 1984 CONSERVATION DIVISION

P.O. BOX 2088

SANTA FE, NEW MEXICO 87501

Form C-101
Revised 11-1-79

0+6-AR-1551-1-1
1-Mr. J. Browning
1-File
1-Engr. PJB
1-Foreman
1-JA
1-BB

1. State of Type of Well	State ☒ New Mexico
2. State of License No.	V-993 & V-992

SUNDRY NOTICES AND REPORTS ON WELLS

DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG A WELL IN A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT TO DRILL" (FORM C-101) FOR SUCH PROPOSALS.

1. OIL WELL ☐ GAS WELL ☒ OTHER ☐	7. Unit Agreement Name
2. Name of Operator Getty Oil Company	8. Farm or Lease Name Getty "IB" 32 State
3. Address of Operator P.O. Box 730, Hobbs, NM 88240	9. Well No. 1
4. Location of Well UNIT LETTER <u>L</u> <u>1320</u> FEET FROM THE <u>South</u> LINE AND <u>660</u> FEET FROM THE <u>West</u> LINE, SECTION <u>32</u> TOWNSHIP <u>21S</u> RANGE <u>24E</u> N.M.P.M.	10. Field and Pool, or Wildcat Indian Basin
15. Elevation (Show whether DF, RT, GR, etc.) 4295' GR	12. County Eddy

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPS. ☐	PLUG AND ABANDONMENT ☒
PULL OR ALTER CASING ☐	OTHER ☐	CASING TEST AND CEMENT JOB ☐	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- TOH and lay down fishing tools, drill collars and casing.
- Left 684' of fish in hole.
- Trip in hole open ended with drill pipe to 465'. Tag @ 465'.
- 1st plug - spot 50/50 plug of calseal and cement @ 465'. WOC 3 hours. Tag plug @ 415'.
- 2nd plug - spot 125 sxs. 50/50 plug of calseal and cement @ 405'. WOC 3 hours. Tag plug @ 387'.
- 3rd plug - spot 100 sxs. 50/50 plug of calseal and cement @ 385'. WOC 3 hours. Tag @ 385', no plug.
- Dump 12 yds. of peagravel.
- 4th plug - spot 75 sxs. 50/50 plug of calseal and cement @ 385'. WOC 3 3/4 hours. Tag @ 383'.
- 5th plug - spot 200 sxs. 50/50 plug of calseal and cement @ 383'. WOC 3 3/4 hours. Tag @ 383'.
- 6th plug - spot 100 sxs. 50/50 plug of calseal and cement @ 383'. WOC 3 1/2 hours. Tag @ 383'.
- Dump 12 yds. ready mix. WOC 4 1/2 hours. Tag @ 380'.
- 7th plug - spot 100 sxs. 50/50 plug of calseal and cement @ 380'. WOC 4 hours. Tag @ 380'.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

Robert J. Paradiso for Area Superintendent
Dale R. Crockett December 4, 1984

Post ID-2
12-7-84
P4H

Approved by Larry Brooks Geologist Date 2-22-85

CONDITIONS OF APPROVAL, IF ANY: