

INDIAN HILLS AGR STATE NO 1
UNIT M 660' FSL AND 660' FWL
SECTION 36-T-21S-R24E

1650'

~~1720~~ across the intermediate casing shoe. Pull tubing up the hole and circulate clean & WOC. - TAG ← 100' plug 1385-1485

7. Load hole with plugging mud and spot 50 sacks Class C cement plug from 399' to 299' across the surface casing shoe. POOH with tubing and WOC. TAG

60' 8. Spot 15 sack Class C cement plug at surface.

9. Remove all surface equipment and weld dry hole marker per regulations.

Notify OCD in Artesia with 24 hour notice before commencing operations

(505) 748-1283