

WINSTON GAS COM #2
SEC. 31, T21S, R24E
EDDY CO., NM

- 11-29-95 Drilling at 8424' with an 8-3/4" bit. Hook on traveling block assembly parted dropping kelly and drill string. Repair same.
- 11-30-95 Pull out of hole with drill string and lay down damaged pipe. Bit missing all three cones. Attempt to fish cones with magnet - no success.
- 12-01-95 Go in hole with fish tail bit. Work bit on bottom. Pin broke on bit sub leaving fish tail bit in hole at 8423'.
- 12-02-95 Go in hole with 8-5/8" wash pipe. Wash & ream 7516-7609'. Pull out of hole with wash pipe. Go in hole with rerun 8-3/4" bit. Wash 24' to bottom. Pull out of hole.
- 12-03-95 Go in hole with 8-5/16" wash pipe. Wash 51' to bottom. Wash over fish at 8423'. Pull out of hole - no recovery.
- 12-04-95 Go in hole with 8-5/16" wash pipe. Wash 24' to bottom. Wash over fish at 8423'. Pull out of hole - no recovery.