

**LONETREE '14' STATE COM NO. 1
PLUG BACK PROCEDURE**

ATTACHMENT TO C-101 – DATED 5-25-99

If Bone Spring zone is unproductive,
RU WL. RIH w/CIBP & set @ 6150'. Dump 35' of cmt on top.
Perf Bone Spring from **5550-58'** (17 shots).
Acidize zone w/1000 gals 15% NEFE. RU swab and swab test zone.

If Bone Spring zone is unproductive,
RU WL. RIH w/CIBP & set @ 5500'. Dump 35' of cmt on top.
Perf Delaware from **4908-18'** (21 shots).
Acidize zone w/1000 gals 15% NEFE. RU swab and swab test zone.

Return well to production.