

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
2040 Pacheco St.
Santa Fe, NM 87505

WELL API NO.
30-015-22352

5. Indicate Type of Lease
STATE ☒ FEE ☐

6. State Oil & Gas Lease No.
VB0522

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. Name of Operator
PURVIS OPERATING CO.

3. Address of Operator
P.O. BOX 11006 MIDLAND, TX 79702-8006

4. Well Location
Unit Letter F : 1980 Feet From The North Line and 1980 Feet From The West Line
Section 36 Township 24S Range 27E NMPM Eddy County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)
3147 GR

7. Lease Name or Unit Agreement Name

RED BLUFF STATE

8. Well No.
1

9. Pool name or Wildcat
Willow Lake/Bone Springs

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☒ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: PLUG BACK ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

4/3-MIRU COMPLETION UNIT; UNSET 5 1/2" ARROW 1X PACKER; 4/4/01-POOH w/ Pkr., Run 5 1/2" CIBP. Tag 5 1/2" casing stub at 8736'. Could not work through. POOH w/ CIBP. 4/5/01-TIH w/ 9 5/8" CIBP, set at 8720'. Cap w/ 35' of cement. Perforate 6544-50, 6555-60, 6575-87, 6590-6608, 6614-18, 6623-32. 4/7/01-TIH w/ new 9 5/8" Arrow, set at 6944. Tsg CIBP to 1500 psi, ok. Set pkr at 6486. Acidize w/ 2000 gal 15% NEFE plus 150 balls. 4/8/01-SWAB. 4/10/01-SWAB. 4/11/01-SWAB Dry. 4/24/01-Acidize w/ 15,000 gals of gelled NEFE plus 90 balls. 4/25/01-16th swab run - FL @6200', recovered 1.1 BOF, Load water w/ 1% condensate. 4/26/01-8th swab run recovered 50' formation water. 9th-recovered 25' of form. water. SI well, released unit.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

J. H. Purvis

TITLE PRESIDENT

DATE 5/10/01

TYPE OR PRINT NAME

J. H. PURVIS

TELEPHONE NO. 915-682-7346

(This space for State Use)

APPROVED BY

For Record Only
BB

TITLE

DATE

MAY 20 2001

CONDITIONS OF APPROVAL, IF ANY: