

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)

Budget Bureau No. 1004-0135
Expires August 31, 1985

5. LEASE DESIGNATION AND SERIAL NO.

NM-26684

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT" for such proposals.)

DEC 6 11 20 AM '90

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Gorley Federal

9. WELL NO.

2

10. FIELD AND POOL, OR WILDCAT

Herradura Bend (Delaware)

11. SEC., T., R., M., OR BLM. AND
SURVEY OR AREA

Sec. 31, T-22-S, R-28-E

12. COUNTY OR PARISH

Eddy

13. STATE

New Mexico

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. NAME OF OPERATOR

Orla Petco, Inc.

3. ADDRESS OF OPERATOR

P. O. Box 1383, Midland, Texas 79702

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.
See also space 17 below.)

At surface

1650' FSL & 330' FEL of Sec. 31, T-22-S, R-28-E, Eddy County,
New Mexico

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

3060' GL

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETION

ABANDON*

CHANGE PLANS

X

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE WORK DONE OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any
proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones perti-
nent to this work.)

- NOTIFY BLM - - - -
- 1) Set CIBP @ 2,400' with 50' cement on top of plug. Tag Plug
 - 2) Spot 100' of cement at Base of Salt from 2070' - 2170'. Not necessary to tag.
 - 3) Spot 100' of cement at Top of Salt from 1360' - 1460'. Tag Plug
 - 4) Spot 100' of cement across surface casing shoe from 319' - 419'. Not necessary to tag.
 - 5) 50' of surface plug.
 - 6) Install dry hole marker.
 - 7) Restore location.

Use Class "C" with 2% CACL and 9 #/gallon fluid between plugs.

18. I hereby certify that the foregoing is true and correct

SIGNED

Joseph Roybal

TITLE Vice President

DATE 12/5/90

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE 1-14-91

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side