

PARDUE 34 COM #1
(Attachment to Form C-103)

PROCEDURE: Plug and abandon

1. MIRSU, ND tree and NU BOP.
2. Circulate hole with plug mud. TOH with tubing.
3. TIH open ended with tubing to top of fish and spot a 150' cement plug. Pull up hole and WOC.
4. Tag first plug. If plug is at or near ^{50' above} top of fish TOH with tubing. If plug fell, spot another plug, WOC and tag it. TOH.
5. Cut off 7" casing as deep as possible and TOH with casing.
6. RIH with tubing to 7" stub and spot a 100' stub plug.
7. Pull up to 2,600' and spot a 100' "shoe" plug. Pull up hole, WOC and tag this plug.
8. Pull up 600' and spot a plug (inside the 9-5/8") from 600' to 300'.
9. Set a 10 sack surface plug, cut off casing strings, weld on cap and dryhole marker.
10. Remove equipment and restore location.