MECEIVED

8/5/80 Drlg 12,363' 1m & sh. 41' prog.

AUG 81 1980

8/6/80 No Report.

O. C. D. ARTESIA, OFFICE

- 8/7/80 Drlg 12,463' sh. 37' prog.
- 8/8/80 Drlg 12,507' lm & sh. 44' prog.
- 8/9/80 Drlg 12,568' sh. 61' prog.
- 8/10/80 Drlg 12,593' sh. 25' prog.
- 8/11/80 Logging 12,600' sh. Reached TD 11 AM, 8/10/80. Loggers TD 12,622'. 1 1/4 deg @ 12,600'.
- 8/12/80 Ran liner 12,600'. Ran Density Neutron & Guard-Forxo from 12,622-9600'.
- 8/13/80 WOC @ 12,621'. Ran 83 jts 5" 23.2# N-80 SFJ-P liner and set @ 12,621'. Cmt'd w/500 sx C1 H w/3% KC1, 0.6% Halad-22H, 0.5% CFR-2 & 2% gas chek. Cmt plug down 12:30 PM, 8/12/80.
- 8/14/80 POOH. PU BHA. RIH. Stuck DP.
- 8/15/80 Work stuck DP. Ran free pt. Pipe stuck @ 7782'.
- 8/16/80 Wash acid across outside of DC's & work pipe. Ran free pt. Stuck 7782'. Back off 7596'. POOH. TIH w/jars, bumper sub, accelator & 9 4 3/4" DC's.
- 8/17/80 Wash 120' cmt of TOF. Circ out cmt cuttings. POOH. PU jars, accelator & bumper sub. TIH & screw into fish 7786'. Jar 3 hrs. Ran free pt. Pipe stuck 7915'. Back off 7786'. POOH. TIH w/12 jts 6" x 5 3/8" wash pipe & 6 3/8" x 5 3/8" wash over shoe. Unable to get over fish. POOH.
- 8/19/80 RIH w/3 1/2" DP open ended. Screw into fish & circ @ 7786'. RU Mac. Back off @ 7756'. Fish 32 DC's, 1 DP. POOH. PU 6 3/8" x 5 3/4" wash shoe, 12 jts 6" wash pipe. RIH. Wash over fish 12' past 1st DC.