

IS well
PxAd 2
IT shows that IT
is.

B6A Recommendations

I) Follow the rules and guidelines set forth in the State of New Mexico "Rules and Regulations" book; Sec.D-1, rule 202.

- 1) MI&RU & pull 300 jts 2 3/8" tbg.
- 2) Set 4 1/2" CIBP @ 10090' w/35 sxs cmt*.
- 3) Displace hole w/ "plugging" mud (i.e., 10# brine w/min. 25# gel/bbl.).
- 4) Spot 100' cmt plug @ 9160' & tag.
- 5) Spot 100' cmt plug @ 7190'.
- 6) Cut 4 1/2" csg @ 5300'.
- 7) Spot 100' cmt plug @ 5200'.
- 8) Spot 100' cmt plug (50'in/50'out at csg shoe set @ 2755' & tag.)
- 9) Spot 100' cmt plug @ 1950'.
- 10) Spot 100' cmt plug @ 1000'.
- 11) Set min of 10 sx surface plug & install dry hole marker per/NMOCD requirements.

* All cmt plugs class "C" grade or better.