

STATE 58 #1
1980' FNL, 660' FEL
Sec. 15, T-24-S, R-27-E

PAGE 2.

- 10/3/84 - Perfs 5138'-5265' (OA).
12 Hr SITP 300#, FL 1400' FS. Swab 15 BW 3 to 10% oil cut & dry. Acidized perfs w/3000 gals 7 1/2% NEFE + 121 RCNB. AIR 6 BPM @ 2800# TP to 3700# TP & broke back to 3000#. Good ball action. ISDP 500#. Flow 40 BLW swabbed 56 BW 4-10% oil cut. Swabbed dry w/4' flare after swab.
- 10/4/84 - Perfs 5138'-5265' (OA)
12 Hr. SITP 400#. FL 1800' FS. Swabbed 3 BO + 12 BAW. Fraced perfs w/40,000 gal 70 quality foam + 28,000# 20-40 sand + 16,000# 10-20 mesh sand. AIR 12 BPM @ 4200#. Flowed 3 BO + 309 BLW + 127 BFW.
- 10/5-7/84 - Perfs 5138'-5265' (OA)
Flow 12 BO + 176 BFW in 6 1/2 hrs. Reset pkr & swabbed perfs 5252'-5265'. Recovered 61 BFW w/fair show of gas. Swab 72 BFW w/trace of oil. Isolated perfs 5138'-5205' (OA). Flowed 205 BFW. 5-10% oil cut. Isolated perfs 5176'-5205' (OA) Swabbed 121 BW 2-5% oil cut.
- 10/9-10-11/84 - Perfs 5176'-5205'. FL 400' FS. Swabbed 116 BW 3 1/2 hrs 2-3% oil cut. FL stable @ 900' FS. Perfs 5138'-5161' (OA) Flowed 135 BFW 6% oil cut. Kill well w/25 BSW. POH RBP & RIH 7 5/8" CIBP.
- 10/12/84 - 10# BW, set CIBP @ 5090', tested to 1000#, ok. Capped w/10 sxs to 5040'. Howco spotted 30 sxs C1 C cement 2390 to 2283'. (Witnessed by Mr. Weaver NMOCD). POH. Remove BOPs. Install tree. Temporarily abandon & wait on casing pullers.
- 10/19/84 - Rig DA & S. Remove csg head. Ran freepoint, pipe free @ 1330'. Shot 7 5/8" csg @ 1300'. POH & LD 32 jts casing. RIH tbq, spot 60 sxs C1 C plug 1350' to 1250'.
- 10/20/84 - RIH, tag cmt plug @ 1162'. Displace hole to 10# mud laden brine. Spot 50 sxs C1 C plug 568' to 450' across 13 3/8" casing shoe. Spot 25 sxs (50') plug @ surface. Cut off csg head, weld on cover plates. Install dry hole marker.
P & A.