Form 3160-5 (June 2015) UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals. SUBMIT IN TRIPLICATE - Other instructions on page 2			OMB N	APPROVED O. 1004-0137 anuary 31, 2018		
			5. Lease Serial No. NMNM080273	5. Lease Serial No.		
			6. If Indian, Allottee	or Tribe Name		
			7. If Unit or CA/Agre	7. If Unit or CA/Agreement, Name and/or No.		
1. Type of Well ☐ Gas Well ☐ Other			8. Well Name and No HANSON FEDEF			
2. Name of Operator MUSTANG RESOURCES LLC Contact: DEB LEMON E-Mail: dlemon@mustangresurcesllc.com			9. API Well No. 30-039-20048-0	00-S1		
3a. Address 3b. F			none No. (include area code) 720-550-7507 Ext: 105		10. Field and Pool or Exploratory Area OTERO CHACRA	
4. Location of Well (Footage, S	ec., T., R., M., or Survey Descriptio	<i>n</i>)		11. County or Parish,	State	
Sec 3 T23N R7W NWSW 36.252731 N Lat, 107.568				RIO ARRIBA C	OUNTY, NM	
12. CHECK TH	E APPROPRIATE BOX(ES) TO INDICATE NATU	JRE OF N	NOTICE, REPORT, OR OT	HER DATA	
TYPE OF SUBMISSION		T	YPE OF A	CTION		
Notice of Intent	□ Acidize	Deepen	(] Production (Start/Resume)	□ Water Shut-Off	
_	□ Alter Casing	Hydraulic Frac	turing [Reclamation	Well Integrity	
Subsequent Report	Casing Repair	New Construct	ion (☐ Recomplete	Other	
Final Abandonment Notic	ce Change Plans	Plug and Aban	□ Plug and Abandon □ Temporarily Abandon		Workover Operations	
BP	Convert to Injection	Plug Back	C	Ukter Disposal		
Attach the Bond under which the following completion of the inv testing has been completed. Fir determined that the site is ready	ctionally or recomplete horizontally e work will be performed or provid olved operations. If the operation r al Abandonment Notices must be f	 give subsurface locations an e the Bond No. on file with B esults in a multiple completion iled only after all requirement 	d measured LM/BIA. R n or recomp s, including	and true vertical depths of all perti- equired subsequent reports must be letion in a new interval, a Form 316 reclamation, have been completed	nent markers and zones. filed within 30 days 50-4 must be filed once	
				OCD Received		
				4/15/2020		
14. I hereby certify that the forego	Electronic Submission	#473053 verified by the B	LM Well In	formation System		
	For MUSTANG Committed to AFMSS for p	RESOURCES LLC, sent processing by JOE KILLIN				
Name(Printed/Typed) DEB	_EMON	• •		ORY MANAGER		
Signature (Electro	onic Submission)	Date 0	7/12/2019	9		
	THIS SPACE F	OR FEDERAL OR ST	TATE OF	FICE USE		
					Deta 07/40/0040	
_Approved By_JOE KILLINS		·	TitleENGINEER Date 07/16/2019			
Conditions of approval, if any, are at certify that the applicant holds legal	or equitable title to those rights in the	ne subject lease				
which would entitle the applicant to conduct operations thereon.		Office Fa	Office Farmington			

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on page 2) ** BLM REVISED **

Well Name:	Hanson Fed #1
API Number:	30-039-20048
Location:	S3, T23N, R7W
County:	San Juan


Note: Follow all NMOCD Rules and Regulations. Mustang Resources LLC Contact: Chuck Dobie 661-301-5802 Note: for all plugs, assume 15.8ppg Density and a 1.15 cf/sx yield.

4-1/2", 10.5#	Capacity	0.0896 ft3/ft
		0.01596 bbl/ft
	ID	4.052 Inches

Step Description

- 1 Prior to work, check lease roads, test rig anchors, arrange for fresh water on location 2
 - Prior to rig, verify wellhead connections for any flanges, DSA's and BOPE necessary.
- 3 Notify NMOCD 48 hours before commencing rig operations
- 4 MIRU workover rig with 2M Class II BOPE.
- 5 Kill well, if necessary with produced water (well likely at low to no pressure)
- Fill 400 bbl tank with produced water for kill operations to be used as necessary. 6
- 7 Keep hole to RBP full of fluid at all times
- 8 TOOH w/production tubing (2 3/8", 4.7 ppf, J-55 at 5363').
- Visually inspect tubing. Move in work string if needed 9
- RIH with 4-1/2" all weight scraper and bit in tandem to PBTD at 5695' (or at least to bottom perf at 5614') 10
- 11 POOH and L/D bit and scraper.
- TIH RBP to 800' and set 11A
- P/U and RIH with tubing open ended to 700'. 12
- 13 Plug 1 Circulate well. Balance plug from 700' - 500' with 19 sacks of Class 'G' Cement
- POOH minimum 200' above cement. Reverse circ tubing clean. POOH standing back tubing. 14
- 15 Shut in Casing and pressure 4 1/2" casing to 750 psi.
- Shut down rig and WOC 16
- 17 Rig up power swivel.
- RIH with bit on tubing. Drill out cement. 18
- 19 POOH and remove bit.
- Pressure Test casing to 600 psi for 30 minutes w/chart recorder 19A
- TIH and retrieve RBP at 800' 19B
- Run tubing back in hole with pump shoe to mid perf 20
- RIH with rods and insert pump. 21
- RTP 22

Hanson Federal #1

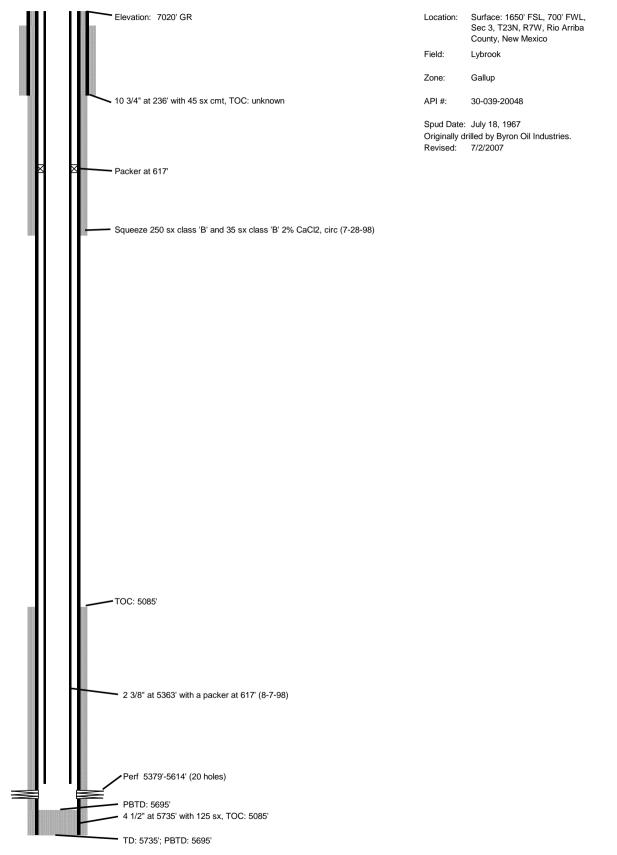

8/6/1998 Spot 130.2 gal 15% HCl, pump 1890 gal 15% HCl @ 2.6 BPM

Plug #1	Balanced Plug	
	Тор	500
	Bottom	700
	Volume	21.5 cf x 20% Sa
	Round Up	22 cf
	Total Sacks	<mark>19.1</mark> sx