Form 3160-5 (June 2015)

### UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

**OCD** Received 5/14/2020

FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018

5. Lease Serial No. NMNM58138

# SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.

6. If Indian, Allottee or Tribe Name

		-,				
SUBMIT IN TRIPLICATE - Other instructions on page 2				7. If Unit or CA/Agreement, Name and/or No. NMNM87110		
Type of Well  ☐ Gas Well  ☑ Other: COAL BED METHANE				8. Well Name and No. WEST BISTI COAL 13 COM 1		
Name of Operator Contact: SHAW-MARIE FORD DJR OPERATING LLC E-Mail: sford@djrllc.com				9. API Well No. 30-045-28388-00-S1		
3a. Address 1600 BROADWAY SUITE 1960 DENVER, CO 80202  3b. Phone No. (include area code) Ph: 505-632-3476				10. Field and Pool or Exploratory Area BASIN FRUITLAND COAL		
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)					11. County or Parish, State	
Sec 13 T25N R13W NENE 07 36.406174 N Lat, 108.163559		SAN JUAN COUNTY, NM				
12. CHECK THE AF	PPROPRIATE BOX(ES)	TO INDICATE NATURE O	F NOTICE,	REPORT, OR OTH	HER DATA	
TYPE OF SUBMISSION	TYPE OF ACTION					
57 Nation of Intent	☐ Acidize	□ Deepen	☐ Production (Start/Resume)		■ Water Shut-Off	
➤ Notice of Intent	☐ Alter Casing	☐ Hydraulic Fracturing	☐ Reclamation		■ Well Integrity	
☐ Subsequent Report	equent Report			lete	☐ Other	
☐ Final Abandonment Notice	☐ Change Plans ☑ Plug and Abandon ☐ Tempo			arily Abandon		
	☐ Convert to Injection	☐ Plug Back	☐ Water D	Pisposal		
13. Describe Proposed or Completed Op If the proposal is to deepen directions Attach the Bond under which the wor following completion of the involved testing has been completed. Final At determined that the site is ready for fi	ally or recomplete horizontally, rk will be performed or provide operations. If the operation re bandonment Notices must be fil	give subsurface locations and measu the Bond No. on file with BLM/BIA sults in a multiple completion or reco	red and true ve  Required sub  mpletion in a re	rtical depths of all pertin sequent reports must be new interval, a Form 316	ent markers and zones. filed within 30 days 0-4 must be filed once	

DJR Operating, LLC requests permission to Plug & Abandon the subject well according to the attached Procedure, Current & Proposed Wellbore Diagram & Reclamation Plan.

Notify NMOCD 24hrs Prior to beginning operations

14. I hereby certify that the foregoing is true and correct.  Electronic Submission #509954 verified by the BLM Well Information System  For DJR OPERATING LLC, sent to the Farmington  Committed to AFMSS for processing by OE KILLINS on 04/07/2020 (20JK0160SE)					
Name (Printed/Typed)	SHAW-MARIE FORD	Title	REGULATORY SPECIALIST		
Signature	(Electronic Submission)	Date	04/07/2020		
	THIS SPACE FOR FEDERA	L OR	STATE OFFICE USE		
Approved By JOE KIL	LI <u>N</u> S	Title	NGINEER	Date 05/14/2020	
Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.		Office	Farmington		

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

KP

### **Plug and Abandonment Procedure**

for

# DJR Operating, LLC West Bisti Coal 13 Com 1 API # 30-045-28388

# **NE/NE, Unit A, Sec. 13, T25N, R13W**

## San Juan County, NM

#### I.

- 1. Hold pre-job meeting, comply with all NMOCD, BLM and environmental regulations.
- 2. Check and record tubing, casing and bradenhead pressures.
- 3. Remove existing piping from casing valve, RU blow lines from casing valves and blow down casing pressure. Kill well as necessary. Ensure that well is dead or on a vacuum.
- 4. Trip out of hole with rods and pump. Lay down to be sent in for storage/salvage.
- 5. ND WH, NU BOP, function test BOP.
- 6. Trip out of hole with 2 3/8" tubing. LD tubing to be sent in for storage/salvage.

#### II.

- 7. PU workstring, TIH with bit and scraper, make sure that the bit and scraper will go below 1300'. TOOH.
- 8. PU and RIH with a 4 ½" cement retainer. Set the CR at +/- 1300'. Pressure test tubing to 1000 psi, sting out of CR, test casing to 600 psi. If casing does not test, contact engineering.

# Provided that casing test was good, proceed to step 9.

- 9. RU cement equipment. Pump water to assure that tubing is clear.
- 10. Plug 1. Mix and attempt to pump 10 sx class G cement through cement retainer and displace with 5.1 bbl water. If zone pressures up, sting back out of retainer and continue with Plug 2.

- 11. Plug 2. Fruitland, Kirtland, Ojo Alamo, and surface casing shoe. From 1300' to surface, mix and pump cement until cement circulation is achieved at surface.
- 12. RD cementing equipment. Cut off wellhead, fill annuli with cement as necessary. Install P&A marker as per regulatory requirements. Record GPS coordinates for P&A marker and the final P&A report. Photograph the P&A marker and attach to the report.
- 13. RD and MO all rig and cement equipment. Assure that location is free of trash and contamination before moving off.
- 14. Send all reports and attachments to DJR Aztec office for regulatory filings.


# **DJR Operating, LLC**

# **Current Wellbore Diagram**

### West Bisti Coal 13 Com 1

API # 30-045-28388 NE/NE, Unit A, Sec 13, T25N, R13W San Juan County, NM

GL 6458' KB N/A Spud Date 11/26/1990

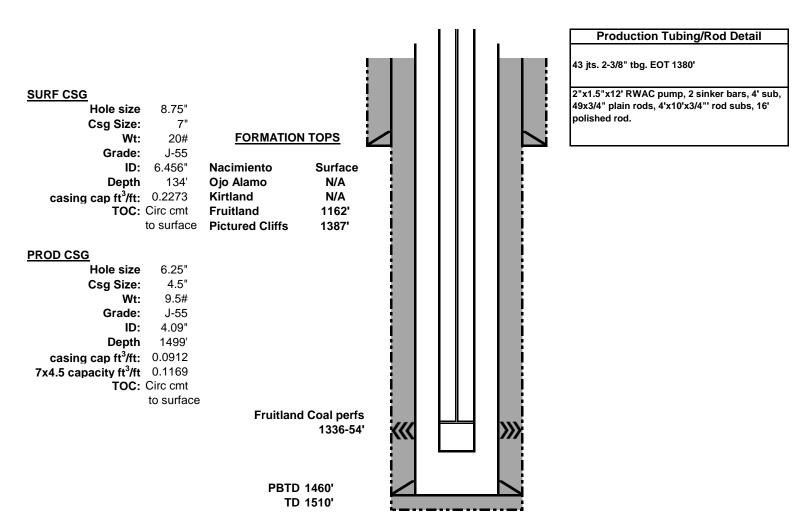


# DJR Operating, LLC Proposed Wellbore Diagram

### West Bisti Coal 13 Com 1

API # 30-045-28388 NE/NE, Unit A, Sec 13, T25N, R13W San Juan County, NM

GL 6458' KB N/A Spud Date 11/26/1990

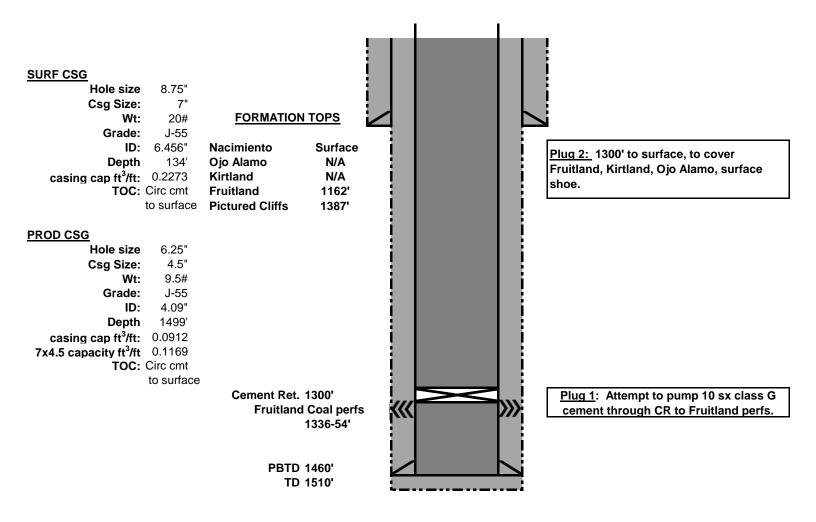

# BLM FLUID MINERALS Geologic Report

**Date Completed:** 5/13/20

Well No.	West Bisti Coal 13 Com # 1		Location	790′	FNL	&	790′	FEL
Lease No.	NMNM87110		Sec. 13	T25N			R13W	
Operator	DJR Operatin	ig LLC	County	San Ju	ıan	State	New M	exico
Total Depth	1510′	PBTD 1460'	Formation	Basin Fruitland Coal				
Elevation (GL) 6458'		Elevation (K)	Elevation (KB) 6470' (est.)					

<b>Geologic Formations</b>	Est. Top	Est. Bottom	Log Top	Log Bottom	Remarks
San Jose Fm					Surface/Fresh water sands
Nacimiento Fm			Surface	Not Determined	
Ojo Alamo Ss			Not Determined	Not Determined	Aquifer (fresh water)
Kirtland Shale			Not Determined	1162'	
Fruitland Fm			1162'	1387'	Coal/Gas/Possible water
Pictured Cliffs Ss			1387′		Gas
Lewis Shale					
Chacra					Probable water or dry
Cliff House Ss (main)					Water/Possible gas
Menefee Fm					Coal/Ss/Water/Possible O&G
Point Lookout Ss					Probable water/Possible O&G
Mancos Shale					Source rock
Gallup					O&G/Water
Dakota					O&G/Water

Remarks: P & A

Reference Well:

1) DJR Operating Fm. Tops Same

- The proposed plugging plan, if executed as presented, will adequately protect the freshwater sands in this well bore.
- Please ensure that the tops of the Pictured Cliffs and Fruitland formations as well as the entire Ojo Alamo aquifer, identified in this report, are isolated by proper placement of cement plugs. This will protect the freshwater sands in this well bore.

**Prepared by:** Walter Gage

# UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT FARMINGTON DISTRICT OFFICE

6251 COLLEGE BLVD. FARMINGTON, NEW MEXICO 87402

Attachment to notice of Re: Permanent Abandonment Intention to Abandon: EC#509954 Well: West Bisti Coal 13 Com 1

# **CONDITIONS OF APPROVAL**

- 1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal and Indian Lease."
- 2. Farmington Office is to be notified at least 24 hours before the plugging operations commence (505) 564-7750.

# GENERAL REQUIREMENTS FOR PERMANENT ABANDONMENT OF WELLS ON FEDERAL AND INDIAN LEASES FARMINGTON FIELD OFFICE

- 1.0 The approved plugging plans may contain variances from the following <u>minimum general</u> requirements.
  - 1.1 Modification of the approved plugging procedure is allowed only with the prior approval of the Authorized Officer, Farmington Field Office.
  - 1.2 Requirements may be added to address specific well conditions.
- 2.0 Materials used must be accurately measured. (densometer/scales)
- 3.0 A tank or lined pit must be used for containment of any fluids from the wellbore during plugging operations and all pits are to be fenced with woven wire. These pits will be fenced on three sides and once the rig leaves location, the fourth side will be fenced.
  - 3.1 Pits are not to be used for disposal of any hydrocarbons. If hydrocarbons are present in the pit, the fluids must be removed prior to filling in.
- 4.0 All cement plugs are to be placed through a work string. Cement may be bull-headed down the casing with prior approval. Cement caps on top of bridge plugs or cement retainers may be placed by dump bailer.
  - 4.1 The cement shall be as specified in the approved plugging plan.
  - 4.2 All cement plugs placed inside casing shall have sufficient volume to fill a minimum of 100' of the casing, or annular void(s) between casings, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.
  - 4.3 Surface plugs may be no less than 50' in length.
  - 4.4 All cement plugs placed to fill annular void(s) between casing and the formation shall be of sufficient volume to fill a minimum of 100' of the annular space plus 100% excess, calculated using the bit size, or 100' of annular capacity, determined from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.
  - 4.5 All cement plugs placed to fill an open hole shall be of sufficient volume to fill a minimum of 100' of hole, as calculated from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug. In the absence of a caliper log, an excess of 100% shall be required.
  - 4.6 A cement bond log or other accepted cement evaluation tool is required to be run if one had not been previously ran or cement did not circulate to surface during the original casing cementing job or subsequent cementing jobs.

- 5.0 All cement plugs spotted across, or above, any exposed zone(s), when; the wellbore is not full of fluid or the fluid level will not remain static, and in the case of lost circulation or partial returns during cement placement, shall be tested by tagging with the work string.
  - 5.1 The top of any cement plug verified by tagging must be at or above the depth specified in the approved plan, without regard to any excess.
  - 5.2 Testing will not be required for any cement plug that is mechanically contained by use of a bridge plug and/or cement retainer, if casing integrity has been established.
  - 5.3 Any cement plug which is the only isolating medium, for a fresh water interval or a zone containing a prospectively valuable deposit of minerals, shall be tested by tagging.
  - 5.4 If perforations are required below the surface casing shoe, a 30 minute minimum wait time will be required to determine if gas and/or water flows are present. If flow is present, the well will be shut-in for a minimum of one hour and the pressure recorded. Short or long term venting may be necessary to evacuate trapped gas. If only a water flow occurs with no associated gas, shut well in and record the pressures. Contact the Engineer as it may be necessary to change the cement weight and additives.
- 6.0 Before setting any cement plugs the hole needs to be rolled. All wells are to be controlled by means of a fluid that is to be of a weight and consistency necessary to stabilize the wellbore. This fluid shall be left in place as filler between all plugs.
  - 6.1 Drilling mud may be used as the wellbore fluid in open hole plugging operations.
  - 6.2 The wellbore fluid used in cased holes shall be of sufficient weight to balance known pore pressures in all exposed formations.
- 7.0 A blowout preventer and related equipment (BOPE) shall be installed and tested prior to working in a wellbore with any exposed zone(s); (1) that are over pressured, (2) where the pressures are unknown, or (3) known to contain  $H_2S$ .
- 8.0 Within 30 days after plugging work is completed, file a Sundry Notice, Subsequent Report of Abandonment (Form 3160-5), five copies, with the Field Manager, Bureau of Land Management, 6251 College Blvd., Suite A, Farmington, NM 87402. The report should show the manner in which the plugging work was carried out, the extent, by depth(s), of cement plugs placed, and the size and location, by depth(s), of casing left in the well. Show date well was plugged.
- 9.0 All permanently abandoned wells are to be marked with a permanent monument as specified in 43 CFR 3162.6(d). Unless otherwise approved.
- 10.0 If this well is located in a Specially Designated Area (SDA), compliance with the appropriate seasonal closure requirements will be necessary.

All of the above are minimum requirements. Failure to comply with the above conditions of approval may result in an assessment for noncompliance and/or a Shut-in Order being issued pursuant to 43 CFR 3163.1. You are further advised that any instructions, orders or decisions issued by the Bureau of Land Management are subject to administrative review pursuant to 43 CFR 3165.3 and appeal pursuant to 43 CFR 3165.4 and 43 CFR 4.700.