	Form 3160-5 (June 2015) UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals. SUBMIT IN TRIPLICATE - Other instructions on page 2					FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018 5. Lease Serial No. 1149IND7971 6. If Indian, Allottee or Tribe Name EASTERN NAVAJO 7. If Unit or CA/Agreement, Name and/or No.		
_								
-1	1. Type of Well □ Oil Well □ Gas Well ☑ Other: COAL BED METHANE					8. Well Name and No. BUENA SUERTE 29 1		
2	2. Name of Operator Contact: SHAW-MARIE FORD DJR OPERATING LLC E-Mail: sford@djrllc.com					9. API Well No. 30-045-28990-00-S1		
3	3a. Address 1 ROAD 3263 AZTEC, NM 87410			e. (include area code) 82-3476		10. Field and Pool or Exploratory Area BASIN FRUITLAND COAL		
4	4. Location of Well (Footage	)			11. County or Parish, State			
	Sec 29 T26N R11W SV 36.459686 N Lat, 108.0	NMOCD REC'D 10/14/20			SAN JUAN COUNTY, NM			
	12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA							
_	TYPE OF SUBMISSIO	N	TYPE OF ACTION					
	Notice of Intent	<ul><li>Acidize</li><li>Alter Casing</li></ul>	<ul><li>Deepen</li><li>Hydraulic Fracturing</li></ul>		<ul> <li>Production (Start/Resume)</li> <li>Reclamation</li> </ul>		<ul><li>Water Shut-Off</li><li>Well Integrity</li></ul>	
	Subsequent Report	Casing Repair	_	v Construction	□ Recomplete		□ Other	
	☐ Final Abandonment No	tice ☐ Change Plans ☐ Convert to Injection	Plug and Abandon Plug Back		<ul> <li>Temporarily Abandon</li> <li>Water Disposal</li> </ul>			
	Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.							
KP 11/9/2020	DJR Operating, LLC requests permission to Plug & Abandon the subject well per the attached Procedure, Current & Proposed Wellbore Diagram, & Reclamation Plan.							
		OCD 24hi						
		eginning						
	operations							
	14. I hereby certify that the foregoing is true and correct. Electronic Submission #518098 verified by the BLM Well Information System For DJR OPERATING LLC, sent to the Farmington Committed to AFMSS for processing by HEATHER PERRY on 06/25/2020 (20HCP0010SE)							
	Name(Printed/Typed) SHAW-MARIE FORD		Title REGULATORY S		ATORY SP	ECIALIST		
_	Signature (Ele	ctronic Submission)		Date 06/08/2020				
_	THIS SPACE FOR FEDERAL OR STATE OFFICE USE							
Co	Approved By JOHN HOFFI onditions of approval, if any, are rtify that the applicant holds leg	not warrant or			EER	Date 10/14	/2020	
wł	hich would entitle the applicant	to conduct operations thereon.		Office Farmington				
	Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.							
(In	(Instructions on page 2) ** BLM REVISED **							

#### **Plug and Abandonment Procedure**

for

DJR Operating, LLC Buena Suerte 29 1 API # 30-045-28990 SW/NE, Unit G, Sec. 29, T26N, R11W San Juan County, NM

I.

- 1. Hold pre-job meeting, comply with all NMOCD, BLM and environmental regulations.
- 2. Check and record tubing, casing and bradenhead pressures.
- 3. Remove existing piping from casing valve, RU blow lines from casing valves and blow down casing pressure. Kill well as necessary. Ensure that well is dead or on a vacuum.
- 4. Trip out of hole with rods and pump. Lay down to be sent in for storage/salvage.
- 5. ND WH, NU BOP, function test BOP.
- 6. Trip out of hole with 2 3/8" tubing. LD tubing to be sent in for storage/salvage.


### II.


- 7. PU workstring, TIH with bit and scraper, make sure that the bit and scraper will go below 1180'. TOOH.
- PU and RIH with a 4 <sup>1</sup>/<sub>2</sub>" cement retainer. Set the CR at +/- 1180'. Pressure test tubing to 1000 psi, sting out of CR, test casing to 600 psi. If casing does not test, contact engineering.

### Provided that casing test was good, proceed to step 9.

- 9. RU cement equipment. Pump water to assure that tubing is clear.
- 10. Plug 1. Mix and attempt to pump 10 sx class G cement through cement retainer and displace with 5.1 bbl water. If zone pressures up, sting back out of retainer and continue with Plug 2.

- 11. Plug 2. Fruitland, Kirtland, Ojo Alamo, and surface casing shoe. From 1180' to surface, mix and pump cement until cement circulation is achieved at surface.
- 12. RD cementing equipment. Cut off wellhead, fill annuli with cement as necessary. Install P&A marker as per regulatory requirements. Record GPS coordinates for P&A marker and the final P&A report. Photograph the P&A marker and attach to the report.
- 13. RD and MO all rig and cement equipment. Assure that location is free of trash and contamination before moving off.
- 14. Send all reports and attachments to DJR Aztec office for regulatory filings.

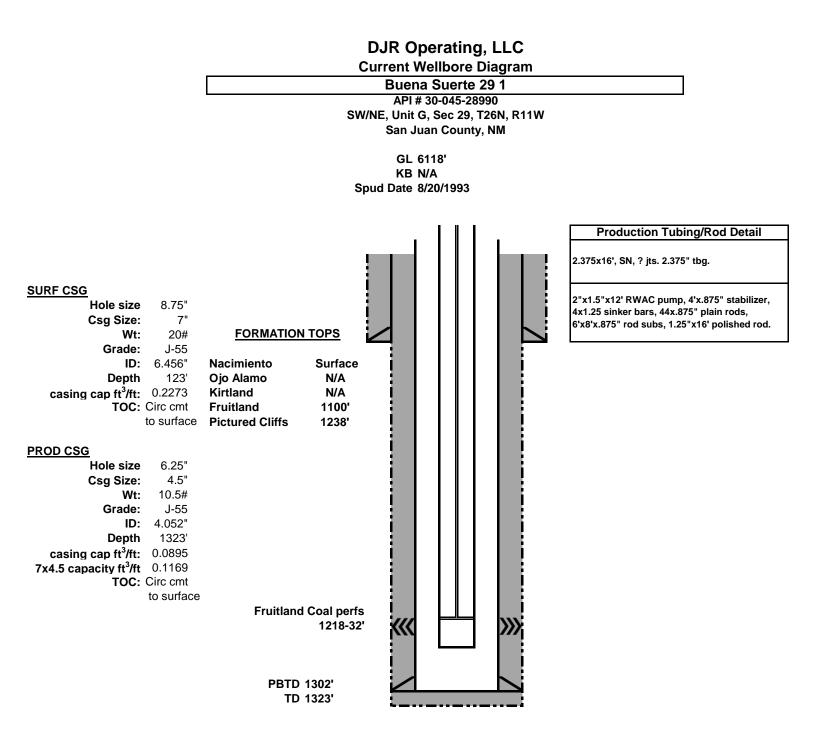

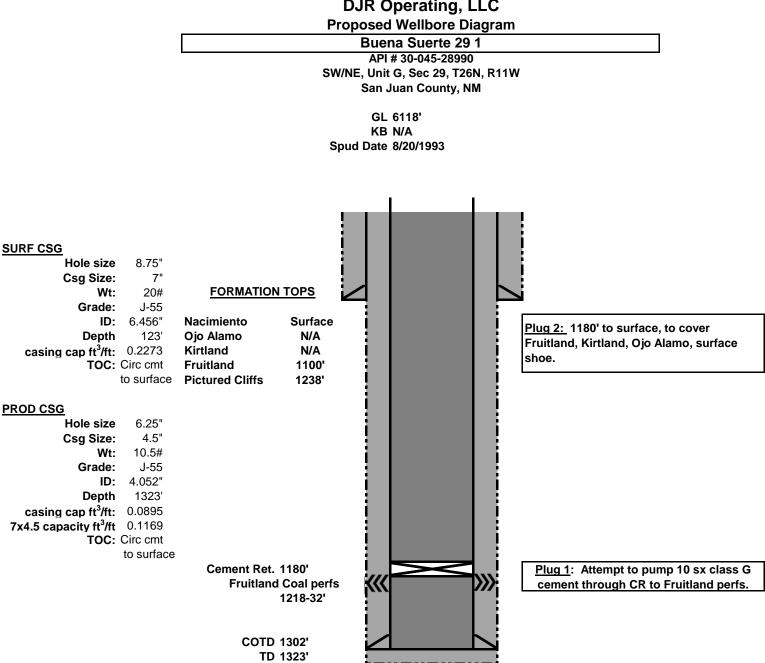

# **DJR Operating, LLC**

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT FARMINGTON DISTRICT OFFICE 6251 COLLEGE BLVD. FARMINGTON, NEW MEXICO 87402

Attachment to notice of Intention to Abandon:

Re: Permanent Abandonment Well: Buena Suerte 20 #1 API: 30-045-28890

# **CONDITIONS OF APPROVAL**

1. Plugging operations authorized are subject to the "General Requirements for Permanent Abandonment of Wells on Federal and Indian Lease."

2. Farmington Office is to be notified at least 24 hours before the plugging operations commence (505) 564-7750.

## GENERAL REQUIREMENTS FOR PERMANENT ABANDONMENT OF WELLS ON FEDERAL AND INDIAN LEASES FARMINGTON FIELD OFFICE

1.0 The approved plugging plans may contain variances from the following <u>minimum general</u> requirements.

- 1.1 Modification of the approved plugging procedure is allowed only with the prior approval of the Authorized Officer, Farmington Field Office.
- 1.2 Requirements may be added to address specific well conditions.
- 2.0 Materials used must be accurately measured. (densometer/scales)

3.0 A tank or lined pit must be used for containment of any fluids from the wellbore during plugging operations and all pits are to be fenced with woven wire. These pits will be fenced on three sides and once the rig leaves location, the fourth side will be fenced.

3.1 Pits are not to be used for disposal of any hydrocarbons. If hydrocarbons are present in the pit, the fluids must be removed prior to filling in.

4.0 All cement plugs are to be placed through a work string. Cement may be bull-headed down the casing with prior approval. Cement caps on top of bridge plugs or cement retainers may be placed by dump bailer.

- 4.1 The cement shall be as specified in the approved plugging plan.
- 4.2 All cement plugs placed inside casing shall have sufficient volume to fill a minimum of 100' of the casing, or annular void(s) between casings, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.
- 4.3 Surface plugs may be no less than 50' in length.
- 4.4 All cement plugs placed to fill annular void(s) between casing and the formation shall be of sufficient volume to fill a minimum of 100' of the annular space plus 100% excess, calculated using the bit size, or 100' of annular capacity, determined from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.
- 4.5 All cement plugs placed to fill an open hole shall be of sufficient volume to fill a minimum of 100' of hole, as calculated from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug. In the absence of a caliper log, an excess of 100% shall be required.
- 4.6 A cement bond log or other accepted cement evaluation tool is required to be run if one had not been previously ran or cement did not circulate to surface during the original casing cementing job or subsequent cementing jobs.

5.0 All cement plugs spotted across, or above, any exposed zone(s), when; the wellbore is not full of fluid or the fluid level will not remain static, and in the case of lost circulation or partial returns during cement placement, shall be tested by tagging with the work string.

- 5.1 The top of any cement plug verified by tagging must be at or above the depth specified in the approved plan, without regard to any excess.
- 5.2 Testing will not be required for any cement plug that is mechanically contained by use of a bridge plug and/or cement retainer, if casing integrity has been established.
- 5.3 Any cement plug which is the only isolating medium, for a fresh water interval or a zone containing a prospectively valuable deposit of minerals, shall be tested by tagging.
- 5.4 If perforations are required below the surface casing shoe, a 30 minute minimum wait time will be required to determine if gas and/or water flows are present. If flow is present, the
- well will be shut-in for a minimum of one hour and the pressure recorded. Short or long term venting may be necessary to evacuate trapped gas. If only a water flow occurs with no associated gas, shut well in and record the pressures. Contact the Engineer as it may be necessary to change the cement weight and additives.

6.0 Before setting any cement plugs the hole needs to be rolled. All wells are to be controlled by means of a fluid that is to be of a weight and consistency necessary to stabilize the wellbore. This fluid shall be left in place as filler between all plugs.

- 6.1 Drilling mud may be used as the wellbore fluid in open hole plugging operations.
- 6.2 The wellbore fluid used in cased holes shall be of sufficient weight to balance known pore pressures in all exposed formations.

7.0 A blowout preventer and related equipment (BOPE) shall be installed and tested prior to working in a wellbore with any exposed zone(s); (1) that are over pressured, (2) where the pressures are unknown, or (3) known to contain  $H_2S$ .

8.0 Within 30 days after plugging work is completed, file a Sundry Notice, Subsequent Report of Abandonment (Form 3160-5), five copies, with the Field Manager, Bureau of Land Management, 6251 College Blvd., Suite A, Farmington, NM 87402. The report should show the manner in which the plugging work was carried out, the extent, by depth(s), of cement plugs placed, and the size and location, by depth(s), of casing left in the well. Show <u>date</u> well was plugged.

9.0 All permanently abandoned wells are to be marked with a permanent monument as specified in 43 CFR 3162.6(d). Unless otherwise approved.

10.0 If this well is located in a Specially Designated Area (SDA), compliance with the appropriate <u>seasonal closure</u> requirements will be necessary.

All of the above are minimum requirements. Failure to comply with the above conditions of approval may result in an assessment for noncompliance and/or a Shut-in Order being issued pursuant to 43 CFR 3163.1. You are further advised that any instructions, orders or decisions issued by the Bureau of Land Management are subject to administrative review pursuant to 43 CFR 3165.3 and appeal pursuant to 43 CFR 3165.4 and 43 CFR 4.700.