RECEIVED

Form 3160-5 (August 2007)

UNITED STATES DEPARTMENT OF THE INTERIOR

FEB 27 2013

FORM APPROVED OMB No. 1004-0137

, ,	BUREAU OF LAND MAN	NAGEMENT	FEB 2	/ Zu	Expires:	: July 31, 2010	
			eminaton F	Field	Lease Serial No.		
Farmington Field SUNDRY NOTICES AND REPORTS ON WELLS Land Mar					NIV	INM-012694	
	e this form for proposals t				. If Indian, Afforce of Tribe	ivame	
	well. Use Form 3160-3 (A						
SUBMIT IN TRIPLICATE - Other instructions on page 2.				7	7. If Unit of CA/Agreement, Name and/or No.		
1. Type of Well	· · · · · · · · · · · · · · · · · · ·			San Juan 30-6 Unit			
Oil Well			8	8. Well Name and No.			
2. Name of Operator					San Juan 30-6 Unit 461S 9. API Well No.		
Burlington Resources Oil & Gas Con					30-039-27733		
3a. Address		3b. Phone No. (include area code)			10. Field and Pool or Exploratory Area		
PO Box 4289, Farmington, NM 87499		(505)	(505) 326-9700			Fruitland Coal	
4. Location of Well (Footage, Sec., T.,R,M., or Survey Description) Surface Unit E (SWNW), 1525' FNL & 870' F		WI Soc 11			1. Country or Parish, State Rio Arriba	New Mexico	
Juliace Office (5)	WL, Jec. 11,	L, 3ec. 11, 13014, 12744		Nio Airiba	, INEW MEXICO		
12. CHECK 1	THE APPROPRIATE BOX(ES)	TO INDICATE	NATURE O	F NOT	ICE, REPORT OR OTH	IER DATA	
TYPE OF SUBMISSION			TYPE OF	F ACT	ION		
X Notice of Intent	Acidize	Deepen		Pro	oduction (Start/Resume)	Water Shut-Off	
	Alter Casing	Fracture Trea	t [=	clamation	Well Integrity	
Subsequent Report	Casing Repair	New Constru	ction	Red	complete	Other	
$_{-}$	Change Plans	X Plug and Aba	ındon	Ter	nporarily Abandon		
Final Abandonment Notice	Convert to Injection	Plug Back	[Wa Wa	ter Disposal		
determined that the site is ready for Burlington Resources r wellbore schematics.	equests permission to P8	A the subjec	t well per t	the att	ached procedure, c	urrent and proposed	
					R	CVD APR 30 '13	
			Notify NMOCD 24 hrs prior to beginning		4	DIL CONS. DIV.	
					J 24 hrg	DIST. 3	
	•		оре	eratio	ns	231.0	
						·· ·	
14. I hereby certify that the foregoing is	true and correct. Name (Printed/Type	ed)					
Dollie L. Busse	Title	Title Staff Regulatory Technician					
Signature Allis	Date	2,	/a-	7/13			
	THIS SPACE FO	R FEDERAL	OR STATE	OFF	CE USE		
Approved by							
Original Signe		7007.43			Date APR 2 4 2013		
Conditions of approval, if any, are attach	warrant or certify	Title			Date Mi ii Z & LUIJ		
that the applicant holds legal or equitable entitle the applicant to conduct operation	e title to those rights in the subject leas		Offic	ce			

false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any

ConocoPhillips SAN JUAN 30-6 UNIT 461S Expense - P&A

Lat 36° 49' 48.324" N

Long 107° 32' 44.304" W

PROCEDURE

This project requires a NMOCD C-144 CLEZ Closed-Loop System Permit for the use of an A-Plus steel tank to handle waste fluids circulated from the well and cement wash up.

- 1. Hold pre-job safety meeting. Comply with all NMOCD, BLM, and COPC safety and environmental regulations. Test rig anchors prior to moving in rig.
- 2. MIRU work over rig. Check casing, tubing, and bradenhead pressures and record them in Wellview.
- 3. When an existing primary valve (i.e. casing valve) is to be used, the existing piping should be removed and replaced with the appropriate piping for the intended operation.
- 4. RU blow lines from casing valves and begin blowing down casing pressure. Unseat pump and kill well with water, as necessary, and at least pump tubing capacity of water down tubing.
- 5. TOOH w/ 3/4" rods and LD.
- 6. ND wellhead and NU BOPE. Pressure and function test BOP. PU and remove tubing hanger.
- 7. TOOH with 2-3/8" tubing (per pertinent data sheet) and LD any bad joints.

 Rods:
 Yes
 Size:
 3/4"
 Length:
 3,160'

 Tubing:
 Yes
 Size:
 2-3/8"
 Length:
 3,167'

Round trip watermelon mill to 2,793' or as deep as possible.

All cement volumes use 100% excess outside pipe and 50' excess inside pipe. The stabilizing wellbore fluid will be 8.3 ppg, sufficient to balance all exposed formation pressures. All cement will be ASTM Type II mixed at 15.6 ppg with a 1.18 cf/sk yield.

8. Plug 1 (Pictured Cliffs Formation Top, 3,121' - 3,170', 12 Sacks Class B Cement)

TIH with tubing. Mix 12 sx Class B cement and spot a balanced plug inside the liner to isolate the Pictured Cliffs formation top. POOH.

- 9. PU and set CR for 7" OD, 6.456" ID casing at 2,793' on tubing. Load hole with water and circulate clean. Pressure test casing to 560 psi and tubing to 800 psi. If casing does not test, the spot or tag subsequent plugs as appropriate. TOOH with tubing.
- 10. RU wireline and run CBL from 2,793' to surface and contact Rig Supervisor and Production Engineer with results.
- 11. Plug 2 (Fruitland Coal Top, Open Hole, Intermediate Shoe, and Liner Top, 2567-2793', 54 Sacks Class B Cement) TIH with tubing, mix 54 sx Class B cement and spot inside the casing above CR to isolate the Fruitland Coal Formation top, open hole, Intermediate shoe and liner top. PUH.

2333 2050

12. Plug 3 (Kirtland and Ojo Alamo Formation Tops, 2036-2243', 50 Sacks Class B Cement)

Mix 50 sx Class B cement and spot a balanced plug inside the casing to isolate the Kirtland and Ojo Alamo formation tops. PUH.


13. Plug 4 (Nacimiento Formation Top, 802-902', 29 Sacks Class B Cement)


Mix 29 sx Class B cement and spot a balanced plug inside the casing to isolate the Nacimiento formation top. PUH.

14. Plug 5 (Surface Shoe, 0-195', 48 Sacks Class B Cement)

Connect the pump line to the bradenhead valve and attempt to pressure test the BH annulus to 300 PSI; note the volume to load. If the BH annulus holds pressure, then establish circulation out casing valve with water. Mix 48 sxs Class B cement and spot a balanced plug inside the casing from 195' to surface, circulate good cement out casing valve. TOH and LD tubing. Shut in well and WOC. If the BH annulus does not test, then perforate at the appropriate depth and attempt to circulate cement to surface, filling the 7" casing and the BH annulus to surface. Shut in well and WOC.

15. Nipple down BOP and cut off casing below the casing flange. Install P&A marker with cement to comply with regulations. Rig down, move off location, cut off anchors, and restore location.

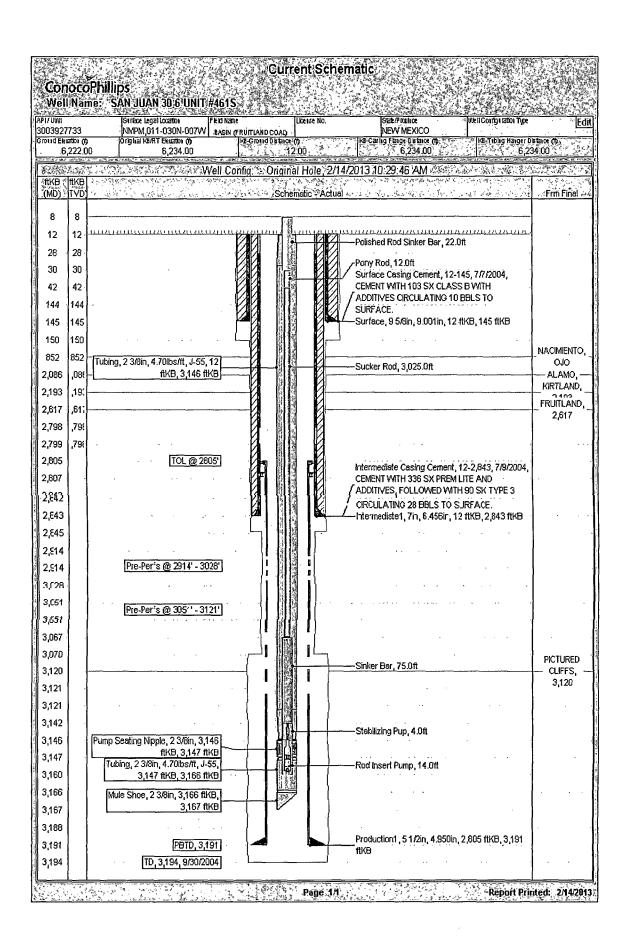

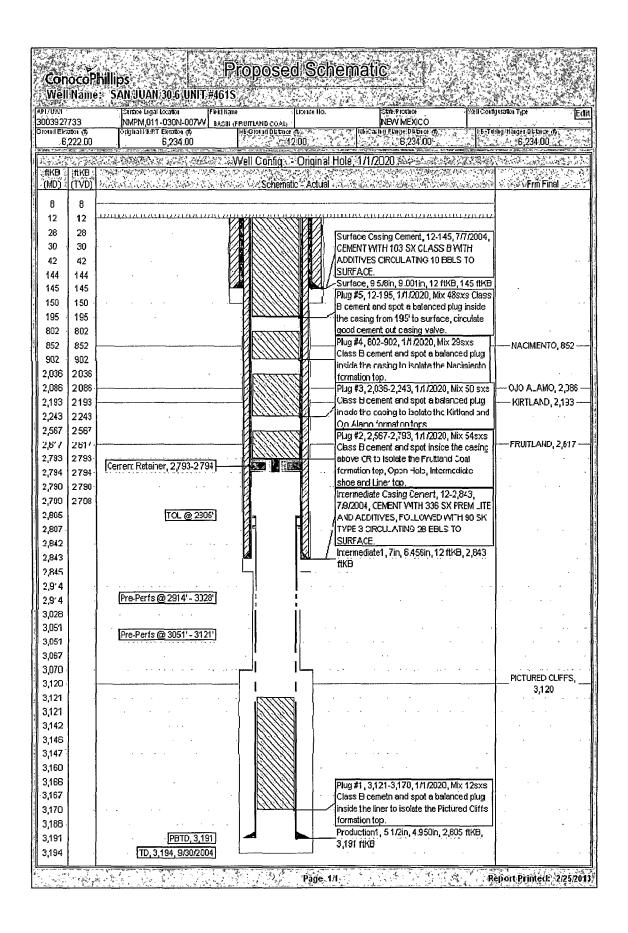

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT FARMINGTON DISTRICT OFFICE

6251 COLLEGE BLVD. FARMINGTON, NEW MEXICO 87402

Attachment to notice of Intention to Abandon:

Re: Permanent Abandonment Well: 461S San Juan 30-6 Unit

CONDITIONS OF APPROVAL

- 1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal and Indian Lease."
- 2. Farmington Office is to be notified at least 24 hours before the plugging operations commence (505) 564-7750.
- 3. The following modifications to your plugging program are to be made:
- a) Place the Kirtland/Ojo Alamo plug from 2333' 2050'.

You are also required to place cement excesses per 4.2 and 4.4 of the attached General Requirements.

Office Hours: 7:45 a.m. to 4:30 p.m.