Form 3160-5 (April 2004)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT MAY 28 2013 FORM APPROVED OM B No. 1004-0137 Expires; March 31, 2007

5. Lease Serial No

NOG-1003-1772 NM=082991

SUNDRY NOTICES AND REPORTS ON WELLS.

Do not use this form for proposals to drill Form the proposals to drill form the proposals to drill form the proposals. If Indian, Allottee or Tribe Name abandoned well. Use Form 3160-3 (APD) West of pand anageme Navajo 7. If Unit or CA/Agreement, Name and/or No. SUBMIT IN TRIPLICATE- Other instructions on reverse side. Öil Well🗆 🗆 Gas-Well D Other 8. Well Name and No. 2. Name of Operator Dominion Production Co. LLC Hanson #38 API Well No. 30-031-20725 3a Address 3b. Phone No. (include area code) 813-579-1188 1414 W. Swann, Suite 100, Tampa, Florida, 33606 10. Field and Pool, or Exploratory Area Hospah 4. Location of Well (Footage, Sec., T., R., M., or Survey Description) 11. County or Parish, State 340' FSL & 1655' FEL Section 06 17N 8W McKinley County, NM 12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE REPORT, OR OTHER DATA TYPE OF SUBMISSION TYPE OF ACTION Acidize Deepen Production (Start/Resume) Water Shut-Off Notice of Intent Alter Casing Reclamation Fracture Treat Well Integrity Casing Repair New Construction Other Recomplete Subsequent Report Change Plans Plug and Abandon Temporarily Abandon Final Abandonment Notice Convert to Injection Plug Back Water Disposal 13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones.

Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)

Please see the attached plugging procedure.

RCVD JUN 4'13 OIL CONS. DIV. DIST. 3

Notify NMOCD 24 hrs prior to beginning operations

| 14. Thereby certify that the foregoing is true and correct Name (Printed/Typed) | | | | | | |
|---|--------|------------------------------------|--|--|--|--|
| Mike Allen | Title | Engineering | 1 | | | |
| Signature Ele monic | Date | 05/24/2013 | | | | |
| THIS SPACE FOR FEDERAL OR STATE OFFICE USE | | | | | | |
| Approved by Original Signed: Stephen Mason | | Title | Date MAY 2 9 2013 | | | |
| Conditions of approval, if any, are attached. Approval of this notice does not warra certify that the applicant holds legal or equitable title to those rights in the subject le which would entitle the applicant to conduct operations thereon. | 1 | Office | | | | |
| Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any | person | knowingly and willfully to make to | any department or agency of the United | | | |

States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

Plug and Abandonment Plan

Dominion Production Co. LLC
Hanson #38
340' FSL & 1655' FEL
Sec. 6 T17N R8W
McKinley County, New Mexico

- 1. Comply to all BLM, Dominion Production and contractor safety rules and regulations. Hold safety meetings each morning.
- 2. MIRU, check tubing, casing annulus and Braden head for pressure. Bleed pressure off of well if necessary.
- 3. Unseat pump, POOH and LD rods. Break rods down to singles for hauling purposes. POOH with tubing and tally.
- 4. Plug # 1-(Cement Plug-Top of Bridge Plug @ 2340')
 RIH with 2 7/8" work string, tag BP @ 2340'. Mix and Pump 7 Sks of Class B
 Cement @ 15 ppg for 50' cap.
- 5. Plug #2 (Lower Gallup Sand-1590'-1594')
 Pull work string up hole to 1700'. Mix and Pump 28 Sks of 15 ppg cement to top At 1490' to cover Gallup sand.

 1600' -/324'
- 6. MIRU Perforating truck, shoot 2 squeeze holes at 650'.
- 7. Plug #3 (Surface Plug-Inside/Outside 650'-Surface)
 RIH with 2 7/8" Work String to 600. Shut-in Annulus and pressure up on squeeze holes and establish circulation. Mix and pump 112 Sks @ 15 ppg to surface. Mix and Pump 87 Sks from 650' to Surface.
- 8. Cut off well 3' below ground and install P&A marker per BLM specifications. RD, cleanup MOL.
- 9. Restore location to BLM specifications.

Form 3160-5 (April 2004)

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT MAY 28 2013

FORM APPROVED OM B No. 1004-0137 Expires: March 31, 2007

5. Lease Serial No.

NOG-1003-1772 NM=082991

SUNDRY NOTICES AND REPORTS ON WELLS

| Do not use th abandoned we | nis form for proposals to di ell. Use Form 3160-3 (APD | ignearcut gr | on Field Office and Manageme | 6. If Indian 11. Navajo | , Allottee or Tribe Name |
|---|--|--|---|-------------------------------|--------------------------------------|
| SUBMIT IN TR | IPLICATE- Other instruct | ions on revei | se side. | 7. If Unit or | CA/Agreement, Name and/or No. |
| Type of Well Oil Well□ □ Gas Well□□ Other | | | 8. Well Na | ne and No. | |
| 2. Name of Operator Dominion Pr | oduction Co. LLC | | | Hanson 9. API We | |
| 3a Address 3b. Phone No. (include area code) 1414 W. Swann, Suite 100, Tampa. Florida. 33606 813-579-1188 | | : area code) | 30-031-20725 10. Field and Pool, or Exploratory Area | | |
| 4. Location of Well (Footage, Sec., T., R., M., or Survey Description) | | | Hospah | | |
| 340' FSL & 1655' FEL Section 06 J7N 8W | | | 11. County or Parish, State McKinley County, NM | | |
| 12. CHECK AI | PPROPRIATE BOX(ES) TO INC | DICATE NATUR | LE OF NOTICE, R | EPORT, OR | OTHER DATA |
| TYPE OF SUBMISSION | | TY | PE OF ACTION | | |
| Notice of Intent | Alter Casing | Deepen Fracture Treat New Construction | Production (Sta | rt/Resume) | Water Shut-Off Well Integrity Other |
| Subsequent Report | | Plug and Abandon | Temporarily Ab | andon | |
| Final Abandonment Notice | Convert to Injection | Plug Back | Water Disposal | | |
| following completion of the inv | | s in a multiple comp | letion or recompletion i | n a new interva | l, a Form 3160-4 shall be filed once |
| 14. I hereby certify that the fore | going is true and correct | | | | |
| Name <i>(Printéd/Typed)</i> Mike Allen | | Title E | ngineering | | |
| Signature Electionic | | Date | 0 | 5/24/2013 | |
| | THIS SPACE FOR FED | ERAL OR S | TATE OFFICE | USE | |
| Approved by | | | itle | ı | Date |
| 11 / | attached. Approval of this notice does it or equitable title to those rights in the occurrence operations thereon. | . 1.2 | ffice | | |

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

Plug and Abandonment Plan

Dominion Production Co. LLC
Hanson #38
340' FSL & 1655' FEL
Sec. 6 T17N R8W
McKinley County, New Mexico

- 1. Comply to all BLM, Dominion Production and contractor safety rules and regulations. Hold safety meetings each morning.
- 2. MIRU, check tubing, casing annulus and Braden head for pressure. Bleed pressure off of well if necessary.
- 3. Unseat pump, POOH and LD rods. Break rods down to singles for hauling purposes. POOH with tubing and tally.
- 4. Plug # 1-(Cement Plug-Top of Bridge Plug @ 2340')
 RIH with 2 7/8" work string, tag BP @ 2340'. Mix and Pump 7 Sks of Class B
 Cement @ 15 ppg for 50' cap.
- 5. Plug #2 (Lower Gallup Sand-1590'-1594')
 Pull work string up hole to 1700'. Mix and Pump 28 Sks of 15 ppg cement to top At 1490' to cover Gallup sand.
- 6. MIRU Perforating truck, shoot 2 squeeze holes at 650'.
- 7. Plug #3 (Surface Plug-Inside/Outside 650'-Surface)
 RIH with 2 7/8" Work String to 600. Shut-in Annulus and pressure up on squeeze holes and establish circulation. Mix and pump 112 Sks @ 15 ppg to surface. Mix and Pump 87 Sks from 650' to Surface.
- 8. Cut off well 3' below ground and install P&A marker per BLM specifications. RD, cleanup MOL.
- 9. Restore location to BLM specifications.

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT FARMINGTON DISTRICT OFFICE

6251 COLLEGE BLVD. FARMINGTON, NEW MEXICO 87402

| Attachment | to | notice | of |
|--------------|----|--------|----|
| Intention to | Δh | andon | • |

Re: Permanent Abandonment

Well: 38 Hanson

CONDITIONS OF APPROVAL

- 1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal and Indian Lease."
- 2. Farmington Office is to be notified at least 24 hours before the plugging operations commence (505) 564-7750.
- 3. The following modifications to your plugging program are to be made:
- a) Place the Gallup plug from 1600' 1324'.

You are also required to place cement excesses per 4.2 and 4.4 of the attached General Requirements.

Office Hours: 7:45 a.m. to 4:30 p.m.