Submit SyCopies To Appropriate District	State of New Mexico		Form C-103	
Office District I	Energy, Minerals and Natural Resources		June 19, 2008	
1625 N. French Dr., Hobbs, NM 87240 District II	OH, CONCERNATION DIVISION		WELL API NO. 30-045-25750	
1301 W. Grand Ave., Artesia, NM 88210	OIL CONSERVATION DIVISION 1220 South St. Francis Dr.		5. Indicate Type of Lease	
District III 1000 Rio Brazos Rd., Aztec, NM 87410			STATE	FEE 🗴
District JV 1220 S. St. Francis Dr., Santa Fe, NM	5anta 1 0, 14141 0	7303	6. State Oil & Gas	
87505				Bedse 110.
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)			7. Lease Name or Unit Agreement Name: FOOTHILLS B	
1. Type of Well: Oil Well Gas Well X Other			8. Well Number #1	
2. Name of Operator			9. OGRID Number	
XTO ENERGY INC.			538	0
3. Address of Operator			10. Pool name or Wildcat	
382 CR 3100 AZTEC, NM 87410 4. Well Location			WC FOOTHILLS FRUITLAND SAND	
4. Well Education				
Unit Letter;	feet from the SOU	Ine and	1650 feet from	the EAST line
Section 20	Township 30N	Range 12W	NMPM NMPM	County SAN JUAN
	11. Elevation (Show whether			County Draw Gurav
5620' GR				
12 Check A	ppropriate Box to Indicate	Nature of Notice	Report or Other F)ata
12. 6	ppropriate Bon to maioate	. (4,0,10 01 1 (0,100,1	report, or other E	, ata
NOTICE OF INTENTION TO: SUBS			SEQUENT REP	ORT OF:
PERFORM REMEDIAL WORK	PLUG AND ABANDON 🔲	REMEDIAL WORK		ALTERING CASING
TEMPORARILY ABANDON	CHANGE PLANS	COMMENCE DRILL	ING OPNS. 🎞	P AND A
PULL OR ALTER CASING	MULTIPLE COMPL	CASING/CEMENT J		
	WOLTH LL COMIT L	O/ CONTO/OLIVIENT O		
DOWNHOLE COMMINGLE				
OTHER:	<u></u>	OTHER:		
 Describe proposed or complete of starting any proposed work). or recompletion. 	d operations. (Clearly state all pe SEE RULE 1103. For Multiple	_	•	•
XTO Energy Inc.has plugge	d and abandoned this well;	per the attached s	summary report. A	Closed Loop System
was used - Basin Disposal		-		
			OIL CONS. D	IV DIST. 3
	Approved for plugging	of wellbore only.		2011
	Liability under bond is Receipt of C-103 (Subse	guent Report of Well	JUN 16	5 2014
_	Plugging) which may be	e found @ OCD web		
PMRMI	page under forms www.emnrd.state.us/oc	d		
	www.cmm u.starcrass s		· · · · · · · · · · · · · · · · · · ·	7
Spud Date:	Rig Relea	ase Date:		
I hereby certify that the information	above is true and complete to the	best of my knowledg	e and belief.	
20,000	a mougutit			
SIGNATURE	TIT			DATE 6/13/14
Type or print name SHERRY J. MOR	ROW E-m	sherry_morrowext nail address:		PHONE <u>505-333-3630</u>
For State Use Only	2.1			
APPROVED BY	ellTI	TLE Deputy O	il & Gas Inspel	AGE, 6/30/14
Conditions of Approval (if any):		7 — 30pan, 9	District #3	, ., ;,

A-PLUS WELL SERVICE, INC.

P.O. BOX 1979

Farmington, New Mexico 87499 505-325-2627 *fax: 505-325-1211

XTO Energy Inc. Foothills B #1

June 4, 2014

Page 1 of 1

1390' FSL and 1650' FEL, Section 20, T-30-N, R-12-W San Juan County, NM Lease Number: FEE API #30-045-25750

Plug and Abandonment Report Notified NMOCD and BLM on 6/3/14

Plug and Abandonment Summary:

- Plug #1 with 16 sxs (18.88 cf) Class B cement inside casing from 1323' to 743' to cover the Fruitland top.
- Plug #2 with 20 sxs (23.6 cf) Class B cement inside casing from 406' to surface to cover the Kirtland, Ojo Alamo tops, 7" casing shoe and surface, 1) pump 14 sxs to circulate good cement out casing valve, 2) TOH and LD all tubing and plugging sub, RU pump to 2-7/8" casing valve, 3) pump 6 sxs to refill 2-7/8" casing.
- Plug #3 with 21 sxs Class B cement to top off casings and install P&A marker.

Plugging Work Details:

- 6/3/14 Rode rig and equipment to location. Spot in basebeam. Spot in equipment and RU. SDFD.
- Check well pressures: SICP 80 PSI and SIBHP 0 PSI. Blow well down. Pump 15 bbls of water down casing to kill well. RIH with 2-7/8" GR to 1350'. TIH with 2-7/8" PW CIBP at 1323'. MU 2-7/8" x 7-1/16" 3K companion flange. NU BOP and function test. TIH with XTO 1-1/4" IJ workstring tag CIBP at 1323'. Bradenhead pressured up to 300 PSI, OK. Circulate well clean. Pressure test casing to 550 PSI, OK. Spot plugs #1 and #2. Dig out wellhead. RU High Desert. Cut off wellhead. Spot plug #3 top off casings and install P&A marker. RD and MOL.

Paul Wiebe, NMOCD representative, was on location.