<b>6</b> •							
۲		R. F.		IVED			
• •							
Form 3160-5 (August 2007)	UNITED STAT	TES e nitediod	liny 2	17 2031.	APPROVED o. 1004-0137		
(1145451 2007)	BUREAU OF LAND MA			1	July 31, 2010		
		Farm		5. Wease Serial No.			
SI	JNDRY NOTICES AND REP		of Land	6. If Indian, Allottee or Tribe I	F-080844		
	se this form for proposals		. an	o. If Indian, Anotee of Thee			
	ed well. Use Form 3160 <u>-</u> 3 (			<u> </u>	<u>.                                    </u>		
	SUBMIT IN TRIPLICATE - Other in	structions on page 2.		7. If Unit of CA/Agreement, N	lame and/or No.		
1. Type of Well		·					
Oil Well	X Gas Well Other			8. Well Name and No.	des B #100		
2. Name of Operator				9. API Well No.	· · · · · · · · · · · · · · · · · · ·		
	ngton Resources Oil & Gas	3b. Phone No. (include area	(code)		045-29217		
	3a. Address PO Box 4289, Farmington, NM 87499		<b>00</b>	10. Field and Pool or Exploratory Area Fruitland Coal			
4. Location of Well (Footage, Sec.,				11. Country or Parish, State	· · · · · · · · · · · · · · · · · · ·		
Surface Unit G (SW	'NE), 1770' FNL & 1850' FE	L, Sec. 20, T28N, R11	W	San Juan	, New Mexico		
	CTHE APPROPRIATE BOX(ES						
TYPE OF SUBMISSION							
X Notice of Intent	Acidize	Deepen		roduction (Start/Resume)	Water Shut-Off		
Subsequent Report	Alter Casing Casing Repair	Fracture Treat		Reclamation	Well Integrity		
L_Joursequent Report	Change Plans	X Plug and Abandon		Cemporarily Abandon			
. Final Abandonment Notice	Convert to Injection	Plug Back	- Ē v	Water Disposal			
• •	Operation: Clearly state all pertinent d ectionally or recomplete horizontally, gi		-				
following completion of the inv	e work will be performed or provide th volved operations. If the operation resu inal Abandonment Notices must be file y for final inspection.)	lts in a multiple completion or	recompletio	on in a new interval, a Form 310	50-4 must be filed once		
The Pre-disturbance	ests permission to P&A this w site visit was conducted on a l loop system will be utilized	10/6/14 with Bob Swit					
· · ·							
		/ RECEIN	/FD	$\sum_{i=1}^{n} (i + i) = (i + i)$	-		
	OR ACCEPTANCE OF THIS			SEF ATTA	CHED FOR		
	T RELIEVE THE LESSEE ANI I OBTAINING ANY OTHER	JAN 232	2015	1	OF APPROVAL		
	REQUIRED FOR OPERATION	VE JAN DO 2	QUIJ		AI WILLAWE		
ON FEDERAL ANI	) INDIAN LANDS	\ NMOC	`F`\		n na		
					• • • • • • • • • •		
	ng is true and correct. Name (Printed/I		1-11/				
F	atsy Clugston			Staff Regulatory Te	chnician		
····	)						
Signature Fail	sy Clust	Date		11/24/201	4		
	// THIS SPACE F	OR FEDERAL OR ST	ATE OF	FICE USE	``		
Approved by					1 1		
Ten Shu	925		Title P	F	Date 121 2015		
	ettached. Approval of this notice does n		Inte I		Luiv I MI AUS		
	itable title to those rights in the subject	lease which would	Office	FA			
entitle the applicant to conduct oper Title 18 U.S.C. Section 1001 and T	itle 43 U.S.C. Section 1212, make it a c	rime for any person knowingly	and willful	ly to make to any department of	r agency of the United States any		
	ents or representations as to any matter,						
(Instruction on page 2)		AHEAAA					

NMOCDKC

5 A

## ConocoPhillips RHODES B 100 Expense - P&A

## Lat 36° 39' 0.144" N

PROCEDURE

## Long 108° 1' 25.896" W

#### This project requires the use of an A-Plus steel tank to handle waste fluids circulated from the well and cement wash up.

1. Hold pre-job safety meeting. Comply with all NMOCD, BLM, and COPC safety and environmental regulations. Test rig anchors prior to moving in rig. Before RU, run WL remove downhole equipment. If an obstruction is found, set a locking-3-slip-stop in the tubing.

2. MIRU workover rig. Check casing, tubing, and bradenhead pressures and record them in Wellview. If there is pressure on the BH, contact the Wells Engineer.

3. Remove existing piping on casing valve. RU blow lines from casing valves and begin blowing down casing pressure. Kill well as necessary. Ensure well is dead or on a vacuum.

4. ND wellhead and NU BOPE. Utilize annular preventer. Pressure and function test BOP to 250 psi low and 1000 psi over SICP high to a maximum of 2000 psi held and charted for 10 minutes as per COP Well Control Manual. PU and remove tubing hanger

5. TOOH inner string and	d LD (per j	pertinent data sheet).							
Tubing Size	1-1/4"	2.33# J-55 IJ	Set Depth	1703	ftKB	KB:	12	ft	
6. TOOH with tubing (pe	r pertinent	data sheet).							
Tubing size:	2-7/8"	6.4# J-55 EUE/UFJ	Set Depth:	1717	ftKB	KB:	12	ft	 ·
			-						فونينا کار اندر ۲۰۰۰ د ۲۰
***NOTE: Ensure et p	ump defu	ser and pump body are re	turned to Aritificia	al Lift grou	JD.***				<b></b>

7. PU 3-7/8" bit and watermelon mill and round trip as deep as possible above top perforation at 1332'.

8. PU 4-1/2" cement retainer on tubing, and set at 1282'. Pressure test tubing to 1000 psi. Sting out of CR. Load hole, and pressure test casing to 800 psi. *If casing does not test, then spot or tag subsequent plugs as appropriate.* POOH w/ tubing.

All cement volumes use 100 excess outside pipe and 50' excess inside pipe. The stabilizing wellbore fluid will be 8.3 ppg, -----sufficient to balance all exposed formation pressures. All cement will be ASTM Class B mixed at 15.6 ppg with a 1.18 cf/sk yield.

10. Plug 1 (Fruitland Perfroations and Formation Top, 1142-1282', 15 Sacks Class B Cement)

Mix cement as described above and spot inside plug to isolate the Fruitland perforations and Formation Top. Pull up hole.


See COA

11. Plug 2 (Kirtland and O b Alamo Formation Top, 401-616', 21 Sacks Class B Cement) Mix cement as described above and spot balanced plug to isolate the Kirtland and Ojo Alamo Formation Tops. Pull up hole.

# 12. Plug 3 (Surface Plug, 0-270', 25 Sacks Class B Cement)

Connect the pump line to the bradenhead valve and attempt to pressure test the BH annulus to 300 psi. Note the volume to load. Mix 25 sacks Class B cement and spot balanced plug inside casing from 270' to surface. TOOH and LD tubing. SI well and WOC. If the BH annulus does not test, then perforate at the appropriate depth and attempt to circulate cement to surface, filling the casing and the BH annulus to surface. Shut well in and WOC.

13. Nipple down BOP and cut off casing below the casing flange. Install P&A marker with cement to comply with regulations. Rig down, move off location, cut off anchors, and restore location.

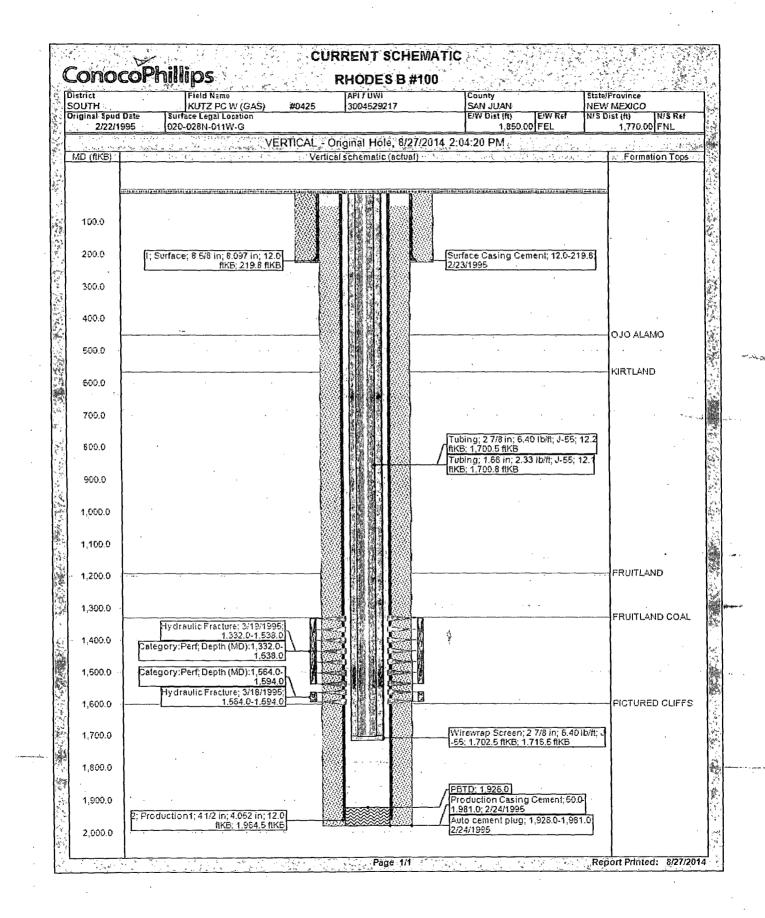

teranajan terata

- - -

	· .		· · · ·	
1.2. S. A.	:oPhillips	RHODE	Schematic S B #100	
District SOUTH Original Spud Date	Field Name KUTZ PC W (GAS) Surface Legal Location	API/UWI #0425 3004529217 East/West Distance (ft)	County SAN JUAN East/West Reference North/	State/Province NEW MEXICO South Distance (ft) North/South Reference
2/22/199	5 020-028N-011W-G	1,850.00	FEL	1,770.00 FNL
		VERTICAL - Original Ho	le, 1/1/2020 1:15:00 AM	
MD (fiKB)		Vertical schematic (actual)		Formation Tops
	a the and the second	<u>, , , , , , , , , , , , , , , , , , , </u>		-
12.5 adatustatististatisti	an a		ydary dar turknameri deki fisionai fizionen nich i seiner engen i innegionen sienen i en en sienen sie	site standing and
49.9			-Casena Jenis: 120.2196	
219.9			Eurlace Casing Cement, 12 0-219.8; CEMERN SXS CLASS 'G' CNIT W/ 3% CACL; 0 25 PPS FLOCELE (245 CUFT) CIRCULATED 13 BBL	1 W# 210 .S CIAT
			TO SURFACE	
225.3				
270.9	•		Flug #3, 12 0-270 0, flux 25 sx Class B cemen spot balanced plug inside casing from 270' to : 1/1/2020	t and surface,
460 9				
451,1				OJO ALAMO
			ter anna e t	
565.9	nin sensen sensen sensen sessen men sensen har sensen sensen sensen har an an sensen har an an sensen har sense		Flug #2, 401 0-616 0, Mix 21 sx Class D ceme	KIRTLAND
616.1			Spot balanced plug to isolate the Kritland and 0 Kama formation rows ; 1/1/2020 Casana Joints, 12:0-1,963 0 Pelice #1; 1,142,0-1,282 0, Mix 15 sx Class B of	
1,1421	·. ·. ·		and spot inside plug to iscline the Fruntand pe	torations
5,191.9			Hydraulic Flacture: 1,322.0-1,533.0, FRAC W 2040 BAADY SAND, 198 EBLS 204 GEL & 2 SCF 112 Net stim 206; Remarks: FRACED W PER DESIGH GODD JOB, FIELD CCST FOI	GLLAS 1
			STAGES S5002 56 ALL FRAC FLUID 204 LINEAR 1/2 FOAM 205 LINEAR 70 OMALITY 1/2 FOAM FAD	
1282 2 Cem	ent Retainer; 1,282.0-1,285.0; 1/1/2020		204 LINEAR TO QUALITY N2 FOAM, 59604 1 8040# 2 PPG, 8920# 3 PPG ALL SAND TAGGED WITH 10 MCI IR-192 TF	RACER
1,285 1			20# LINEAR 60 QUALITY N2 FOAM 11709# 17325# 5 PPG, ALL SAUD TAGGED WATH 12 NCLIR-192 TRACER	
1,330.1			30# LINEAR 60 QUALITY N2 FOALI FLUSH : 310/1005 	
1,322.0			// 1403; 1469 - 75; 1497; 1530 - 38; Total 11,00 hotes PERF - FRUITLAND COAL: 1,864,0-1,594.0,	3 dia
				053,0509
1,538.1			2010 92407 2010 & 190 6515 20# GEL & SCF 1/2 1-1 stim 30, Remarks, FRACED WE PER DESIGN GOOD JOB FLIELD COST OF ISTAGE	ill i i i i i i i i i i i i i i i i i i
1,554 0 .	•		30# LINEAR 70 QUALITY N2 FOAM PAD.	
1,594.2			30# LINEAR 70 OUAUITY N2 FOAM, 6237# 1 5544# 2 PG. 11760# 3 PPG SAND TAGGED WITH 16 MCI IR-192 TRACE 30# LINEAR 60 QUALITY N2 FOAM, 12160#	=p
1,680,1			12075# 5 FPG ALL SAVE TAGGED WITH 12 MOUR-192 TRACER. 	
			3/15/1995	I
i,935.9				· · · · · · · · · · · · · · · · · · ·
1,653.6			Casing Shoe, ThreanLock VIII, Y, 1963.6.1.3 Auto cement plug, 1,920.0.1.961.0, Automatic created engent plug 1,920.0.1.961.0, Automatic	caty ]
1,954 6		4	Greated cement plug from the casing cement in nad a tagged depth. 2/24/1095 Freduction Cosing Cement, 50 0-1.981.0; CE 163 SXS CLASS G: CMT W/4 GPS DISPER	
1.981.0			PFS CELLOPHAVE, 0 20% D-112 (546 CUF1 W/ 167 SXS CLASS 'G' NEAT CLIT W/ 4 GPS	2.025 T) TAIL S D-155
			FUME SILICA, 0 25 D-65 TIC D, 0 10% D-46 ANTIFOAM, 0 25 PPS CELLOPHANE (342 C TOC 50' RAY BY CBL ON 3/18/1995 ; 2/24/1	NET).

# UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT FARMINGTON DISTRICT OFFICE 6251 COLLEGE BLVD.

FARMINGTON, NEW MEXICO 87402

Attachment to notice of Intention to Abandon:

. . .

Re: Permanent Abandonment Well: Rhodes B #100

# CONDITIONS OF APPROVAL

1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal and Indian Lease."

2. Farmington Office is to be notified at least 24 hours before the plugging operations commence (505) 564-7750.

- 3. The following modifications to your plugging program are to be made:
  - a) Bring the top of plug #2 to 356 ft. to cover the Kirtland and Ojo Alamo tops. Adjust cement volume accordingly.

You are also required to place cement excesses per 4.2 and 4.4 of the attached General Requirements.

Office Hours: 7:45 a.m. to 4:30 p.m.