Form 3160- 5 (August 2007)

## UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

RECEIVED

OCT 29

FORM APPROVED

OMB No. 1004-0137 Expires: July 31,2010

SUNDRY NOTICES AND REPORTS ON WELLS

Lease Serial No.

Jicarilla Contract 452

ab	eandoned well. Use Form 31	60-3 (APD) for such pi	roposalsu of Land I	Vanagicarilla	Apache Tribe	
SUBMIT IN TRIPLICATE - Other Instructions on page 2.				7. If Unit or CA. Agreement Name and/or No.		
1. Type of Well  Oil Well  ✓ Gas Well  Other					8. Well Name and No.	
2. Name of Operator				Jicarilla 452-07 #13		
Black Hills Gas Resources, Inc.				9. API Well No.		
3a. Address	3b. Phone No. (include area code)		30-039-29	300.00		
P.O. Box 249 Bloomfield, NM 87413 (505) 634-5104			04	10. Field and Pool, or Exploratory Area		
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)			East Blanco Pictured Cliffs			
SHL: 690' FNL & 1345' FEL NW/NE Sec. 7 T29N R3W (UL: B)				11. County or Parish, State		
BHL: 784' FNL & 732' FWL NW/NW Sec. 7 T29N R3W (UL: D)				Rio Arriba County, New Mexico		
12. CHECK APPI	ROPRIATE BOX(S) TO IND	ICATE NATURE OF	NOTICE, REPORT,	OR OTHER DA	TA	
TYPE OF SUBMISSION	TYPE OF ACTION					
Notice of Intent	Acidize	Deepen	Production (	( Start/ Resume) Water Shut-off		
	Altering Casing	Fracture Treat	Reclamation		Well Integrity	
Subsequent Report	Casing Repair	New Construction	Recomplete		Other	
Of	Change Plans	Plug and abandon	Temporarily	Abandon		

13. Describe Proposed or Completed Operation Clearly state all pertinent details including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will performed or provide the Bond No. on file with the BLM/ BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notice shall be filed only after all requirements, including reclamantion, have been completed, and the operator has determined that the site is ready for final inspection.)

Plug back

Black Hills Gas Resources had completed plugging the Jicarilla 452-07 #13 per the attached summary report.

Attachment: Plug and Abandonment Report

Final Abandonment Notice

ACCEPTED FOR RECORD

Water Disposal

Approved as to plugging of the well bore. Liability under bond is retained until surface restoration is completed.

Convert to Injection

FARMINGTON FIRED OFFICE BY:

14. I hereby certify that the foregoing is true and correct. Name (Printed/ Typed)		
Daniel Manus Re	gulatory Technician II	
Signature Taniel Many Date	Oct. 29 201	5
THIS SPACE FOR FEDER	AL OR STATE OFFICE USE	
Approved by		LE THERE WILL BE
	Title	Date
Conditions of approval, if any are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.	Office	
Title 18 U.S.C. Section 1001 AND Title 43 U.S.C. Section 1212, make it a crime for any person ki	nowingly and willfully to make any department or a	gency of the United States any false,

(Instructions on page 2)

690' FNL and 1345' FEL, Section 7, T-29-N, R-3-W Rio Arriba County, NM Lease Number: Jicarilla Contract 452 API #30-039-29470

Plug and Abandonment Report Notified Jicarilla BLM, BLM & NMOCD on 10/12/15

## Plug and Abandonment Summary:

Plug #1 with 24 sxs (28.32 cf) Class B cement from 2149' to 1938' to cover the Nacimiento top.

Plug #2 with 53 sxs (62.54 cf) Class B cement from 386' to surface to cover the 8-5/8" casing shoe & surface, 1) pump 45 sxs to circulate good cement out 5-1/2" casing valve, 2) TOH & LD all tubing and plugging sub, RU pump to 5-1/2" casing valve, 3) pump 8 sxs to re-fill 5-1/2" casing.

Plug #3 with 16 sxs Class B cement top off casings and install P&A marker with coordinates N 36° 44' 42" / W 107° 11' 16".

## Plugging Work Details:

- 10/13/15 MIRU A-Plus #14 rig. Open up well; no pressures. ND WH. NU BOP & function test. PU plugging sub & 2-3/8" workstring. TIH to 2149'. Roll hole w/ 52 bbls. Pressure test casing to 800 PSI, OK. Load bradenhead w/ < 1/8 bbl & pressure test bradenhead to 300 PSI, OK. Spot plug #1 with calculated TOC at 1938'. SI well. SDFD.
- 10/14/15 Travel to location. Open up well; no pressures. Function test BOP. Spot plug #2 with TOC at surface. ND BOP. NU WH. Dig out WH. Write Hot Work Permit. Cut off WH. Found cement at cutoff point in 5-1/2" and 8-5/8" casings. Spot plug #3 top off casings and install P&A marker with coordinates N 36° 44' 42" / W 107° 11' 16". RD & MOL.

Bryce Hammond, Jicarilla BLM representative, was on location.