UNITED STATES Form 3160-5 FORM APPROVED DEPARTMENT OF THE INTERIOR OMB No. 1004-0137 (August 2007) BUREAU OF LAND MANAGEMENT Expires: July 31, 2010 5. Lease Serial No. SF-078000 Farmington Field SUNDRY NOTICES AND REPORTS ON WELLS
Bureau of Landause this form for proposals to drill or to re-enter an 6. If Indian, Allottee or Tribe Name abandoned well. Use Form 3160-3 (APD) for such proposals. SUBMIT IN TRIPLICATE - Other instructions on page 2 7. If Unit of CA/Agreement, Name and/or No. 1. Type of Well Huerfano Unit Oil Well X Gas Well Other Revised 8. Well Name and No. **Huerfano Unit 47** 2. Name of Operator 9. API Well No. Burlington Resources Oil & Gas Company LP 30-045-05971 3a. Address 3b. Phone No. (include area code) 10. Field and Pool or Exploratory Area PO Box 4289, Farmington, NM 87499 (505) 326-9700 **Ballard Pictured Cliffs** 4. Location of Well (Footage, Sec., T., R., M., or Survey Description) 11. Country or Parish, State Surface Unit A (NENE), 990' FNL & 990' FEL, Sec. 9, T26N, R9W San Juan **New Mexico** 12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT OR OTHER DATA TYPE OF SUBMISSION TYPE OF ACTION Notice of Intent Acidize Deepen Production (Start/Resume) Water Shut-Off Alter Casing Fracture Treat Reclamation Well Integrity X Subsequent Report Casing Repair New Construction Recomplete Other Change Plans Plug and Abandon Temporarily Abandon Plug Back Final Abandonment Notice Convert to Injection Water Disposal 13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once Testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.) 10/12/15 Contacted Brandon Powell/OCD (Jamie Joe/BLM onsite) re Plug 2 (Kirtland/Ojo). Ran CBL 10/9/15. Perfd @ 410' couldn't get injection rate; perf'd @ 1206' couldn't get injection rate. Requested permission to spot balanced plug to cover Kirtland/Ojo formation top, then POOH. Rec'vd verbal approval to proceed. The subject well was P&A'd on 10/13/15 per the notification above and the attached report. ACCEPTED FOR RECORD Approved as to plugging OIL CONS. DIV DIST, 3 of the well bore. Liability under bond is retained until surface restoration is completed. DEC 1 5 2015

14. I hereby certify that the foregoing is true and correct. Name (Printed/Typed)		La Cherry St.
Dollie L. Busse	Title Staff Regulatory Technician	
Signature Alli Busse	Date 11/17/15	
THIS SPACE FOR FE	DERAL OR STATE OFFICE USE	
Approved by		
	Title	Date
Conditions of approval, if any, are attached. Approval of this notice does not warrant that the applicant holds legal or equitable title to those rights in the subject lease which		

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction

entitle the applicant to conduct operations thereon.

## A-PLUS WELL SERVICE, INC.

P.O. BOX 1979 Farmington, New Mexico 87499

505-325-2627 \*fax: 505-325-1211

Conoco Phillips Huerfano #47

October 13, 2015 Page 1 of 1

990' FNL and 990' FEL, Section 09, T-26-N, R-09-W San Juan County, NM Lease Number: SF-078000 API #30-045-05971

Plug and Abandonment Report Notified NMOCD and BLM on 10/8/15

## Plug and Abandonment Summary:

Plug #1 with CIBP at 2033' spot 11 sxs (12.98 cf) Class B cement from 2033' to 1634' to cover the Pictured Cliff and Fruitland tops.

Plug #2 with squeeze holes at 1410' and 1206' spot 14 sxs (16.52 cf) Class B cement with 2% Cal Chloride from 1460' to 952' to cover the Kirtland and Oio Alamo tops. Tag TOC low at 1152'.

Plug #2A with 10 sxs (11.8 cf) Class B cement from 1152' to 789' to cover the Ojo Alamo top.

Plug #3 with squeeze holes at 183' spot 53 sxs (62.54 cf) Class B cement from 183' to surface with 5 sxs in 2-7/8" casing, and 48 sxs in annulus.

Plug #4 with 18 sxs Class B cement top off casings and install P&A Marker.

## Plugging Work Details:

10/8/15 Rode rig and equipment to location. Note: Rig axle broke on way to location, and had to be towed. Spot in and RU. SDFD.

10/9/15 Held safety meeting. Bump test H2S equipment. Check well pressures: casing 20 PSI, BH 0 PSI. Blow down well. RD wellhead. RU companion flange. NU BOP. RU A-Plus WL. RIH with 2-7/8" gauge ring to 2043'. POOH. RIH and set CIBP at 2033'. POOH. RD WL. TIH and tally 63 joints 1-1/4" IJ tubing to 2033'. Shut in casing and pressure test to 800# for 30 minutes. TOOH with tubing. RU WL and run CBL from 2033' to surface. Found good cement from 2033' to 20'. RD WL. SI Well. SDFD.

10/12/15 Held safety meeting. Bump test H2S equipment. Check well pressures: 0 PSI on well. Open well to pit. Function test BOP. TIH with tubing to 2033'. Spot Plug #1. TOOH with tubing. RU WL and perforate 4 holes at 1410'. POOH. Pressure up to 1500#, unable to establish rate. RIH and perforate 4 holes at 1206'. POOH. Attempt to get rate, pressured up to 1500# and bled down to 0 in 5 minutes. Vic Montoya, COPC representative, approved procedure change. TIH with tubing to 1460'. Spot Plug #2. TOOH with tubing. WOC. TIH and tag TOC low at 1152'. Pressure test casing to 800#. Spot Plug #2A. LD remaining tubing. RU WL. RIH and perforate 4 holes at 183'. POOH. RD WL. Spot Plug #3. SI Well. SDFD.

10/13/15 Held safety meeting. Bump test H2S equipment. Check well pressures: 0 PSI on well. Open well top it. Found TOC at surface. Dig out WH. RU High Desert. Cut off WH. Found TOC at surface in annulus and in 2-7/8" casing, and 2' in 7" casing. Spot Plug #4 and set P&A Marker. RD and MOL.

> Jim Morris, COPC representative, was on location. Jamie Joe, BLM representative, was on location on 10/12 and 10/13.