Form 3160-5

# UNITED STATES

FORM APPROVED

abandoned well.	Use Form 3160-3 (	s to drill or to re-enter and (APD) for such proposals.	6. If Indian, Allottee or Tribe Name
SUBI	7. If Unit of CA/Agreement, Name and/or No.		
	Gas Well Other		8. Well Name and No. MC 7 Com #913H
2. Name of Operator WPX Energy Production, LLC	9. API Well No. 30-039- 3 13 5 \		
3a. Address PO Box 640 Aztec, NM		3b. Phone No. (include area code) 505-333-1808	10. Field and Pool or Exploratory Are Basin Mancos / Lybrook Gallup
4. Location of Well <i>(Footage, Sec</i> SHL: 1647' FNL & 2337' FEL So BHL: 330' FNL & 330' FWL Sec	ec 6 23N 7W	ription)	11. Country or Parish, State Rio Arriba, NM San Juan, NM
	HE APPROPRIATE BOX(	ES) TO INDICATE NATURE OF NOT	
TYPE OF SUBMISSION		TYPE OF AC	Production W. C. C.
		Fracture Treat  New Construction  Plug and Abandon  Plug Back  all pertinent details, including estimated	Reclamation Recomplete  Temporarily ndon  Starting date of any proposed work and approximation face locations and measured and true vertical depth
of all pertinent markers and zo Required subsequent reports a completion or recompletion in only after all requirements, in	ones. Attach the Bond unde must be filed within 30 days n a new interval, a Form 31 cluding reclamation, have b	or which the work will be performed or p is following completion of the involved of 60-4 must be filed once testing has been been completed and the operator has deter	rovide the Bond No. on file with BLM/BIybA. perations. If the operation results in a multiple completed. Final Abandonment Notices must be fil rmined that the site is ready for final inspection.)
of all pertinent markers and zo Required subsequent reports to completion or recompletion in	ones. Attach the Bond unde must be filed within 30 days n a new interval, a Form 31 cluding reclamation, have b	or which the work will be performed or p is following completion of the involved of 60-4 must be filed once testing has been been completed and the operator has deter	rovide the Bond No. on file with BLM/BIybA. perations. If the operation results in a multiple completed. Final Abandonment Notices must be fil rmined that the site is ready for final inspection.)  CONDITIONS OF APPROVAL
of all pertinent markers and zo Required subsequent reports a completion or recompletion in only after all requirements, in	ones. Attach the Bond unde must be filed within 30 days n a new interval, a Form 31 cluding reclamation, have b	or which the work will be performed or p is following completion of the involved of 60-4 must be filed once testing has been been completed and the operator has deter	rovide the Bond No. on file with BLM/BIybA. perations. If the operation results in a multiple completed. Final Abandonment Notices must be fil rmined that the site is ready for final inspection.)

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on page 2)

entitle the applicant to conduct operations thereon.



# **WPX Energy**

## **Operations Plan**

(Note: This procedure will be adjusted onsite based upon actual conditions)

Date:

January 7, 2016

Field:

BASIN MANCOS/ LYBROOK GALLUP

Well Name:

MC 7 COM #913H

Surface:

BLM

SH Location:

SWNE Sec 6 23N-07W

Elevation:

6970' GR

BH Location:

NWNW Sec 1 23N-08W

Minerals:

IA FED

Measured Depth: 13,213.00

I. GEOLOGY:

SURFACE FORMATION - NACIMIENTO

A. FORMATION TOPS (KB)

NAME	MD	TVD	NAME	MD	TVD	
3.48						
OJO ALAMO	1227	1225	POINT LOOKOUT	IT LOOKOUT 4299		
KIRTLAND	1397	1393	MANCOS 4532		4497	
PICTURED CLIFFS	1940	1931	GALLUP	LUP 4907		
LEWIS	2033	2023	KICKOFF POINT	4,675.71	4,638.93	
CHACRA	2306	2293	TOP TARGET	5580.00	5293.00	
CLIFF HOUSE	3460	3435	LANDING POINT	5,761.50	5,325.00	
MENEFEE	3503	3478	BASE TARGET	5,761.50	5,325.00	
			TD	13,213.00	5,293.00	

- B. MUD LOGGING PROGRAM: Mudlogger on location from surface csg to TD.
- C. LOGGING PROGRAM: LWD GR from surface casing to TD.
- D. <u>NATURAL GAUGES:</u> Gauge any noticeable increases in gas flow. Record all gauges in Tour book and on morning reports.

## II. DRILLING

- A. <u>MUD PROGRAM:</u> LSND mud (WBM) will be used to drill the 12-1/4" Surface hole, the 8 ¾" Directional Vertical hole, and the curve portion of the wellbore. A LSND (WBM) or (OBM) will be used to drill the lateral portion of well. Treat for lost circulation as necessary. Obtain 100% returns prior to cementing. Notify Engineering of any mud losses.
- B. <u>BOP TESTING:</u> While drill pipe is in use, the pipe rams and the blind rams will be function tested once each trip. The anticipated reservoir is expected to be less than 1300 psi, so the BOPE will be tested to 250 psi (Low) for 5 minutes and 1500 psi (High) for 10 minutes. Pressure test surface casing to 600 psi for 30 minutes and intermediate casing to 1500 psi for 30 minutes. Utilize a BOPE Testing Unit with a recording chart and appropriate test plug for testing. The drum brakes will be inspected and tested each tour. All tests and inspections will be recorded in the tour book as to time and results.

Hold for APD

# III. MATERIALS

## A. CASING PROGRAM:

CASING TYPE	OH SIZE (IN)	DEPTH (MD)	CSG SIZE	WEIGHT	GRADE	CONN
SURFACE	12.25"	320'	9.625"	36 LBS	J-55 or equiv	STC
INTERMEDIATE	8.75"	5,761.50	7"	23 LBS	J-55 or equiv	LTC
PRODUCTION	6.125"	5611.5 - 13,213.00	4.5"	11.6 LBS	P-110 or equiv	LTC
TIE BACK	6.125"	Surf 5611.5	4.5"	11.6 LBS	P-110 or equiv	LTC

## B. FLOAT EQUIPMENT:

- 1. <u>SURFACE CASING:</u> 9-5/8" notched regular pattern guide shoe. Run (1) standard centralizer on each of the bottom (4) joints of Surface Casing.
- 2. INTERMEDIATE CASING: 7" cement nose guide shoe with a self-fill insert float. Place float collar one joint above the shoe. Install (1) centralizer on each of the bottom (3) joints and one standard centralizer every (3) joints to 2,500 ft. Run (1) centralizer at 2,500 ft., 2,300ft., 2,000ft., 1,500 ft., and 1,000 ft. A DV tool will be placed 100' above the top of the Chacra formation. If cement is circulated back to surface on the first stage, a cancelation device will be dropped to shift the dv tool closed and the 2nd stage cement job will be aborted at that time.
- 3. <u>PRODUCTION LINER:</u> Run 4-1/2" Liner with cement nose guide Float Shoe + 2jts. of 4-1/2" casing + Landing Collar + 4-1/2" pup joint + 1 RSI (Sliding Sleeve) positioned inside the 330ft Hard line. Centralizer program will be determined by Wellbore condition and when Lateral is evaluated by Geoscientists and Reservoir Engineers. Set seals on Liner Hanger. Test TOL to 1500 psi for 15 minutes.

## C. CEMENTING:

(Note: Volumes may be adjusted onsite due to actual conditions)

- 5 bbl Fresh Water Spacer, 100 sx (160 cu.ft.) of 14.5 ppg Type I-II (Neat G) + 20% Fly Ash cement w/ 7.41 gal/sack mix water ratio @ 1.61 cu ft/sx yield. Calculated @ volume + 50% excess. WOC 12 hours. Test csg to 600psi. Total Volume: (160 cu-ft/100 sx/ Bbls).TOC at Surface.
- 2.Intermediate
  STAGE 1: Spacer #1: 20 bbl (112 cuft) Chemwash. Lead Cement: 122 bbls, 347 sks, (684 cuft), 12.3 ppg @ 1.97 cuft/sk yield. Tail Cement: 79 bbls, 342 sks, (444 cuft), 13.5 ppg @ 1.3 cuft/sk yield. Displacement: Displace w/ +/- 227 bbl Drilling mud or water.

  Total Cement: 201 bbls, 689 sks, (1128 cuft)
  STAGE 2: Spacer #1: 20 bbl (112 cuft) Chemwash. Lead Cement: 55 bbls, 158 sks, (308 cuft), 12.3 ppg @ 1.97 cuft/sk yield. Tail Cement: 16 bbls, 78 sks, (90 cuft), 13.5 ppg @ 1.3 cuft/sk yield. Displacement: Displace w/ +/- 87 bbl Drilling mud or water.

  Total Cement: 71 bbls, 236 sks, (398 cuft)
- 3. PROD. LINER: Spacer #1:10 bbl (56.cu-ft) Water Spacer. Spacer #2: 40 bbl 9.5 ppg (224.6 cu-ft) Tuned Spacer III. Spacer #3: 10 bbl Water Spacer. Lead Cement: Extencem ™ System. Yield 1.36 cuft/sk 13.3 ppg (745 sx /1013 cuft /180 bbls). Tail Spacer: 20 BBL of MMCR. Displacement: Displace w/ +/- 140 bbl Fr Water. Total Cement (745 sx /1013bbls).

# I. COMPLETION

## A. CBL

Run CCL for perforating

## A. PRESSURE TEST

1. Pressure test 4-1/2" casing to 4500 psi max, hold at 1500 psi for 30 minutes. Increase pressure to Open RSI sleeves.

# B. STIMULATION

- 1. Stimulate with approximately 2,805,000# 20/40 mesh sand and 340,000# 16/30 mesh sand in 619,113 gallons water with 42,696 mscf N2 for 17 stages.
- 2. Isolate stages with flow through frac plug.
- 3. Drill out frac plugs and flowback lateral.

## C. RUNNING TUBING

- 1. <u>Production Tubing:</u> Run 2-7/8", 6.5#, J-55, EUE tubing with a SN on top of bottom joint. Land tubing near Top of Liner.
- Although this horizontal well will be drilled past the applicable setbacks, an unorthodox location application is not required because the completed interval in this well, as defined by 19.15.16.7 B(1) NMAC, will be entirely within the applicable setbacks. This approach complies with all applicable rules, including 19.15.16.14 A(3) NMAC, 19.15.16.14 B(2) NMAC, 19.15.16.15 B(2)NMAC, and 19.15.16.15. B(4) NMAC.

#### NOTE:

# **Proposed Operations:**

A 4-1/2" 11.6# N-80 Liner will be run to TD and landed +/- 150 ft. into the 7" 23# K-55 Intermediate casing with a Liner Hanger and pack-off assembly then cemented to top of liner hanger.

After cementing and TOL clean up operations are complete, the TOL will be tested to 1500 psi (per BLM).