

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

RECEIVED

FORM APPROVED  
OMB No. 1004-0137  
Expires: March 31, 2007

**SUNDRY NOTICES AND REPORTS ON WELLS**  
**Do not use this form for proposals to drill or to re-enter and**  
**abandoned well. Use Form 3160-3 (APD) for such proposals.**

SUBMIT IN TRIPLICATE - Other instructions on page 2.

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

OIL CONS. DIV DIST. 3

2. Name of Operator

WPX Energy Production, LLC

3a. Address

PO Box 640 Aztec, NM 87410

3b. Phone No. (include area code)

505-333-1816

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

SHL: 1086' FSL & 450' FWL SEC 33 24N 8W

BHL: 1573' FSL & 230' FEL SEC 33 24N 8W

5. Lease Serial No.

NMNM 119283

6. If Indian, Allottee or Tribe Name

7. If Unit of CA/Agreement, Name and/or No.

8. Well Name and No.

Chaco 2408 33M #121H

9. API Well No.

30-045-35677

10. Field and Pool or Exploratory Area  
Basin Mancos

11. Country or Parish, State  
San Juan, NM

12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION			
<input checked="" type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize	<input type="checkbox"/> Deepen	<input type="checkbox"/> Production (Start/Resume)	<input type="checkbox"/> Water Shut-Off
<input type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing	<input type="checkbox"/> Fracture Treat	<input type="checkbox"/> Reclamation	<input type="checkbox"/> Well Integrity
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> New Construction	<input type="checkbox"/> Recomplete	<input type="checkbox"/> Other <b>P&amp;A</b>
	<input type="checkbox"/> Change Plans	<input checked="" type="checkbox"/> Plug and Abandon	<input type="checkbox"/> Temporarily Abandon	
	<input type="checkbox"/> Convert to Injection	<input type="checkbox"/> Plug Back	<input type="checkbox"/> Water Disposal	

13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleate horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleation in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.)

Notify NMOCD 24 hrs  
prior to beginning  
operations

WPX Energy request to plug and abandon the above well per attached plugging procedure, wellbore and reclamation plan.

NOTE: ONLY SPUD/SURFACE PREVIOUSLY SET  
**ACTION DOES NOT RELIEVE THE LESSEE AND  
OPERATOR FROM OBTAINING ANY OTHER  
AUTHORIZATION REQUIRED FOR OPERATIONS  
ON FEDERAL AND INDIAN LANDS**

**SEE ATTACHED FOR  
CONDITIONS OF APPROVAL**

14. I hereby certify that the foregoing is true and correct.

Name (Printed/Typed)

Lacey Granillo

Title Permit Tech III

Signature

6/21/16

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved by

Title PE

Date 6/23/16

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Office FFO

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on page 2)

NMOCD

XC  
5



## WPX Plug & Abandon Procedure

June 1, 2016

<b>Well:</b>	Chaco 2408-33M #121H	<b>API:</b>	30-045-35677
<b>Location:</b>	1086'FSL & 450' FWL	<b>Field:</b>	PROVIDED BY WPX
<b>Sec, T, R:</b>	Sec. 33, T24N, R08W	<b>Elevation:</b>	GL: XXXX'; KB: XXXX'
<b>Cnty/State:</b>	San Juan, New Mexico	<b>By:</b>	Aztec Well Servicing
<b>GPS:</b> Lat: 36.266575N; Long: 107.694764W			

### Objective:

Permanently plug & abandon surface hole containing 9-5/8" 36.0lb/ft casing set at a depth of 341'.

### Prior to Rig:

1. NO rig anchors needed
2. Notify BLM & NMOCD

### Procedure:

1. Move-in cementing equipment.
2. Spot tubing trailer w/ workstring and half tank.
3. NU stripping head w/ diverter port tied into half tank or dirty water truck (pull vacuum while pumping to minimize fluid spill on location), and install 2" hand operated slips for safety.
4. Hold safety meeting with rig crew and related personnel explaining the procedure and outlining potential hazards.
5. Tally & TIH w/ 2" PVC pipe by hand. Note: This will be surface casing only, WPX confirms casing is full of fluid (if not, can be topped off with fresh water), PVC can be floated to bottom (plug bottom of 2" PVC with a low pressure pump out plug or equivalent, load PVC with fluid to float to bottom, as needed ONLY - PVC should remain in floating status at all times, tag bottom to verify previous depth.
6. Rig up cementing equipment to PVC connection, load PVC and observe returns prior to cement mixing. Once returns are observed prepare to mix cement as designed. Mix and pump 125x with 16.0bbls of mix water. Note: need 2.0-5.0bbls water ahead to clear pumps and lines, no displacement calculated.
7. **Pump Plug #1 (341' - Surface):** Circulate cement out the end of tubing from 341' to surface until good cement is observed on returns.
8. Cut PVC and leave in the wellbore. Note: wash pumping equip. prior to moving to next location.
9. Cut off casing below surface and Install P&A marker.
10. RD & Move out all related equipment to next location, or release.


# CHACO 2408-33M #121H

## Current

Spud: 5/20/15

SHL: 1086' FSL & 450' FWL  
SEC 33 24N 8W

SAN JUAN, NM  
API: 30-045-35677

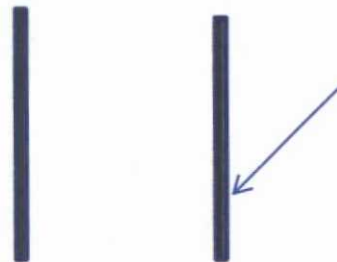

Run 11jts., 9- 5/8", 36#, J-55, LT&C csg set @ 336', FC @ 305'  
TD 12-1/4" Surface hole @ 341'



Spud: 5/20/15

## CHACO 2408-33M #121H Proposed P&A

SHL: 1086' FSL & 450' FWL  
SEC 33 24N 8W

SAN JUAN, NM  
API: 30-045-35677



Run 11jts., 9- 5/8", 36#, J-55, LT&C csg set @ 336', FC @ 305'  
TD 12-1/4" Surface hole @ 341'

**Plug #1:**  
125sx cement, 341'-Surface

UNITED STATES DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT  
FARMINGTON DISTRICT OFFICE  
6251 COLLEGE BLVD.  
FARMINGTON, NEW MEXICO 87402

Attachment to notice of  
Intention to Abandon:

Re: Permanent Abandonment  
Well: Chaco 2408 33M #121H

CONDITIONS OF APPROVAL

1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal and Indian Lease."
2. Farmington Office is to be notified at least 24 hours before the plugging operations commence (505) 564-7750.

You are also required to place cement excesses per 4.2 and 4.4 of the attached General Requirements.

Office Hours: 7:45 a.m. to 4:30 p.m.