UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an

FORM APPROVED
OMB NO. 1004-0137
Expires: January 31, 201

	Expires. Jain	4
5.	Lease Serial No.	
	NMSF078926	

6.	If Indian, Allottee or Tribe Name
	EASTERN NAVAJO

abandoned wel		EASTERN NAVAJO						
SUBMIT IN TRIPLICATE - Other instructions on page 2					7. If Unit or CA/Agreement, Name and/or No. 892000844E			
1. Type of Well ☐ Oil Well ☑ Gas Well ☐ Oth	205			8. Well Name and No. GALLEGOS CANYON UNIT 365				
2. Name of Operator	Contact: 7	IN	9. API Well No.					
BP AMERICA PRODUCTION	CO E-Mail: Toya.Colvin	30-045-26881-00-S1						
3a. Address 200 ENERGY COURT FARMINGTON, NM 87401		. (include area code) 6.7148		10. Field and Pool or Exploratory Area UNKNOWN Lutz Pictored Cliffs				
4. Location of Well (Footage, Sec., T	., R., M., or Survey Description)				11. County or Parish,	State		
Sec 25 T29N R13W SESE 09 36.692540 N Lat, 108.150640				SAN JUAN COUNTY, NM				
12. CHECK THE AF	PPROPRIATE BOX(ES) T	ΓΟ INDICA	TE NATURE OI	F NOTICE,	REPORT, OR OTH	IER DA	ТА	
TYPE OF SUBMISSION	TYPE OF ACTION							
Notice of Intent ■ Notice of Intent Notice of Inten	☐ Acidize	☐ Dee	pen	☐ Product	tion (Start/Resume)	□ Wat	er Shut-Off	
_	☐ Alter Casing	☐ Hyd	raulic Fracturing	☐ Reclam	ation	■ Wel	l Integrity	
☐ Subsequent Report	☐ Casing Repair	□ New	Construction	☐ Recomp	plete	Othe	er	
☐ Final Abandonment Notice	☐ Change Plans	☑ Plug	and Abandon	☐ Tempor	rarily Abandon			
82K	☐ Convert to Injection	Plug	Back	■ Water I	Disposal			
following completion of the involved testing has been completed. Final At determined that the site is ready for fi BP requests to P&A the subje Please note our operations sp reclamation plans are required	pandonment Notices must be filed in all inspection. ct well. Please see the attace tecialist has confirmed this	d only after all a	requirements, includidure and wellbore	ing reclamation	n, have been completed a	and the ope	rator has	
In accordance with NMOCD P operations.	it Rule 19.15.17.9 NMAC,	BP will use	a closed-loop sys	stem during	NMOCD			
		Notify NM	IOCD 24 hrs					
		prior to	beginning MAR 16 2018 attons					
					DISTRICT 1	11		
14. I hereby certify that the foregoing is	true and correct. Electronic Submission #4 For BP AMERICA mmitted to AFMSS for proce	PRODUCTIO	N CO, sent to the	Farmington	n -			
Name (Printed/Typed) TOYA CO				ATORY AN				
					*			
Signature (Electronic S	Date 02/20/2018							
	THIS SPACE FO	R FEDERA	L OR STATE	OFFICE U	SE			
Approved By JACK SAVAGE			TitlePETROLE	UM ENGIN	EER	Da	ate 03/05/2018	
Conditions of approval, if any, are attache certify that the applicant holds legal or equ which would entitle the applicant to condu	Office Farmington							
Title 18 U.S.C. Section 1001 and Title 43 States any false, fictitious or fraudulent s	U.S.C. Section 1212, make it a c statements or representations as t	rime for any pe	erson knowingly and ithin its jurisdiction.	willfully to m	ake to any department or	agency of	the United	

(Instructions on page 2) ** BLM REVISED ** BLM REVISED ** BLM REVISED ** BLM REVISED **

NMOCD/~

BP America

Plug And Abandonment Procedure GCU 365

900' FSL & 765' FEL, Section 25, T29N, R13W San Juan County, NM / API 30-045-26881

- 1. Hold pre-job safety meeting. Comply with all NMOCD, BLM safety and environmental regulations. Test rig anchors prior to moving in rig if not rigged to base beam.
- 2. Check casing, tubing, and bradenhead pressures.
- 3. Remove existing piping on casing valve. RU blow lines from casing valves and begin blowing down casing pressure. Kill well as necessary. Ensure well is dead or on a vacuum.
- 4. ND wellhead and NU BOP. Function test BOP.
- 5. P/U 4-1/2" bit or casing scraper on 2-3/8" workstring and round trip as deep as possible above top perforation at 1246'.
- 6. P/U 4-1/2" CR, RIH and set CR at +/- 1196'. Pressure test tubing to 1000 psi. Sting out of CR. Load hole, and pressure test casing to 800 psi. If casing does not test, then spot or tag subsequent plugs as appropriate. POOH w/ tubing.
- 7. Rig up to pump cement down tubing. Pump water to establish rate down tubing.

NOTE: All Plugs Include 100% excess outside casing and 50% Excess inside casing

9. Plug 1 (Pictured Cliffs Interval, Fruitland Formation Top 1196'-780', 35 Sacks Class B Cement)

Mix 35 sx Class B cement and spot a balanced plug inside casing to cover Pictured Cliffs interval and Fruitland formation top.

10. Plug 2 (Kirtland, Ojo Alamo Formation Tops and Surface Shoe 250's surface, 55 Sacks Class B Cement)

Attempt to pressure test the bradenhead annulus to 300 psi; note the volume to load. If BH annulus holds pressure, then establish circulation out casing valve with water. Mix approximately 55 sx Class B cement and spot a balanced plug from 250' to surface, circulate good cement out of casing valve. TOH and LD tubing. Shut well in and WOC. If BH annulus does not test, then perforate at the appropriate depth and attempt to circulate cement to surface filling the casing from 250' and the annulus from the squeeze holes to surface. Shut in well and WOC.

11. ND cementing valves and cut off wellhead. Fill annuli with cement as necessary. Install P&A marker to comply with regulations. Record GPS coordinate for P&A marker on tower report. Photograph P&A marker in place. RD, MOL and restore location per BLM stipulations.

Wellbore Diagram

Gallegos Canyon Unit 365 API #: 3004526881 San Juan, New Mexico

Plug 2

250 feet - Surface 250 feet plug 55 sacks of Class B Cement

Plug 1

1196 feet - 780 feet 416 feet plug 35 sacks of Class B Cement

Surface Casing

7" 20# @ 127 ft


Formation

Fruitland Coal - 880 feet

Retainer @ 1196 feet

Perforations 1246 feet - 1266 feet

> **Production Casing** 4.5" 10.5# @ 1383 ft

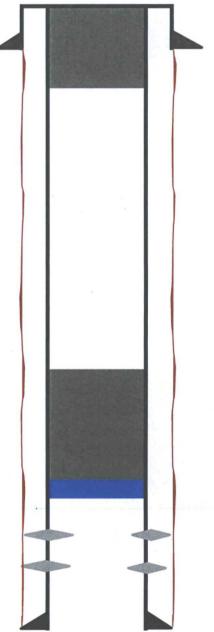

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT FARMINGTON DISTRICT OFFICE

6251 COLLEGE BLVD. FARMINGTON, NEW MEXICO 87402

Attachment to notice of Intention to Abandon:

Re: Permanent Abandonment Well: Gallegos Canyon Unit 365

CONDITIONS OF APPROVAL

- 1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal and Indian Lease."
- 2. Farmington Office is to be notified at least 24 hours before the plugging operations commence (505) 564-7750.

Low concentrations of H_2S (>100 ppm GSV) have been reported in the SWSW/4 Sec. 26, 29N, 13W.

You are also required to place cement excesses per 4.2 and 4.4 of the attached General Requirements.

Office Hours: 7:45 a.m. to 4:30 p.m.