Form 3160-5 (June 2015)

UNITED STATES

DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

OMB NO. 1004-0137 Expires: January 31, 2018 5. Lease Serial No.

INIVISI	-079	043	
 			 _

FORM APPROVED

SUNDRY NOTICES AND REPORTS ON WELLS
Do not use this form for proposals to drill or to re-enter an
abandoned well. Use form 3160-3 (APD) for such proposals

abandoned well. Use form 3160-3 (APD) for such proposals.		
SUBMIT IN TRIPLICATE - Other instructions on page 2		
Type of Well Gas Well		
2. Name of Operator Contact: TOYA COLVIN BP AMERICA PRODUCTION COMPAN-Mail: Toya.Colvin@bp.com		
3b. Phone No. (include area code) Ph: 281.892.5369	10. Field and Pool or Exploratory Area BASIN FRUITLAND COAL	
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)		
	SAN JUAN COUNTY, NM	
	TOYA COLVIN n@bp.com 3b. Phone No. (include area code) Ph: 281.892.5369	

12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE	NATURE OF NOTICE, REPORT, OR OTHER DATA
---	---

TYPE OF SUBMISSION TYPE OF ACTION				
Notice of Intent	☐ Acidize	☐ Deepen	☐ Production (Start/Resume)	☐ Water Shut-Off
☐ Subsequent Report	☐ Alter Casing	☐ Hydraulic Fracturing	□ Reclamation	■ Well Integrity
	□ Casing Repair	■ New Construction	☐ Recomplete	☐ Other
☐ Final Abandonment Notice	☐ Change Plans	☑ Plug and Abandon	□ Temporarily Abandon	
36	☐ Convert to Injection	☐ Plug Back	☐ Water Disposal	

13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection. determined that the site is ready for final inspection.

BP requests to P&A the subject well. Please see the attached P&A procedure, wellbore diagram, and BLM required reclamation plan documents.

In accordance with NMOCD Pit Rule 19.15.17.9 NMAC, BP will use a closed-loop system during

Notify NMOCD 24 hrs prior to beginning operations

MMOCD

AUG 0 2 2018

	NISTRICT III
14. I hereby certify that the foregoing is true and correct.	gara.

Electronic Submission #421180 verified by the BLM Well Information System For BP AMERICA PRODUCTION COMPANY, sent to the Farmington Committed to AFMSS for processing by JACK SAVAGE on 08/01/2018 (18JWS0166SE)

Name (Printed/Typed) TOYA COLVIN Title **REGULATORY ANALYST**

05/23/2018

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Date 08/01/2018 Approved By JACK SAVAGE TitlePETROLEUM ENGINEER

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Office Farmington

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on page 2) ** BLM REVISED ** BLM REVISED ** BLM REVISED ** BLM REVISED **





PLUG AND ABANDONMENT PROCEDURE

May 21, 2018

NEBU 420

Basin Fruitland Coal 1030' FNL & 1485' FEL, Section 28, T-31-N, R-7-W San Juan County, New Mexico / API 30-045-27286

Note: All cement volumes use 100% excess outside pipe and 50' excess inside. The stabilizing wellbore fluid will be 8.3 ppg, sufficient to balance all exposed formation pressures. All cement will be Class G, mixed at 15.8 ppg with a 1.15 cf/sx yield.

1.	nstall and test location rig anchors. Comply with all NMOCD, BLM, and Operator safety egulations. MOL and RU daylight pulling unit. Conduct safety meeting for all personnel on ocation. Record casing, tubing and bradenhead pressures. NU relief line and blow down well.		
	Kill well with water as necessary and at least pump tubing capacity of water down the tubing. ND wellhead and NU BOP. Function test BOP.		
2.	Rods: YesX, No, Unknown, Size _2-3/8", Length _ 3256' Packer: YesX, No, Unknown, Type		

- 3. Plug #1 (Fruitland perforations and top, 5 ½" Liner top, 2941' 2841'): Round trip 7" gauge ring to 2941' or as deep as possible. RIH and set 7" CR at 2941'. Circulate well clean. Pressure test casing to 800#. If casing does not test then spot or tag subsequent plugs as appropriate. Spot 29 sxs Class G cement inside casing from 2941' to cover the Fruitland top. PUH.
- 4. Plug #2 (Kirtland and Ojo Alamo tops, 2330' 2050'): Mix 64 sxs Class G cement inside casing to cover the Kirtland and Ojo Alamo tops. TOH and LD tubing. PUH.
- 5. Plug #3 (9 5/8" surface casing shoe, 349' Surface): Attempt to pressure test the bradenhead annulus to 300 PSI; note the volume to load. If the BH annulus holds pressure, then establish circulation out casing valve with water. Mix approximately 68 sxs cement and spot a balanced plug from 349' to surface, circulate good cement out casing valve. TOH and LD tubing. Shut well in and WOC. If the BH annulus does not test, then perforate at the appropriate depth and attempt to circulate cement to surface filling the casing and annulus from the squeeze holes to surface. Shut in well and WOC.
- ND cementing valves and cut off wellhead. Fill annuli with cement as necessary. Install P&A
 marker to comply with regulations. Record GPS coordinate for P&A marker on tower report.
 Photograph P&A marker in place. RD, MOL and cut off anchors. Restore location per BLM
 stipulations

NEBU 420


Proposed P&A

Basin Fruitland Coal 1030' FNL & 1485' FEL, Section 28, T-31-N, R-7-W San Juan County, NM, API #30-045-27286

Today's Date: 5/21/2018

Spud: 10/8/89 Completed: 10/18/89 Elevation: 6378' GL

12.25" hole

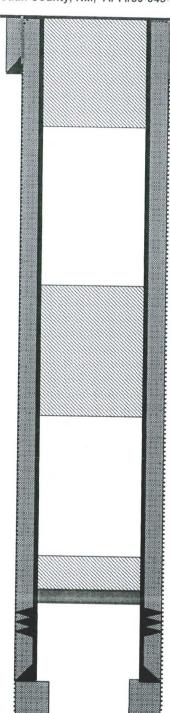

9.625" 23# Casing set @ 299' Cement with 250 sxs, circulated

> Plug #3: 349' - 0' Class G cement, 68 sxs

Plug #2: 2330' - 2050' Class G cement, 64 sxs

Plug #1: 2941' - 2841' Class G cement, 29 sxs

Fruitland @ 2980'

Ojo Alamo @ 2100'

Kirtland @ 2280'

8.75" hole

PBTD N/A TD 3275' Set CR @ 2941'

Fruitland Coal Perforations: 2991' – 3275'

7" 23# Casing set at 2991' Cement with 585 sxs, circulated

5.5" Liner hanger @ 2955' Open Hole to 3275'

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT FARMINGTON DISTRICT OFFICE

6251 COLLEGE BLVD. FARMINGTON, NEW MEXICO 87402

Attachment to notice of Intention to Abandon:

Re: Permanent Abandonment

Well: NEBU 420

CONDITIONS OF APPROVAL

- 1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal and Indian Lease."
- 2. Farmington Office is to be notified at least 24 hours before the plugging operations commence (505) 564-7750.
- 3. The following modifications to your plugging program are to be made:
 - a) Set Plug 1 (2941 2830) ft. to cover the Fruitland top. BLM picks top of Fruitland at 2880 ft.
 - b) Set Plug 2 (2350 2155) ft. to cover the Kirtland top. BLM picks top of Kirtland at 2320 ft. BLM picks top of Ojo Alamo at 1610 ft.
 - c) Add a cement plug (760 660) ft. to cover the Nacimiento top. BLM picks top of Nacimiento at 710 ft.

You are also required to place cement excesses per 4.2 and 4.4 of the attached General Requirements.

Office Hours: 7:45 a.m. to 4:30 p.m.