

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENTFORM APPROVED
OMB NO. 1004-0137
Expires: January 31, 2018**SUNDRY NOTICES AND REPORTS ON WELLS**
*Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.*5. Lease Serial No.
NMSF078109

6. If Indian, Allottee or Tribe Name

7. If Unit or CA/Agreement, Name and/or No.
NMNM939998. Well Name and No.
GALLEGOS CANYON UNIT 5129. API Well No.
30-045-28221-00-S110. Field and Pool or Exploratory Area
WEST KUTZ PICTURED CLIFFS11. County or Parish, State
SAN JUAN COUNTY, NM**SUBMIT IN TRIPLICATE - Other instructions on page 2**

1. Type of Well

☐ Oil Well ☒ Gas Well ☐ Other

2. Name of Operator

BP AMERICA PRODUCTION COMPANY

Contact: PATTI CAMPBELL

Email: patti.campbell@bpx.com

3a. Address

380 AIRPORT RD
DURANGO, CO 81303

3b. Phone No. (include area code)

Ph: 970-712-5997

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

Sec 26 T29N R12W NWSE 1620FSL 1850FEL
36.694280 N Lat, 108.065140 W Lon

12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

☒ Notice of Intent☐ Subsequent Report☐ Final Abandonment Notice

TYPE OF ACTION

☐ Acidize☐ Alter Casing☐ Casing Repair☐ Change Plans☐ Convert to Injection☐ Deepen☐ Hydraulic Fracturing☐ New Construction☒ Plug and Abandon☐ Plug Back☐ Production (Start/Resume)☐ Reclamation☐ Recomplete☐ Temporarily Abandon☐ Water Disposal☐ Water Shut-Off☐ Well Integrity☐ Other

13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleat horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleat in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.

BP requests to P&A the subject well. Please see the attached P&A procedure, wellbore diagrams and BLM required reclamation plan documents.

In accordance with NMOCD Pit Rule 19.15.17.9 NMAC, BP will use a closed-loop system during operations.

Notify NMOCD 24 hrs
prior to beginning
operations

NMOCD

AUG 03 2018

DISTRICT III

14. I hereby certify that the foregoing is true and correct.

Electronic Submission #426710 verified by the BLM Well Information System
For BP AMERICA PRODUCTION COMPANY, sent to the Farmington
Committed to AFMSS for processing by JACK SAVAGE on 07/09/2018 (18JWS0152SE)

Name (Printed/Typed) PATTI CAMPBELL

Title REGULATORY ANALYST

Signature (Electronic Submission)

Date 07/09/2018

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved By JACK SAVAGE

Title PETROLEUM ENGINEER

Date 07/09/2018

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Office Farmington

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on page 2)

** BLM REVISED ** BLM REVISED ** BLM REVISED ** BLM REVISED ** BLM REVISED **

NMOCD AV

4

PLUG AND ABANDONMENT PROCEDURE

January 10, 2018

Gallegos Canyon Unit #512

West Kutz Pictured Cliffs

1530' FSL and 1715' FWL, Section 26, T29N, R12W

San Juan County, New Mexico / API 30-045-28221

Note: All cement volumes use 100% excess outside pipe and 50' excess inside. The stabilizing wellbore fluid will be 8.3 ppg, sufficient to balance all exposed formation pressures. All cement will be Class B, mixed at 15.6 ppg with a 1.18 cf/sx yield.

1. Install and test location rig anchors. Comply with all NMOCD, BLM, and Operator safety regulations. MOL and RU daylight pulling unit. Conduct safety meeting for all personnel on location. Record casing, tubing and bradenhead pressures. NU relief line and blow down well. Kill well with water as necessary and at least pump tubing capacity of water down the tubing. ND wellhead and NU BOP. Function test BOP.
2. Rods: Yes____, No X, Unknown____.
Tubing: Yes X, No____, Unknown____, Size 2-3/8", Length 1463'.
Packer: Yes____, No X, Unknown____, Type _____.
3. **Plug #1 (Pictured Cliffs perfs and top, Fruitland top, 1356' – 1063')**: Round trip 4.5" gauge ring or mill to 1356' or as deep as possible. RIH and set 4.5" CR at 1356'. Pressure test tubing to 1000#. Circulate well clean. Pressure test casing to 800#. If casing does not test then spot or tag subsequent plugs as appropriate. Mix 27 sxs Class B cement inside casing from 1356' to 1063' to isolate the Pictured Cliffs interval and cover Fruitland top. PUH.
4. **Plug #2 (Kirtland, Ojo Alamo tops and 7" casing shoe, 326' – 0')**: Attempt to pressure test the bradenhead annulus to 300 PSI; note the volume to load. If the BH annulus holds pressure, then establish circulation out casing valve with water. Mix approximately 30 sxs cement and spot a balanced plug from 326' to surface, circulate good cement out casing valve. TOH and LD tubing. Shut well in and WOC. If the BH annulus does not test, then perforate at the appropriate depth and attempt to circulate cement to surface filling the casing and annulus from the squeeze holes to surface. Shut in well and WOC.
5. ND cementing valves and cut off wellhead. Fill annuli with cement as necessary. Install P&A marker to comply with regulations. Record GPS coordinate for P&A marker on tower report. Photograph P&A marker in place. RD, MOL and cut off anchors. Restore location per BLM stipulations

Gallegos Canyon Unit #512

Proposed P&A

West Kutz Pictured Cliffs

1530' FSL, 1715' FWL, Section 26, T-29-N, R-12-W

San Juan County, NM, API #30-045-28221

Today's Date: 1/10/18

Spud: 1/1/91

Completed: 2/20/91

Elevation: 5397' GL

8.75" hole

Ojo Alamo @ 98'

Kirtland @ 273'

Fruitland @ 1113'

Pictured Cliffs @ 1406'

6.25" hole

TD 1546'
PBD 1509'

Circulated cement to surface

Plug #2: 326' - 0'
Class B cement, 30 sxs

7" 20# Casing set @ 276'
Cement with 250 sxs, circulated to surface.

Plug #1: 1356' - 1063'
Class B cement, 27 sxs

Set CR @ 1356'

Pictured Cliffs Perforations:
1406' - 1442'

4.5", 10.5#, Casing set @ 1542'
Cement with 305 sxs, circulated to surface

UNITED STATES DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT
FARMINGTON DISTRICT OFFICE
6251 COLLEGE BLVD.
FARMINGTON, NEW MEXICO 87402

Attachment to notice of
Intention to Abandon:

Re: Permanent Abandonment
Well: Gallegos Canyon Unit 512

CONDITIONS OF APPROVAL

1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal and Indian Lease."

2. Farmington Office is to be notified at least 24 hours before the plugging operations commence (505) 564-7750.

3. The following modifications to your plugging program are to be made:

- a) Set Plug #1 (1356 - 1035) ft. to cover the Pictured Cliffs and Fruitland tops. BLM picks top of Fruitland at 1085 ft.

H₂S has not been reported in this section, however, very high concentrations of H₂S (900 ppm GSV) have been reported at the Crawford Com B #1 well located in the NWSW/4 Sec. 24, 29N, 12W.

You are also required to place cement excesses per 4.2 and 4.4 of the attached General Requirements.

Office Hours: 7:45 a.m. to 4:30 p.m.