UNITED STATES

DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

					()		
		Sundry Notic	ces and Report	s on Wel	ls o ou l	22	
	 -			700 SEP ?	A EU I	5.	Lease Number
Typ	pe of Well GAS			070 Fam	ington,	NM 6.	NMSF077730 If Indian, All. or Tribe Name
						7.	Unit Agreement Nam
	me of Oper						
	URLING						•
F	JESOUI	RCES OIL & GAS	COMPANY			8.	Well Name & Number
. Add	dress & Ph	one No. of Operato	or			0.	Sunray E #2M
PC	O Box 4289	, Farmington, NM	87499 (505)	326-9700		9.	· - · · · · · · · · · · · · · · · · · ·
. Loc	cation of	Well, Footage, Sec	C., T, R, M	··-		10	30-045-30838 . Field and Pool
		35'FWL, Sec.9, T-		NMPM	•		Blanco MV/Basin DK
						11	. County and State San Juan Co, NM
	HECK APPRO pe of Subm	OPRIATE BOX TO IND		OF NOTICE VDe of Ac		r, other	R DATA
- 71		ce of Intent	Abandonme	ent		ge of Pi	lans
			Recomple	tion _	New	Constru	ction
	X Subs	sequent Report	Plugging				Fracturing
	Fina	al Abandonment	Casing Re			r Shut (ersion (to Injection
			X_ Other -				co injection
	B 1 b -	Dunnand on Comple					
3.	Describe	Proposed or Comple	eted Operation	ns	<u>_</u>		
3.	8/15/03	MIRU. ND WH. NU	BOP. TOOH w/2	-3/8" tbg			
3.		MIRU. ND WH. NU I	BOP. TOOH w/2 D @ 7588'. Blo	-3/8" tbg ow hole c			
3.	8/15/03 8/18/03	MIRU. ND WH. NU 1 Circ & CO to PBTI set @ 7510'. So	BOP. TOOH w/2 D @ 7588'. Blowab well back	-3/8" tbg ow hole c . SDON.	lean. T	OOH w/m	ill. TIH w/CICR,
3.	8/15/03	MIRU. ND WH. NU I Circ & CO to PBT set @ 7510'. So TOOH w/CICR. TIH (Verbal approval	BOP. TOOH w/2 D @ 7588'. Blowab well back w/pkr, set @ from Wayne To	-3/8" tbg ow hole o . SDON. 7440'. S ownsend,	lean. To wab tes BLM, to	DOH w/m t. SDON set CIO	ill. TIH w/CICR, CR @ 7440'.) Rls
3.	8/15/03 8/18/03 8/19/03 8/20/03	MIRU. ND WH. NU I Circ & CO to PBT set @ 7510'. So TOOH w/CICR. TIH (Verbal approval pkr & TOOH w/p	BOP. TOOH w/2 D @ 7588'. Blowab well back w/pkr, set @ from Wayne To	-3/8" tbg ow hole o . SDON. 7440'. S ownsend,	lean. To wab tes BLM, to	DOH w/m t. SDON set CIO	ill. TIH w/CICR, CR @ 7440'.) Rls
3.	8/15/03 8/18/03 8/19/03	MIRU. ND WH. NU I Circ & CO to PBT set @ 7510'. So TOOH w/CICR. TIH (Verbal approval pkr & TOOH w/p Blow well & CO. TOOH. TIH w/pkr,	BOP. TOOH w/2 D @ 7588'. Blowab well back w/pkr, set @ from Wayne Tokr. TIH w/CIC	-3/8" tbg bw hole c . SDON. 7440'. S bwnsend, R, set @	wab tes BLM, to 7440'.	DOH w/mi t. SDON set CIO Blow we:	ill. TIH w/CICR, CR @ 7440'.) Rls ll overnight.
3.	8/15/03 8/18/03 8/19/03 8/20/03 8/21/03 8/22/03	MIRU. ND WH. NU I Circ & CO to PBT set @ 7510'. So TOOH w/CICR. TIH (Verbal approval pkr & TOOH w/p Blow well & CO. TOOH. TIH w/pkr, 7390'. Blow we	BOP. TOOH w/2 D @ 7588'. Blowab well back w/pkr, set @ from Wayne Tokr. TIH w/CIC	-3/8" tbg bw hole c . SDON. 7440'. S bwnsend, R, set @	wab tes BLM, to 7440'.	DOH w/mi t. SDON set CIO Blow we:	ill. TIH w/CICR, CR @ 7440'.) Rls ll overnight.
3.	8/15/03 8/18/03 8/19/03 8/20/03 8/21/03 8/22/03 8/23/03 8/24/03	MIRU. ND WH. NU I Circ & CO to PBT set @ 7510'. So TOOH w/CICR. TIH (Verbal approval pkr & TOOH w/p Blow well & CO. TOOH. TIH w/pkr, 7390'. Blow well. Blow well.	BOP. TOOH w/2 D @ 7588'. Blowab well back w/pkr, set @ from Wayne Tokr. TIH w/CIC set @ 7340'.	-3/8" tbg ow hole o . SDON. 7440'. S ownsend, R, set @ Swab wel	lean. To wab tes BLM, to 7440'.	DOH w/m. t. SDON set CIO Blow we Rls pk	ill. TIH w/CICR, CR @ 7440'.) Rls ll overnight. r & TOOH. TIH to
3.	8/15/03 8/18/03 8/19/03 8/20/03 8/21/03 8/22/03	MIRU. ND WH. NU I Circ & CO to PBT set @ 7510'. So TOOH w/CICR. TIH (Verbal approval pkr & TOOH w/p Blow well & CO. TOOH. TIH w/pkr, 7390'. Blow well. Blow well. Blow well. Blow well. TIH w	BOP. TOOH w/2 D @ 7588'. Blowab well back w/pkr, set @ from Wayne Tokr. TIH w/CIC set @ 7340'. ll. /238 jts 2-3/8	-3/8" tbg ow hole o . SDON. 7440'. S ownsend, R, set @ Swab wel	lean. To wab tes BLM, to 7440'.	DOH w/m. t. SDON set CIO Blow we Rls pk	ill. TIH w/CICR, CR @ 7440'.) Rls ll overnight. r & TOOH. TIH to
3.	8/15/03 8/18/03 8/19/03 8/20/03 8/21/03 8/22/03 8/23/03 8/24/03	MIRU. ND WH. NU I Circ & CO to PBT set @ 7510'. So TOOH w/CICR. TIH (Verbal approval pkr & TOOH w/p Blow well & CO. TOOH. TIH w/pkr, 7390'. Blow well. Blow well.	BOP. TOOH w/2 D @ 7588'. Blowab well back w/pkr, set @ from Wayne Tokr. TIH w/CIC set @ 7340'. ll. /238 jts 2-3/8	-3/8" tbg ow hole o . SDON. 7440'. S ownsend, R, set @ Swab wel	lean. To wab tes BLM, to 7440'.	DOH w/m. t. SDON set CIO Blow we Rls pk	ill. TIH w/CICR, CR @ 7440'.) Rls ll overnight. r & TOOH. TIH to
3.	8/15/03 8/18/03 8/19/03 8/20/03 8/21/03 8/22/03 8/23/03 8/24/03	MIRU. ND WH. NU I Circ & CO to PBT set @ 7510'. So TOOH w/CICR. TIH (Verbal approval pkr & TOOH w/p Blow well & CO. TOOH. TIH w/pkr, 7390'. Blow well. Blow well. Blow well. Blow well. TIH w	BOP. TOOH w/2 D @ 7588'. Blowab well back w/pkr, set @ from Wayne Tokr. TIH w/CIC set @ 7340'. ll. /238 jts 2-3/8	-3/8" tbg ow hole o . SDON. 7440'. S ownsend, R, set @ Swab wel	lean. To wab tes BLM, to 7440'.	DOH w/m. t. SDON set CIO Blow we Rls pk	ill. TIH w/CICR, CR @ 7440'.) Rls ll overnight. r & TOOH. TIH to
3.	8/15/03 8/18/03 8/19/03 8/20/03 8/21/03 8/22/03 8/23/03 8/24/03	MIRU. ND WH. NU I Circ & CO to PBT set @ 7510'. So TOOH w/CICR. TIH (Verbal approval pkr & TOOH w/p Blow well & CO. TOOH. TIH w/pkr, 7390'. Blow well. Blow well. Blow well. Blow well. TIH w	BOP. TOOH w/2 D @ 7588'. Blowab well back w/pkr, set @ from Wayne Tokr. TIH w/CIC set @ 7340'. ll. /238 jts 2-3/8	-3/8" tbg ow hole o . SDON. 7440'. S ownsend, R, set @ Swab wel	lean. To wab tes BLM, to 7440'.	DOH w/m. t. SDON set CIO Blow we Rls pk	ill. TIH w/CICR, CR @ 7440'.) Rls ll overnight. r & TOOH. TIH to
3.	8/15/03 8/18/03 8/19/03 8/20/03 8/21/03 8/22/03 8/23/03 8/24/03	MIRU. ND WH. NU I Circ & CO to PBT set @ 7510'. So TOOH w/CICR. TIH (Verbal approval pkr & TOOH w/p Blow well & CO. TOOH. TIH w/pkr, 7390'. Blow well. Blow well. Blow well. Blow well. TIH w	BOP. TOOH w/2 D @ 7588'. Blowab well back w/pkr, set @ from Wayne Tokr. TIH w/CIC set @ 7340'. ll. /238 jts 2-3/8	-3/8" tbg ow hole o . SDON. 7440'. S ownsend, R, set @ Swab wel	lean. To wab tes BLM, to 7440'.	DOH w/m. t. SDON set CIO Blow we Rls pk	ill. TIH w/CICR, CR @ 7440'.) Rls ll overnight. r & TOOH. TIH to
3.	8/15/03 8/18/03 8/19/03 8/20/03 8/21/03 8/22/03 8/23/03 8/24/03	MIRU. ND WH. NU I Circ & CO to PBT set @ 7510'. So TOOH w/CICR. TIH (Verbal approval pkr & TOOH w/p Blow well & CO. TOOH. TIH w/pkr, 7390'. Blow well. Blow well. Blow well. Blow well. TIH w	BOP. TOOH w/2 D @ 7588'. Blowab well back w/pkr, set @ from Wayne Tokr. TIH w/CIC set @ 7340'. ll. /238 jts 2-3/8	-3/8" tbg ow hole o . SDON. 7440'. S ownsend, R, set @ Swab wel	lean. To wab tes BLM, to 7440'.	DOH w/m. t. SDON set CIO Blow we Rls pk	ill. TIH w/CICR, CR @ 7440'.) Rls ll overnight. r & TOOH. TIH to
3.	8/15/03 8/18/03 8/19/03 8/20/03 8/21/03 8/22/03 8/23/03 8/24/03	MIRU. ND WH. NU I Circ & CO to PBT set @ 7510'. So TOOH w/CICR. TIH (Verbal approval pkr & TOOH w/p Blow well & CO. TOOH. TIH w/pkr, 7390'. Blow well. Blow well. Blow well. Blow well. TIH w	BOP. TOOH w/2 D @ 7588'. Blowab well back w/pkr, set @ from Wayne Tokr. TIH w/CIC set @ 7340'. ll. /238 jts 2-3/8	-3/8" tbg ow hole o . SDON. 7440'. S ownsend, R, set @ Swab wel	lean. To wab tes BLM, to 7440'.	DOH w/m. t. SDON set CIO Blow we: Rls pk:	ill. TIH w/CICR, CR @ 7440'.) Rls ll overnight. r & TOOH. TIH to 7409'. ND BOP.
	8/15/03 8/18/03 8/19/03 8/20/03 8/21/03 8/22/03 8/23/03 8/24/03 8/25/03	MIRU. ND WH. NU I Circ & CO to PBT set @ 7510'. So TOOH w/CICR. TIH (Verbal approval pkr & TOOH w/p. Blow well & CO. TOOH. TIH w/pkr, 7390'. Blow well. Blow well. Blow well. Blow well. TIH w NU WH. RD. Rig	BOP. TOOH w/2 D @ 7588'. Blo wab well back w/pkr, set @ from Wayne To kr. TIH w/CIC set @ 7340'. ll. /238 jts 2-3/6 released.	-3/8" tbg ow hole of . SDON 7440'. S ownsend, R, set @ . Swab wel . Swab wel	lean. To wab tes BLM, to 7440'. l back.	DOH w/m. t. SDON set CIO Blow we Rls pk: , set @	ill. TIH w/CICR, CR @ 7440'.) Rls ll overnight. r & TOOH. TIH to
3.	8/15/03 8/18/03 8/19/03 8/20/03 8/21/03 8/22/03 8/23/03 8/24/03 8/25/03	MIRU. ND WH. NU I Circ & CO to PBT set @ 7510'. So TOOH w/CICR. TIH (Verbal approval pkr & TOOH w/p Blow well & CO. TOOH. TIH w/pkr, 7390'. Blow well. Blow well. Blow well. Blow well. TIH w	BOP. TOOH w/2 D @ 7588'. Blo wab well back w/pkr, set @ from Wayne To kr. TIH w/CIC set @ 7340'. ll. /238 jts 2-3/6 released.	-3/8" tbg ow hole of . SDON 7440'. S ownsend, R, set @ . Swab wel . Swab wel	lean. To wab tes BLM, to 7440'. l back.	DOH w/m. t. SDON set CIO Blow we Rls pk: , set @	ill. TIH w/CICR, CR @ 7440'.) Rls ll overnight. r & TOOH. TIH to 7409'. ND BOP.
	8/15/03 8/18/03 8/19/03 8/20/03 8/21/03 8/22/03 8/23/03 8/24/03 8/25/03	MIRU. ND WH. NU I Circ & CO to PBT set @ 7510'. So TOOH w/CICR. TIH (Verbal approval pkr & TOOH w/p. Blow well & CO. TOOH. TIH w/pkr, 7390'. Blow well. Blow well. Blow well. Blow well. TIH w NU WH. RD. Rig	BOP. TOOH w/2 D @ 7588'. Blo wab well back w/pkr, set @ from Wayne To kr. TIH w/CIC set @ 7340'. ll. /238 jts 2-3/3 released.	-3/8" tbg ow hole of . SDON 7440'. S ownsend, R, set @ . Swab wel . Swab wel	lean. To wab tes BLM, to 7440'. l back.	COH w/m. t. SDON set CIO Blow we Rls pk: , set @	ill. TIH w/CICR, CR @ 7440'.) Rls ll overnight. r & TOOH. TIH to 7409'. ND BOP.
4. Signed	8/15/03 8/18/03 8/19/03 8/20/03 8/21/03 8/22/03 8/23/03 8/24/03 8/25/03	MIRU. ND WH. NU I Circ & CO to PBT set @ 7510'. So TOOH w/CICR. TIH (Verbal approval pkr & TOOH w/pk Blow well & CO. TOOH. TIH w/pkr, 7390'. Blow well. Blow well. Blow well. Blow well. RIOH. RIG	BOP. TOOH w/2 D @ 7588'. Blo wab well back w/pkr, set @ from Wayne To kr. TIH w/CIC set @ 7340'. ll. /238 jts 2-3/ released. foregoing is	-3/8" tbg bw hole c . SDON. 7440'. S bwnsend, R, set @ Swab wel 3" 4.7# J	lean. To wab tes BLM, to 7440'. l back.	DOH w/m. t. SDON set CIO Blow we Rls pk. , set @	ill. TIH w/CICR, CR @ 7440'.) Rls ll overnight. r & TOOH. TIH to 7409'. ND BOP.