

RECOMMENDED PROCEDURE FOR WORKOVER ON
LONE PINE UNIT #26

- (1) MIRU PU.
- (2) Unseat tbg and tally out of hole.
- (3) RIN w/2 7/8 tbg and squeeze Dakota "D" zone (2774-80') below Mod "D" Packer @ 2725' w/100 sxs Class "A" Cement.
- (4) Pull up 4 jts and spot 120' cement on Mod "D", then reverse out remaining cement.
- (5) Pull 2 7/8 tbg.
- (6) Run CCL & CBL from PBTD to top of cement in 5 1/2 by 8 5/8 Annulus.
- (7) Perforate 5 1/2 csg @ top of cement and squeeze w/50 sxs cement under fullbore packer set 100' above perforations.
- (8) Shut-in and WOC.
- (9) Pull tbg and treating packer.
- (10) Drill out cement.
- (11) Perforate 1762' - 1802' 40' w/2 JSPF.
- (12) Run 2 7/8 tbg and land bottom @ 1700'±.
- (13) Hookup to line and start injection.