Form approved. Budget Bureau No. 1004-0135 UNITED STATES

BUBMIT IN TRIPLICATE®

Other Instructions on reverse alde) Form 3160-5 Expires August 31, 1985 (November 1983) 5. LEASE DESIGNATION AND SERIAL NO. (Formerly 9-331) BUREAU OF LAND MANAGEMENT MM 5980 IP INDIAN, ALLOTTER OR TRIBE NAME SUNDRY NOTICES AND REPORTS ON WELLS (Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.

Use "APPLICATION FOR PERMIT—" for such proposals.) 7. UNIT AGREEMENT NAME GAS WELL WELL X OTHER 2. NAME OF OPERATOR S. PARM OR LEASE MAME Texaco Inc. <u>Federal</u> 3. ADDRESS OF OPERATOR P.O. Box EE, Cortez, CO. 81321

LOCATION OF WELL (Report location clearly and in accordance with any State requirements.\*

See also space 17 below.)

At surface

RECEIVI 10. FIELD AND POOL, OR WILDCAT RECEIVED Ojo Encino
11. SEC., T., R., M., OR BLK. AND
SURVEY OR ARMA 2310' FSL, 2310' FWL JUL 1 5 1985 Sec. 21, T20N, R5W BUREAU OF LAND MANAGEMENT
15. BLEVATIONS (Show WARRINGTOOK MEECURCE AREA 14. PERMIT NO. 12. COUNTY OR PARISH 18. STATE 6787' KB McKinley <u>NewMexic</u>o 16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: TEST WATER SHUT-OFF PULL OR ALTER CASING WATER SHUT-OFF REPAIRING WELL FRACTURE TREAT MULTIPLE COMPLETE FRACTURE TREATMENT ALTERING CASING XX SHOOT OR ACIDIZE ABANDON\* SHOOTING OR ACIDIZING ABANDON MENT REPAIR WELL CHANGE PLANS (Other) (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) (Other) 17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and sones pertinent to this work.) Texaco proposes to abandon this well using the following procedure, subject to managerial approval. Approval of this procedure should be granted within 90 days. Your office will be notified prior to initiating plugging operation so that a representative can witness. PROCEDURE: MIRUSU. Drill and clean out to top of CIBP @ 5600' KB. w/9.2 lb/gal. mud. Spot a 20 sx class B neat cement plug on top of CIBP. Displace w/mud. Pull tubing up to 5088'. Spot a 40 sx cement plug. Displace w/mud. 3.) TOOH. Shoot 4-way squeeze shot @ 3550'. Spot 35 sx cement plug @ 3550'. 4.) squeeze into formation. Leave 20 sxs inside casing. 5.) Set cement retainer @ 2000' KB. Squeeze open perfs with 75 sxs of cement. 6.) Load hole w/mud. 7.) Shoot 4-way squeeze shot @ 930' KB. Spot 35 sxs cement plug @ 930'. squeeze into formation, leave 20 sxs inside casing. 8.) Shoot 4-way squeeze shot @ 265' KB. Fill casing inside and annuals w/110 sxs of class B neat cement from 265' to surface. Erect P & A Marker and clean location. 18. I hereby certify that the foregoing is true and correct K. Mang TITLE Area Superintend SIGNED ent 7/9/85 (This space for Federal or State office use) APPROVED BY TITLE \_ JUL 1 8 1985 CONDITIONS OF APPROVAL, IF ANY: BLM (5) - NMOGCC (3) - JNH-AJS-ARM

\*See Instructions on Revert Side 3

OIL CON. DI

AREA MANAGER

FARMING ON RESOURCE AREA