

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

NM-15646

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Federal 21

9. WELL NO.

2

10. FIELD AND POOL, OR WILDCAT

Undesignated Entrada

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Sec. 21, T20N, R5W

12. COUNTY OR PARISH

McKinley

13. STATE

N. Mexico

SUNDRY NOTICES AND REPORTS ON WELLS
(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)1. OIL ☒ GAS ☐ OTHER ☐
WELL WELL

2. NAME OF OPERATOR

Dome Petroleum Corporation

3. ADDRESS OF OPERATOR c/o Minerals Management Inc.

501 Airport Dr., Suite 105, Farmington, N. Mex. 87401

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface

2310' FNL, 2310' FWL, Sec. 21, T20N, R5W

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

6806' GR 6818' KB

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐FRACTURE TREAT ☐SHOOT OR ACIDIZE ☐REPAIR WELL ☐(Other) ☐PULL OR ALTER CASING ☐MULTIPLE COMPLETE ☐ABANDON* ☐CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐FRACTURE TREATMENT ☐SHOOTING OR ACIDIZING ☒(Other) ☐REPAIRING WELL ☐ALTERING CASING ☐ABANDONMENT* ☐(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any
proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones perti-
nent to this work.)*

9-12-76 Drill DV Tool, pressure test casing to 3000 psi, ok.

9-13-76 Run cement bond-correlation log. Perforate 5910'-5915' with
2 JSPF. Run packer. Swab 80% water.9-16-76 Pull packer - perforate 5934'-5944' with 4 JSPF. Set cement
retainer at 5850'.

9-17-76 Cement squeeze with 100 sacks cement to 2600 psi.

9-20-76 Drill cement to 5926'. Reperforated 5910'-5915' with 2 JSPF.

9-21-76 Run tubing and swab test (50% water).

18. I hereby certify that the foregoing is true and correct

SIGNED

J. Arnold Swell

TITLE Area Mgr./Minerals Mgt. DATE Sept. 29, 1976

(This space for Federal or State office use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

*See Instructions on Reverse Side